

Our reference: 21-8041
Date: 29/8/2021

INVOICE NO. 8041

Tan Kuan Joong
c/o Garage 13 Pte Ltd
8 Kaki Bukit Ave 4
#03-46 Premier@KB
Singapore 415875

Registration No. **SLQ7220D**

We enclose our fee note for your kind attention, which remains payable irrespective of the outcome of this case.

S/No.	Description of Services Provided	Qty	Amount
1	Being vehicle damage assessment report, inspection, photographs, transport and miscellaneous.	1	\$864.00
Total amount			<u><u>\$864.00</u></u>

Please kindly cross all cheques made payable to "Impact Analysis Consultant".

We thank you in anticipation for your prompt payment.



L. L. Tan (Ms)
Principal Consultant

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsultingsg.com

Our reference: 21-8041

Date: 29/8/2021

c/o Garage 13 Pte Ltd
8 Kaki Bukit Ave 4
#03-46 Premier@KB
Singapore 415875

Dear Sirs

**RE: Road Traffic Accident on 18/8/2021
Tan Kuan Joong**

In accordance with your instructions received in this office on **19/8/2021**, we made arrangements to examine the vehicle on **19/8/2021** at above-mentioned address. The following data was recorded:


Vehicle details

Make	Hyundai	Registration	SLQ7220D
Model	Elantra	Chassis	KMHD841CMJU509382
Colour	Blue	Gearbox	Auto
Odometer	*	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

Tyre Depths

Front left	195/65R15	85% Yokohama
Front right	195/65R15	85% Yokohama
Rear left	195/65R15	85% Yokohama
Rear right	195/65R15	85% Yokohama

Impact Direction & Area of Damage:

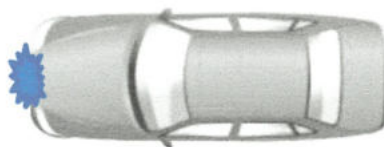

Status	REPAIRABLE
Magnitude	Medium
Legal status	Unroadworthy

Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of **\$16,321.61** and **10** working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
 - IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
- www.iaconsultingsg.com

Our reference 21-8041

Date 29/8/2021

Page 2

Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items :				
Bonnet	1	buckled	895.12	895.12
Bonnet hinge @\$65.30	2	bent	130.60	130.60
Bonnet lock	1	damaged.jammed	121.50	121.50
Bonnet insulator	1	crumpled	165.40	165.40
Bonnet cable bracket	1	bent	45.80	45.80
Front bumper	1	crushed	952.30	952.30 498.20
Front bumper lower lid (rubber)	1	torn	166.90	166.90
Front bumper side retainer @\$36.50	2	cracked	73.00	73.00
Front bumper top rubber	1	abraded	58.90	58.90
Front bumper sponge	1	compressed.torn	221.00	221.00 130.20
Front bumper lower beam (plastic)	1	cracked	168.70	168.70
Front bumper inner rail guide	1	broken	185.10	185.10
Front bumper reinforcement	1	bent	515.10	515.10 435
Front bumper bracket @\$98.96	2	bent	197.92	197.92
Front bumper under cover	1	damaged	185.40	185.40
Front bumper lower grille	1	damaged	195.60	195.60
Front bumper fog lamp @\$265.70	2	damaged	531.40	531.40
Front bumper fog lamp garnish @\$95.00	2	damaged	190.00	190.00
Front bumper tow cover	1	dislodged	35.50	35.50
Front bumper air curtain	1	damaged	198.75	198.75
Front radiator grille outer chrome	1	broken	422.00	422.00 395.50
Front radiator grille assy	1	broken	298.90	298.90
Front radiator grille logo	1	necessary	52.00	52.00
Front support panel (plastic)	1	broken	711.20	711.20
Front support panel top garnish	1	cracked	175.00	175.00
Headlamp @\$1254.80 @763.80	2	cracked	2509.60	2509.60 1527.60

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsulting.sg.com

Our reference 21-8041

Date 29/8/2021

Headlamp bracket (plastic) @\$102.50	2	cracked	205.00	205.00	
Horn	1	cut	99.00	99.00	
Horn bracket	1	bent	29.00	29.00	
Radiator	1	crushed	1042.50	1042.50	685.20
Radiator fan motor	1	ceased	322.00	322.00	
Radiator fan cowling	1	damaged	215.00	215.00	
Radiator fan blade	1	damaged	201.00	201.00	
Radiator bracket @\$38.50	2	damaged	77.00	77.00	
Radiator spare tank	1	deformed	122.00	122.00	
Radiator side garnish @\$55.20	2	cracked	110.40	110.40	
Radiator neck c/w cap	1	crackd	114.00	114.00	
Radiator fan sensor	1	damaged	75.90	75.90	
Aircon condenser	1	crushed	1125.00	1125.00	526.80
Aircon condenser pipes	set	bent	289.50	289.50	
Air filter box	1	cracked	312.00	312.00	
Air filter box inlet duct	1	damaged	221.00	221.00	
Air filter box connection joint	1	cracked	185.00	185.00	
Resonator box	1	cracked	275.80	275.80	
Aircon condenser thermostat	1	broken	102.50	102.50	
Aircon condenser thermostat cable	1	torn	99.00	99.00	
Manifold cover	1	cracked	425.50	425.50	
Front fender rh	1	crushed	598.10	598.10	
Front fender inner shield rh	1	refix	113.20	0.00	xnn
Front chassis member lh - bent	1	re-straighten	548.90	0.00	xR
Front fender inner panel rh	1	repair.respray	322.10	0.00	xR
Sub- Total cost			16633.09	15648.89	
Percentage discount : 20%			3326.62	3129.78	13059.89
Sub-Total costs for parts			13306.47	12519.11	10447.91

Special Nett Items:

Front bumper clips	set	necessary	50.00	50.00	30
Front number plate garnish	1	necessary	95.00	95.00	15

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
 - IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
- www.iaconsultingsg.com

Our reference 21-8041

Date 29/8/2021

Front number plate	1	missing	50.00	50.00	30
Front wire harness	1	abraded	150.00	150.00	
Front radiator grille clips	set	damaged	20.00	20.00	
Front support panel top garnish clips	set	necessary	20.00	20.00	
Sub-Total costs for parts			385.00	385.00	265

Parts Repair

*	*	*	0.00	0.00	
Sub- Total costs			0.00	0.00	
Total costs for parts			13691.47	12904.11	

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd ● Impact Analysis Academy Pte Ltd ● IA Racking Solutions Pte Ltd
 - IA Accounting & Consultancy Pte Ltd ● Infoknights International Services (Philippines) ● IABN Pte Ltd
- www.iaconsultingsg.com

Our reference 21-8041

Date 29/8/2021

Page 3

Section B: Labour Cost Calculation

	Hourly rate	Manhr. Req.	Total	
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	37	\$ 1,665.00	1000
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.	Sub-contract work.		\$ 1,100.00	1000
Apply rust proofing on the adjacent panels.	Sub-contract work.		\$ 60.00	40
Remove / replace aircon condenser and refill aircon gas	\$ 45.00	3	\$ 135.00	100
Remove / refix radiator, top up coolant & conduct pressure test	\$ 45.00	2	\$ 90.00	60
Specialist charges - Dignostic fault code / reset			\$ 100.00	
Specialist charges - Conduct front chassis alignment	-	-	\$ 200.00	
Wiring / bulb checking (inclusive of re-focus / re-adjust on angle of light intensity.)	\$ 45.00	1.5	\$ 67.50	30
Total labour cost			\$ 3,417.50	2630

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

13,342.91
l/s\$10,650
8 days

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsultingsg.com

Section C: Summary Table of Total Repair Cost

Description		Cost
Damaged Parts Assessment (See section A)		\$12,904.11
Labour Cost Calculation (See section B)		\$3,417.50
Total cost		\$16,321.61
Part-By-Part		\$0.00
Further discount	0%	
Total Repair Cost		\$16,321.61

We would recommend a sum of **\$16,321.61** and **10** working days for repair.
No further items will be approved without our expressed written agreement. Any significant additional items will be subject to a supplementary report.



Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)
B.Eng. (Hons, NUS)
Diploma.Mechanical Engineering
NTC-2 Automovite Technology
Sr.MIES, Institution of Engineers, Singapore (#20100091)
MATAI, Maryland Association of Traffic Accident Investigators
IAARS, International Association of Accident Reconstruction Specialists
PMC of Singapore Business Advisors & Consultants Council
ACTA certified Trainer, Singapore
Enterprise Singapore - Recognised Certification for Management Consultants
IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd
• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd
www.iaconsultingsg.com