

APPRAISAL OF VEHICLE AFTER REPAIRS

Ministry of Defence
HQ - Transport Command
Kranji Camp 3, 151 Choa Chu Kang Way
Singapore 688248

Our File No: **DSTA21-100030**
IOD No.: **CY20/21/0024**
Insured Name: **Ministry of Defence**

Date: 19-Nov-21

REFERENCE

Mindef Veh No: GBF8432D/MID46356
Date of loss: 19-Oct-21
Claimant Veh No: GBD161Z

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBD161Z	Engine No:	4D56UCEX5513
Make:	MITSUBISHI	Chassis No:	MMBJYKB40FD008673
Model:	L200 TRITON DOUBLE CAB A/T NO SUNROOF	Reg Date:	07-May-14
Odometer:	347157 km	Engine Cap:	2477 cc
Colour:	White		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

(STATIC ONLY)

General Condition:	Fair	Steering:	Serviceable	Modification:	No
Rims:	Standard	Brakes:	Serviceable		

CONDITION OF TYRES

Front Left Size:	Yokohama 245/70R18 3mm	Front Right Size:	Yokohama 245/70R18 3mm
Rear Left Size:	Yokohama 245/70R18 3mm	Rear Right Size:	Yokohama 245/70R18 3mm

The above "mm" represent the remaining life of the tyre threads

COST OF REPAIRS	Repairer's S\$	Adjuster's S\$	Difference S\$
Parts	14,408.76	5,651.87	8,756.89
Labour	4,560.00	2,510.00	2,050.00
Calculated Cost (S\$) :	18,968.76	8,161.87	10,806.89

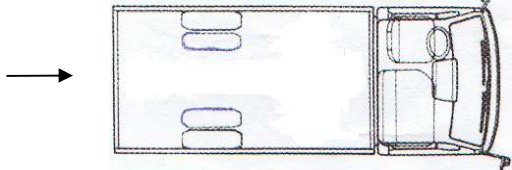
Recommended Lump Sum Repair Cost (S\$) : 6,500.00

INSPECTION

Date of Assignment:	21-Oct-21	Inspected At:	TeamWork Garage Pte Ltd
Date Inspected:	21-Oct-21		53 Ubi Avenue 1
Est. repair Period:	7 days		#01-23/24 Paya Ubi Industrial Park
Repair status:	Surveyed on a "Without Prejudice" Basis		Singapore 408934

DSTA21-100030
GBD161Z

POINT OF IMPACT

The vehicle sustained damages to the rear portion .	
------------------------------------------------------------	------------------------------------------------------------------------------------

BRIEF CIRCUMSTANCES OF ACCIDENT

Mindef's vehicle and Third Party's vehicle collided at along **Choa Chu Kang Drive**.

CONSISTENCY OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are consistent with the accident as reported, please refer to ANNEX A & ANNEX B.

SPECIAL REMARKS

1. In accordance with your instruction, we have not authorised repair. Under normal circumstances, estimated **7 working days** are required to repair the vehicle.
2. This inspection was conducted on a "Without Prejudice" Basis.
3. We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



Jason Lek, MSAAA
Automobile Appraisal

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

DSTA21-100030
GBD161Z

ANNEX A

REPAIR DETAILS

The vehicle sustained damages to the rear portion.

NO	QTY	PARTICULARS	CONDITIONS/ REMARKS	REPAIRER'S AMOUNT (\$)	ADJUSTER'S AMOUNT (\$)
		<u>PARTS (LIST ITEMS)</u>			
1	1	Rear End Panel	Buckled	750.00	750.00
2	2	Rear Bumper Damper	Cut	77.00	77.00
3	1	Rear Bumper Lower Reinforcement	Bent	385.00	385.00
4	2	Rear Bumper Side Reflector	Smashed	108.00	108.00
5	2	Rear Bumper Lower Reflector	Cracked/Missing	418.00	418.00
6	1	Tailgate	Buckled	787.60	787.60
7	2	Tailgate Hinge	Bent	129.80	129.80
8	1	Tailgate Emblem - Logo	Necessary	59.40	59.40
9	1	Tailgate Emblem - Sportero	Necessary	60.50	60.50
10	1	Tailgate Emblem - L200	Necessary	32.60	32.60
11	1	Tailgate Outer Handle	Serviceable	104.60	-
12	1	Tailgate Inner Trim Board	Serviceable	495.00	-
13	1	Tailgate Lock	Bent	132.00	132.00
14	1	Tailgate Lower Member	Bent	495.00	495.00
15	2	Taillamp	Broken/Cut	415.80	415.80
16	1	Floor Panel	Repair	3,562.90	-
17	2	Rear Fender	Buckled	1,232.00	1,232.00
18	2	Rear Fender Mudflap	Deformed	145.40	145.40
19	2	Rear Wheel Arc Garnish	Deformed	596.20	596.20
20	1	Cabin Head End Panel	Repair	2,799.00	-
21	1	Fuel Tank	Serviceable	1,205.60	-
22	1	Fuel Tank Cap	Repair	385.00	-
				14,376.40	5,824.30
		Less	10%	1,437.64	582.43
			Sub-total:	12,938.76	5,241.87

DSTA21-100030
GBD161Z

ANNEX A

REPAIR DETAILS

NO	QTY	PARTICULARS	CONDITIONS/ REMARKS	REPAIRER'S AMOUNT (\$)	ADJUSTER'S AMOUNT (\$)
		<u>SPECIAL NETT ITEMS</u>			
1	1 Set	Rear Bumper Clip	Not Necessary	40.00	-
2	1 Set	Rear Number Plate	Bent	80.00	45.00
3	1	Windscreen Sealant	Not Necessary	120.00	-
4	1	Tailgate Sticker - 70km	Necessary	80.00	15.00
5	1 Set	Reverse Sensor	Bent/Malfunction	300.00	200.00
6	1	Tailgate Rubber	Not Necessary	150.00	-
7	2	Rear Fender Rubber @ \$150.00	Necessary	300.00	150.00
8	1	Floor Carpet	Serviceable	400.00	-
			Sub-total:	1,470.00	410.00
			Total Parts :	14,408.76	5,651.87

DSTA21-100030
GBD161Z

ANNEX B

REPAIR DETAILS

The vehicle sustained damages to the rear portion.

NO	PARTICULARS	REPAIRER'S AMOUNT (\$)	ADJUSTER'S AMOUNT (\$)
1	Check wiring and lighting system.	60.00	20.00
2	Remove trims & garnishes for hotwork repair.	200.00	80.00
3	Remove and refit exhaust silencer.	150.00	-
4	Remove, refit rear windscreen.	200.00	100.00
5	Remove, refit and replace reverse sensor.	200.00	50.00
6	Panel beating on affected areas.	1,800.00	1,000.00
7	Spray painting on affected areas.	1,800.00	1,200.00
8	Apply anti rust on affected areas.	150.00	60.00
Total labour :		4,560.00	2,510.00

ANNEX C

REPAIR DETAILS

ADJUSTED REPAIR COSTS	REPAIRER'S AMOUNT (\$)	ADJUSTER'S AMOUNT (\$)
Total Parts cost :	14,408.76	5,651.87
Total Labour cost :	4,560.00	2,510.00
Total repair cost :	18,968.76	8,161.87
Adjusted Repair Cost (Lump Sum Repair) :		6,500.00