



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2108522

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 10/12/2021
Reference CC4/FCI21012191/Upa3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMW 8856U
Insured Veh. SBS 6408U
Claim No. D21003326MFBP
Policy No.
Accident Date 30/11/2021
Inspection Date 01/12/2021

Description	Total
Survey Inspection	522.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	522.00
GST (7%)	36.54
Grand Total	558.54

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21012191/Upa3q2	
			Date: 10/12/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SBS 6408U	Veh. Inspected	SMW 8856U
	Policy No.		Coverage (\$)	0.00
	Claim No.	D21003326MFBP	Excess (\$)	0.00
	Assign From	RACHEL WU	Assign Date	01/12/2021
2. Vehicle Particulars & Condition				
	Make & Model	HYUNDAI AVANTE (A)	c.c	1598
	Engine No.	HIDDEN	Year of Reg.	2020
	Chassis No.	KMHLN41ETMU066619	Colour	GREY
	Odometer	12311 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/55 R16	PIRELLI	7 mm
	L/H Front Tyre	205/55 R16	PIRELLI	7 mm
	R/H Rear Tyre	205/55 R16	HANKOOK	7 mm
	L/H Rear Tyre	205/55 R16	HANKOOK	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT AND N/S REAR PORTION.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/11/2021	Inspection Date	01/12/2021
	Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMW 8856U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT HEAD LAMP LH	NOT NECESSARY	3,458.00	-
1	FRONT HEAD LAMP LOWER BRACKET LH	NOT NECESSARY	33.60	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	1,202.20	-
1	FRONT BUMPER	DEEP CUT	966.20	494.40
1	FRONT BUMPER SIDE RETAINER LH	NECESSARY	38.40	38.40
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	627.00	-
1	FRONT BUMPER FOG LAMP LH	NOT NECESSARY	324.00	-
1	FRONT BUMPER LOWER SPOILER	NOT NECESSARY	352.10	-
1	FRONT BUMPER INNER SPONGE	NOT NECESSARY	186.20	-
1	FRONT BUMPER CENTRE BLACK MOULDING LH	NOT NECESSARY	41.70	-
1	FRONT BUMPER FOG LAMP SIDE GARNISH LH	NOT NECESSARY	58.70	-
1	FRONT FENDER LH	TO REPAIR SEE LABOUR	1,272.00	-
1	FRONT FENDER MUDFLAP LH	GRAZED	112.30	88.50
1	FRONT LOWER ARM LH	BENT	465.20	465.20
1	FRONT KNUCKLE ARM LH	WARPED	765.20	765.20
1	FRONT ABSORBER LH	BENT	340.00	340.00
1	FRONT HUB BEARING LH	DAMAGED	445.00	445.00
1	FRONT DRIVE SHAFT LH	NOT NECESSARY	926.30	-
1	FRONT STEERING RACK	NOT NECESSARY	996.20	-
1	FRONT STABILIZER LINK LH	NOT NECESSARY	156.20	-
1	FRONT DOOR SIDE MIRROR ASSY	CUT / DAMAGED	1,054.00	820.00
1	REAR BUMPER	DEEP CUT	625.00	495.00
1	REAR BUMPER SIDE RETAINER LH	NECESSARY	28.30	28.30
	LESS 20% DISCOUNT		-2,894.76	-796.00
			11,579.04	3,184.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT SPORT RIM LH (SN)	CUT / BENT	1,800.00	700.00
1	FRONT TYRE LH (LOCAL PURCHASE) (70%) (\$200.00) (SN)	GRAZED	850.00	140.00
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	60.00	40.00

Report Ref No. CC4/FCI21012191/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT GRILLE & TOP COVER CLIP (SN)	NOT NECESSARY	50.00	-
1	SET FRONT FENDER INNER SHIELD CLIP (SN)	NOT NECESSARY	80.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	40.00
			2,920.00	920.00
	LABOUR			
	TO CHECK WIRING .		150.00	20.00
	TUFF KOTE.	NOT NECESSARY	180.00	-
	TO CHECK WHEEL ALIGNMENT.		120.00	100.00
	REMOVE & REPLACE FRONT SUSPENSION UNDERCARRIAGE & SUSPENSION LH .		550.00	150.00
	REMOVE AND REFIX AIRCOND CONDENSER & REFILL GAS.	NOT NECESSARY	150.00	-
	REMOVE AND REFIX RADIATOR .	NOT NECESSARY	120.00	-
	TO REMOVE AND REPLACE SPARE PART AND PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRONT FENDER LH .		1,500.00	580.00
	TO SPRAY PAINTING AND ETC.		1,500.00	1,300.00
			4,270.00	2,150.00
GRAND TOTAL			18,769.04	6,254.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,000.00

Report Ref No. CC4/FCI21012191/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 8856U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

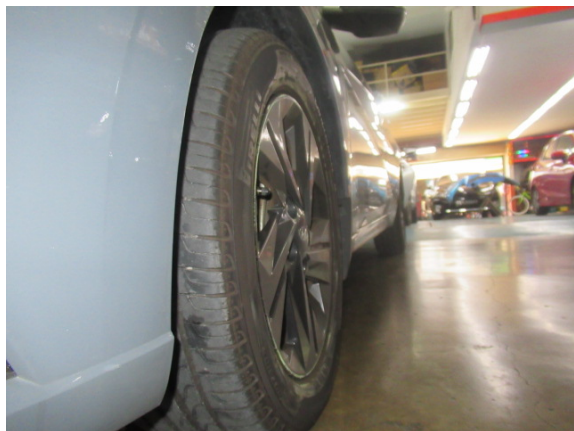



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 8856U

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

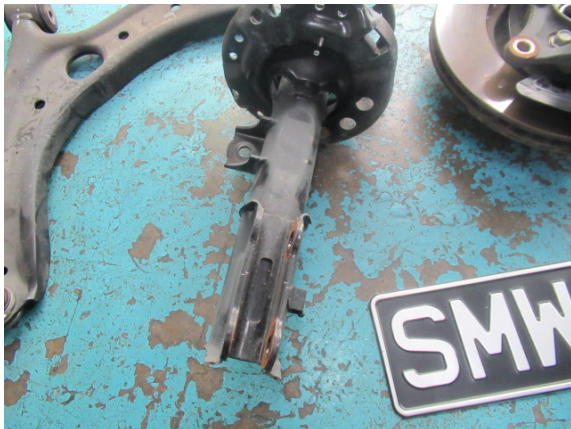




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

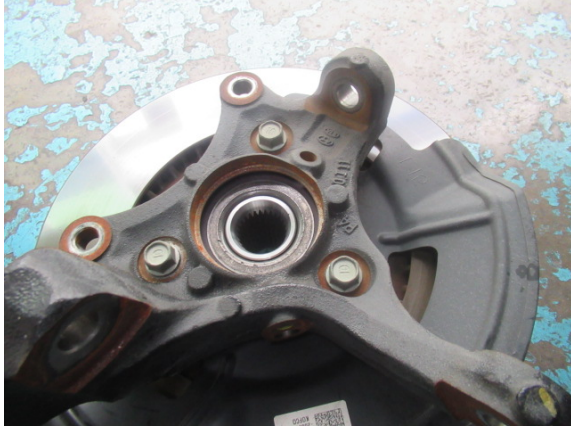



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 8856U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

