



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2201373

INV Date 14/03/2022

Reference CC4/LPC21012357/Uea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GP 1199L
Insured Veh. YN 8022P
Claim No. 21/21/21/VC05/025219
Policy No. Z21VC05007419
Accident Date 06/12/2021
Inspection Date 07/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21012357/Uea3q2 Date: 14/03/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YN 8022P	Veh. Inspected	GP 1199L
	Policy No.	Z21VC05007419	Coverage (\$)	0.00
	Claim No.	21/21/21/VC05/025219	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	07/12/2021
2. Vehicle Particulars & Condition				
	Make & Model	NISSAN NV350 (M)	c.c	2488
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	JN1MC2E26Z0005245	Colour	SILVER
	Odometer	134252 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195 R15	TOYO	7 mm
	L/H Front Tyre	195 R15	TOYO	7 mm
	R/H Rear Tyre	195 R15	TOYO	7 mm
	L/H Rear Tyre	195 R15	TOYO	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION AND REAR WINDSCREEN SHATTERED. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	06/12/2021	Inspection Date	07/12/2021
	Survey held at	AUTOLUTION INDUSTRIAL PTE LTD 19 UBI ROAD 4 SINGAPORE 408623		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GP 1199L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR TOP UNDER MIRROR (N)	NOT NECESSARY	112.00	-
1	LH RR COMB LAMP (SCRATCHED) (N)	OLD DAMAGED	224.80	-
1	RH RR COMB LAMP (N)	CRACKED	224.80	136.00
1	EMBLEM -BACK DOOR URVAN (N)	NECESSARY	64.90	39.27
1	EMBLEM-BACK DOOR MV350 (N)	NECESSARY	110.00	66.55
1	EMBLEM-REAR NISSAN (N)	NECESSARY	64.90	39.27
1	INNER CENTER BRACKET RR BUMPER (N)	TO REPAIR SEE LABOUR	171.90	-
10	CLIP RR BUMPER @\$1.30 (N)	NECESSARY	13.00	7.90
1	REAR BUMPER (N)	DISTORTED	667.20	403.66
1	TAILGATE LOCK (N)	DENTED/ JAMMED	287.10	173.70
1	STRIKER -TAIL GATE (N)	NOT NECESSARY	34.80	-
1	WEATHERSTRIP TAILGATE (N)	NOT NECESSARY	134.30	-
1	LH STAY TAILGATE (N)	NOT NECESSARY	215.90	-
1	RH STAY TAILGATE (N)	NOT NECESSARY	215.90	-
1	INNER SCREEN TAIL GATE (N)	NOT NECESSARY	16.20	-
1	TAIL GATE (N)	DENTED	1,998.30	1,208.98
1	CHROME TAILGATE FINISHER (N)	CRACKED	535.70	324.10
1	GLASS -TAIL GATE (N)	SHATTERED	891.00	539.06
	LESS 20% DISCOUNT		-1,196.54	-
			4,786.16	2,938.49
<u>SPECIAL NETT ITEMS</u>				
1	CENTER TOP 3RD BRAKE LAMP (SN)	NOT NECESSARY	237.50	-
1	RR WINDOW WIPER ARM COVER (SN)	NOT NECESSARY	13.10	-
1	RR WINDOW WIPER BLADE (SN)	NOT NECESSARY	26.90	-
1	RR WINDOW WIPER ARM (SN)	NOT NECESSARY	75.20	-
1	REAR WIPER MOTOR (SN)	NOT NECESSARY	242.00	-
1	SUNDRIES (SN)	NOT NECESSARY	100.00	-
1	REAR LICENSE PLATE (SN)	NOT NECESSARY	60.00	-
1	70KM/H STICKER (SN)	NECESSARY	15.00	15.00
1	SENSOR -REVERSE (SN)	TORN	250.00	250.00

Report Ref No. CC4/LPC21012357/Uea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR W/SCREEN SEALANT (SN)	NECESSARY	80.00	80.00
			1,099.70	345.00
	LABOUR			
	LABOR CHARGES TO REPAIR TRUNKFLOOR INNER END PANEL BOTH INNER PANEL RR FENDER ,RENEW OUTER END PANEL RR BUMPER AND TAIL GATE.INCLUSIVE OF THE REPAIR OF INNER CENTER BRACKET RR BUMPER.		2,730.00	1,520.00
	CHARGES TO SPRAY PAINTING TRUNKFLOOR INNER/OUTER END PANEL,BOTH RR FENDER INNER EXTENSION ,RR BUMPR AND TAIL GATE.		2,000.00	1,100.00
	REMOVE AND INSTALL TAILGATE MECHANISM.		80.00	80.00
	RENEW REAR WINDSCREEN GLASS .		240.00	180.00
	RENEW REAR WINDSCREEN GLASS SOLAR FILM.	NOT NECESSARY	150.00	-
	RENEW REVERSE SENSOR .		110.00	55.00
	RENEW BOTH RR COMB LAMP AND CHECK WIRING SYSTEM RR .		48.00	48.00
	COMPUTER CHECK DIAGNOSIS.		120.00	120.00
	SUPPLY REAR LICENSE PLATE (NPA)	NOT NECESSARY	-	-
			5,478.00	3,103.00
GRAND TOTAL			11,363.86	6,386.49
RECOMMENDED COST OF REPAIRS				6,386.49

Report Ref No. CC4/LPC21012357/Uea3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GP 1199L

INSPECTION

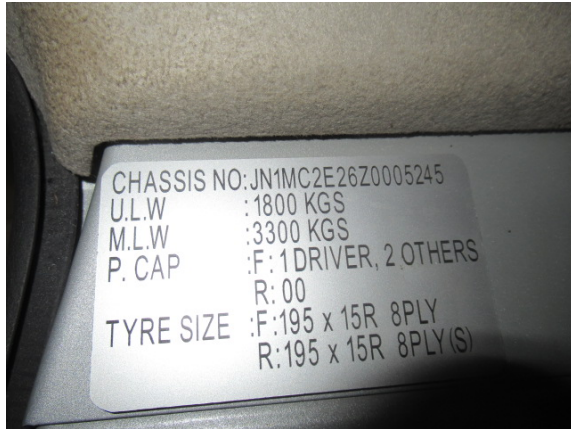



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GP 1199L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GP 1199L

RE-INSPECTION

