



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2200416

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 18/01/2022
Reference CC4/FCI21012479/Era3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. YQ 3208M

Insured Veh. YQ 3820U

Claim No. D21003401MFCV

Policy No.

Accident Date 08/12/2021

Inspection Date 21/12/2021

Description	Total
Survey Inspection	440.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	440.00
GST (7%)	30.80
Grand Total	470.80

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21012479/Era3q2 Date: 18/01/2022 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YQ 3820U	Veh. Inspected	YQ 3208M	
Policy No.		Coverage (\$)	0.00	
Claim No.	D21003401MFCV	Excess (\$)	0.00	
Assign From	ESTHER	Assign Date	09/12/2021	
2. Vehicle Particulars & Condition				
Make & Model	mitsubishi fuso fm65	c.c	7545	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	FM65FMA40038	Colour	BLUE	
Odometer	34059 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	11 R22.5	DUNLOP	4 mm	
L/H Front Tyre	11 R22.5	DUNLOP	4 mm	
R/H Rear Tyre	11 R22.5	DUNLOP	4 mm	
L/H Rear Tyre	11 R22.5	DUNLOP	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	08/12/2021	Inspection Date	21/12/2021	
Survey held at	GOLDBELL ENGINEERING PTE LTD 10 TUAS AVE 18 SINGAPORE 638894			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YQ 3208M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	GLASS WINDSHIELD	BROKEN	3,914.53	3,914.53
1	WEATHERSTRIP ,WINDSHIELD	CUT	960.65	960.65
1	MARK ,FUSO	NECESSARY	540.00	540.00
1	MARK ,THREE-DIA	NECESSARY	66.89	66.89
1	MARK ,FIGHTER	NECESSARY	114.41	114.41
1	PANEL,WINDSHIELD ,LWR	TO REPAIR SEE LABOUR	371.20	-
1	TAPE ,WINDSHIELD PANEL BLACK OUT	NOT NECESSARY	398.49	-
1	REINFORCEMENT ,DASH PANEL	NOT NECESSARY	1,769.57	-
1	PANEL ,CAB ,FR	DENTED	4,510.76	4,510.76
1	STRIKER ,FR PANEL LATCH	NOT NECESSARY	35.37	-
1	GRILLE ASSY ,FRONT	CUT	1,175.69	1,175.69
1	ARM ,WINDSHIELD WIPER ,LH	NOT NECESSARY	307.08	-
1	BLADE ,WINDSHIELD WIPER	NOT NECESSARY	102.67	-
1	COVER ,WINDSHIELD WIPER ARM HEAD LH	NOT NECESSARY	17.56	-
1	TUBE ,WINDSHIELD WASHER	NOT NECESSARY	20.14	-
1	NOZZLE ,WINDSHIELD WASHER LH	NOT NECESSARY	60.56	-
1	BRACKET ,RR VIEW MIRROR STAY ,UPR LH	BROKEN	81.00	81.00
1	BRACKET ,RR VIEW MIRROR STAY ,LWR LH	BROKEN	70.50	70.50
1	STAY ,RR VIEW MIRROR LH	NOT NECESSARY	1,750.72	-
1	BAR ,RR VIEW MIRROR STAY PROP ,LH	NOT NECESSARY	281.46	-
1	STAY ,RR VIEW MIRROR ,UPR	NOT NECESSARY	640.31	-
1	STAY ,RR VIEW MIRROR ,LWR LH	NOT NECESSARY	178.36	-
1	MIRROR ,FR UNDER VIEW	MISSING	129.60	129.60
1	COVER ,RR VIEW MIRROR	MISSING	36.79	36.79
1	MIRROR ,SIDE UNDER VIEW	MISSING	145.80	145.80
1	COVER ,RR VIEW MIRROR	MISSING	38.84	38.84
1	MIRROR ,RR VIEW ,LH	NOT NECESSARY	172.80	-
1	COVER ,RR VIEW MIRROR	MISSING	117.65	117.65
	LESS 25% DISCOUNT		-4,502.35	-2,975.76
			13,507.05	8,927.35

Report Ref No. CC4/FCI21012479/Era3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	IU BRACKET (SN)	NECESSARY	26.00	26.00
1	WINDSCREEN SEALANT (SN)	NECESSARY	80.00	80.00
1	FRONT PANEL COMPANY STICKER (SN)	NECESSARY	500.00	300.00
			606.00	406.00
	<u>LABOUR</u>			
	TO REMOVE AND REFIX FRONT WINDSCREEN .		200.00	200.00
	TO REMOVE AND REFIX DAMAGED PARTS ,CUT ,WELD ,PANEL BEAT, STRAIGHTEN & REALIGN ,ETC.INCLUSIVE OF THE REPAIR OF PANEL,WINDSHIELD ,LWR.		3,000.00	1,200.00
	TO CHECK FOR AND RECTIFY WIRING FAULTS ,TO CONDUCT DIAGNOSTICS CHECK .		180.00	80.00
	TO REMOVE AND INSTALL MOBILEYE .		350.00	300.00
	TO PUTTY ,CLEAN ,SPRAY PAINT AND POLISH ,ETC.		900.00	525.00
			4,630.00	2,305.00
GRAND TOTAL			18,743.05	11,638.35
RECOMMENDED COST OF REPAIRS				11,638.35

Report Ref No. CC4/FCI21012479/Era3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YQ 3208M

INSPECTION

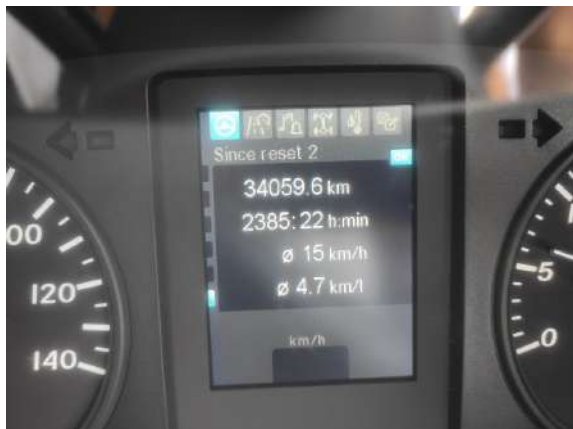



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. YQ 3208M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

