

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD INV No. AC2303898

3 ANSON ROAD #16-00 INV Date 19/06/2023

SPRINGLEAF TOWER Reference CC3/CTI21012796/Kya3q2 SINGAPORE 079909

Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMZ 7720T

Insured Veh. GBJ 6922Z

Claim No. SNM21D207330/C02

Policy No. DMCVSNW00075772102

Accident Date 15/12/2021

Inspection Date 16/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

3	HINA TAIPING IN	SURANCE (S) PTE LTD	Ref:	OO0/OTIO4040700/I/: 0 0
			Nei.	CC3/CTI21012796/Kya3q2
	ANSON ROAD #1 PRINGLEAF TOW	16-00 /ERSINGAPORE 079909	Date:	19/06/2023
			Code:	СТІ
1.	Policy Particulars :- THIRD PARTY CLAIM			
Ir	nsured Veh.	GBJ 6922Z	Veh. Inspected	SMZ 7720T
Р	olicy No.	DMCVSNW00075772102	Coverage (\$)	0.00
С	laim No.	SNM21D207330/C02	Excess (\$)	0.00
Α	ssign From		Assign Date	16/12/2021
2.		Vehicle Partic	culars & Condition	
M	lake & Model	TOYOTA PRIUS (A)	c.c	1798
E	ingine No.	HIDDEN	Year of Reg.	2021
С	Chassis No. JTDKB3FU903092920 Colour		Colour	METALLIC PEARL WHITE
0	dometer	66300 KM	Steering	IN ORDER
В	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
G	General	GOOD		
3.		Conditi	ons of Tyres	
		Size	Make	Balance
R	/H Front Tyre	195/65 R15	SAILUN	9 mm
L	/H Front Tyre	195/65 R15	SAILUN	9 mm
R	/H Rear Tyre	195/65 R15	SAILUN	9 mm
L	/H Rear Tyre	195/65 R15	SAILUN	9 mm
4.	Description of Damages			
T	HE VEHICLE SUS	STAINED DAMAGES AT THE O/S	BODY.	
D	AMAGES SEE DE	ETAILS.		
5.		Genera	I Information	
Α	ccident Date	15/12/2021	Inspection Date	16/12/2021
s	Survey held at	TRANS-CAB AUTO SERVICES	PTE LTD	
		NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a.		Re	emarks	
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
	Estimate Days of Repair			
5b.				



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMZ 7720T

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	PANEL SUB-ASSY, FRONT DOOR, RH	BENT	1,300.70	1,300.70
1	LOCK ASSY, FRONT DOOR W/MOTOR, RH	TO REPAIR SEE LABOUR	603.20	-
1	MOULDING, FRONT DOOR WINDOW FRAME, FRONT RH	SERVICEABLE	38.60	-
1	FRAME SUB-ASSY, FRONT DOOR OUTSIDE HANDLE, RH	SERVICEABLE	193.50	-
1	HANDLE ASSY, FRONT DOOR, OUTSIDE RH	SERVICEABLE	390.60	-
1	MOTOR ASSY, POWER WINDOW REGULATOR, RH	SERVICEABLE	926.00	-
1	WEATHERSTRIP, FRONT DOOR OPENING TRIM, RH	SERVICEABLE	321.10	-
1	HINGE ASSY, FRONT DOOR, LOWER RH	TO REPAIR SEE LABOUR	110.60	-
1	HINGE ASSY, FRONT DOOR, UPPER RH	TO REPAIR SEE LABOUR	97.50	-
1	REGULATOR SUB-ASSY, FRONT DOOR WINDOW, RH	TO REPAIR SEE LABOUR	238.30	-
1	TAPE, BLACK OUT, NO.2 FRT RH	NECESSARY	43.50	43.50
1	TAPE, BLACK OUT, NO.1 FRT RH	NECESSARY	13.30	13.30
1	TAPE, BLACK OUT, NO.3 FRT RH	NECESSARY	26.30	26.30
1	PANEL SUB-ASSY, REAR DOOR, RH	BENT	1,294.90	1,294.90
1	FRAME SUB-ASSY, REAR DOOR OUTSIDE HANDLE, RH	SERVICEABLE	193.50	-
1	HANDLE ASSY, REAR DOOR OUTSIDE, RH	SERVICEABLE	97.40	-
1	WEATHERSTRIP, REAR DOOR OPENING TRIM, RH	SERVICEABLE	293.00	-
1	MOTOR ASSY, POWER WINDOW REGULATOR, REAR RH	SERVICEABLE	926.00	-
1	REGULATOR SUB-ASSY, REAR DOOR WINDOW, RH	SERVICEABLE	206.70	-
1	TAPE, BLACK OUT, NO.2 REAR RH	NECESSARY	34.90	34.90
1	TAPE, BLACK OUT, NO.3 REAR RH	NECESSARY	15.40	15.40
1	TAPE, BLACK OUT, NO.1 REAR RH	NECESSARY	21.90	21.90
1	HINGE ASSY, REAR DOOR, LOWER RH	TO REPAIR SEE LABOUR	87.10	-
1	HINGE ASSY, REAR DOOR, UPPER RH	TO REPAIR SEE LABOUR	98.90	-
1	MIRROR ASSY, OUTER REAR VIEW, RH	SERVICEABLE	1,436.60	-
1	PANEL SUB-ASSY, QUARTER, RH	TO REPAIR SEE LABOUR	871.50	-

Report Ref No. CC3/CTI21012796/Kya3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	LINER, REAR WHEEL HOUSE, RH	SERVICEABLE	139.80	- (Ψ)
	MOULDING ASSY, BODY ROCKER PANEL, RH	BENT	594.80	594.80
	FENDER SUB-ASSY, FRONT RH	TO REPAIR SEE LABOUR	977.80	-
1	COVER, REAR BUMPER	TO REPAIR SEE LABOUR	485.60	-
	LESS 25% DISCOUNT		-3,019.75	-836.42
			9,059.25	2,509.28
	SPECIAL NETT ITEMS			
1	REAR FENDER LINER CLIP (SN)	NOT NECESSARY	65.00	-
1	FRT FENDER LINER CLIP (SN)	NOT NECESSARY	65.00	-
1	REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	75.00	-
2	DOOR TRIM CLIP (SN)	NOT NECESSARY	150.00	-
2	DOOR WEATHERSTRIP CLIP (SN)	NOT NECESSARY	160.00	-
			515.00	-
	<u>LABOUR</u>			
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		240.00	60.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.		380.00	60.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF LOCK ASSY, FRONT DOOR, W/MOTOR, RH, HINGE ASSY, FRONT DOOR, LOWER RH, HINGE ASSY, FRONT DOOR, UPPER RH, REGULATOR SUB-ASSY, FRONT DOOR WINDOW, RH, HINGE ASSY, REAR DOOR, UPPER RH, PANEL SUB-ASSY, QUARTER, RH, FENDER SUB-ASSY, FRONT RH AND COVER, REAR BUMPER.		1,600.00	600.00
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		1,600.00	1,100.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00

Report Ref No. CC3/CTI21012796/Kya3q2



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO REMOVE AND REFIT OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
			5,100.00	1,900.00
	GRAND TOTAL		14,674.25	4,409.28

RECOMMENDED COST OF REPAIRS 4,409.28

Report Ref No. CC3/CTI21012796/Kya3q2

KONG SENG CHEONG

Licensed Appraiser



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMZ 7720T

INSPECTION












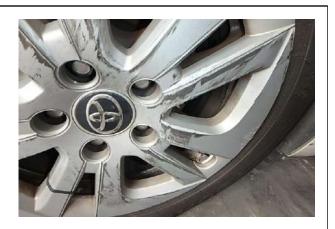




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

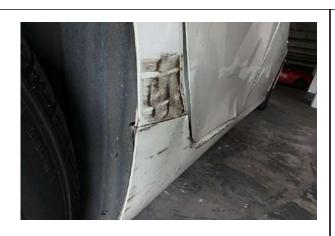














51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



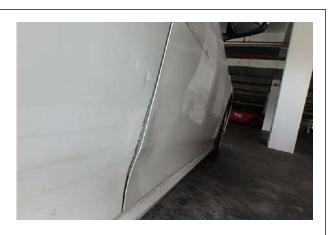











51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMZ 7720T

RE-INSPECTION





