



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2202518

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/05/2022
Reference CC6/CTI21013083/Kpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJN 8576K
Insured Veh. GBG 1146X
Claim No. SNM21D207384/C02
Policy No. DMCVSNW00048042100
Accident Date 17/12/2021
Inspection Date 22/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21013083/Kpa3q2 Date: 05/05/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBG 1146X	Veh. Inspected	SJN 8576K	
Policy No.	DMCVSNW00048042100	Coverage (\$)	0.00	
Claim No.	SNM21D207384/C02	Excess (\$)	0.00	
Assign From		Assign Date	22/12/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA WISH (A)	c.c	1794	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	JTDER12W603001932	Colour	METALLIC GREY	
Odometer	521299 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	ARIVO	5 mm	
L/H Front Tyre	205/55 R16	ARIVO	5 mm	
R/H Rear Tyre	205/55 R16	ROTALLA	7 mm	
L/H Rear Tyre	205/55 R16	ROTALLA	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/12/2021	Inspection Date	22/12/2021	
Survey held at	LOH HENG BLK 176 #03-08 SIN MING DRIVE SINGAPORE 575721			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJN 8576K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	BENT	1,068.00	1,068.00
1	BONNET LOCK	TO REPAIR SEE LABOUR	187.00	-
1	BONNET CHROME	MTG CRACKED	143.00	143.00
1	BONNET LOGO	NECESSARY	45.00	45.00
1	BONNET LOCK CABLE	SERVICEABLE	114.00	-
1	FRONT BUMPER	BUCKLED	789.00	789.00
1	FRONT BUMPER GRILLE	DENTED /WARPED	378.00	378.00
2	FRONT BUMPER SIDE RETAINER @\$78.00	N/S DISTORTED	156.00	78.00
2	HEADLAMP ASSY @\$736.00	MTG BROKEN	1,472.00	1,472.00
2	HEADLAMP LOWER BRACKET @\$105.00	TO REPAIR SEE LABOUR	210.00	-
2	HEADLAMP PANEL @\$157.00	TO REPAIR SEE LABOUR	314.00	-
1	BRACE PANEL	TO REPAIR SEE LABOUR	263.00	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	295.00	-
2	FOG LAMP GARNISH @\$69.00	SERVICEABLE	138.00	-
1	FRONT BUMPER SPONGE	SERVICEABLE	187.00	-
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	557.00	-
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	675.00	-
1	FRONT SUPPORT PANEL TOP GARNISH	SERVICEABLE	289.00	-
1	TAILGATE	BENT	1,293.00	1,293.00
1	TAILGATE CHROME GARNISH	CRACKED	285.00	285.00
1	TAILGATE INNER HANDLE	SERVICEABLE	136.00	-
1	TAILGATE INNER LOCK	DENTED	485.00	485.00
1	TAILGATE LOCK SENSOR	NO SUCH PARTS	334.00	-
1	TAILGATE STRIKER	TO REPAIR SEE LABOUR	38.00	-
1	TAILGATE TRIMBOARD	BUCKLED	445.00	445.00
2	TAILGATE HINGE @\$53.00	TO REPAIR SEE LABOUR	106.00	-

Report Ref No. CC6/CTI21013083/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE WINDSCREEN MOULDING	NECESSARY	69.00	69.00
2	TAILLAMP @\$589.00	CRACKED	1,178.00	1,178.00
1	REAR BUMPER	BENT	796.00	796.00
2	REAR BUMPER RETAINER @\$74.00	O/S DISTORTED	148.00	74.00
4	REAR BUMPER TOP BRACKET @\$63.00	NO SUCH PARTS	252.00	-
2	REAR BUMPER SIDE REFLECTOR @\$125.00	SERVICEABLE	250.00	-
1	REAR BUMPER LOWER COWLING	SERVICEABLE	398.00	-
1	END PANEL OUTER	BENT	785.00	785.00
1	END PANEL INNER	NO SUCH PARTS	696.00	-
1	END PANEL TOP GARNISH	DISTORTED	189.00	189.00
2	REAR FENDER INNER TRIM @\$363.00	DISTORTED / DENTED	726.00	726.00
2	REAR FENDER GLASS MOULDING @\$76.00	NOT NECESSARY	152.00	-
2	REAR FENDER @\$765.00	TO REPAIR SEE LABOUR	1,530.00	-
2	REAR FENDER COWLING @\$145.00	SERVICEABLE	290.00	-
1	SPARE TYRE COMPARTMENT MIDDLE BOARD	CRACKED	348.00	348.00
2	SPARE TYRE COMPARTMENT SIDE BOARD @\$196.00	N/S BUCKLED	392.00	196.00
1	TAILGATE WIPER MOTOR	SERVICEABLE	364.00	-
1	TAILGATE WIPER ARM	SERVICEABLE	82.00	-
1	FLOOR PANEL	TO REPAIR SEE LABOUR	894.00	-
	LESS 25% DISCOUNT		-4,985.25	-2,710.50
			14,955.75	8,131.50
1	TAILGATE WEATHERSTRIP (50%)	DISTORTED / DENTED L	185.00	92.50
	LESS 25% DISCOUNT		-46.25	-
			138.75	92.50
	SPECIAL NETT ITEMS			
8	BONNET INSULATOR CLIPS @\$3.50 (SN)	NECESSARY	28.00	28.00
1	REVERSE SENSOR (SN)	DENTED	280.00	200.00
10	FRONT BUMPER CLIPS @\$3.50(SN)	NECESSARY	35.00	35.00

Report Ref No. CC6/CTI21013083/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
6	FRONT SUPPORT PANEL TOP GARNISH CLIPS @\$3.50 (SN)	NOT NECESSARY	21.00	-
1	FRONT LICENCE PLATE & FRAME (SN)	BENT	55.00	45.00
14	REAR FENDER INNER TRIM CLIPS @\$3.50 (SN)	NECESSARY	49.00	49.00
1	FLOOR PANEL SEALANT (SN)	NOT NECESSARY	100.00	-
12	REAR FENDER COWLING CLIPS @\$3.50(SN)	NOT NECESSARY	42.00	-
6	END PANEL TOP GARNISH CLIPS @\$3.50(SN)	NECESSARY	21.00	21.00
8	REAR BUMPER LOWER COWLING CLIPS @\$3.50 (SN)	NOT NECESSARY	28.00	-
2	REAR FENDER GLASS SEALANT @\$80.00 (SN)	NOT NECESSARY	160.00	-
1	REAR LICENCE PLATE & FRAME (SN)	DENTED	55.00	45.00
4	TAILGATE CHROME GARNISH CLIPS @\$3.50 (SN)	NECESSARY	14.00	14.00
10	TAILGATE TRIMBOARD CLIPS @\$3.50(SN)	NECESSARY	35.00	35.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
12	REAR BUMPER CLIPS @\$3.50 (SN)	NECESSARY	42.00	42.00
1	END PANEL SEALANT (SN)	NECESSARY	100.00	30.00
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			1,195.00	584.00
	LABOUR			
	TO DISMANTLE /RENEW ACCIDENT DAMAGED PORTIONS TO PANEL BEAT ,RESHAPE ,STRAIGHTEN ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF BONNET LOCK,HEADLAMP LOWER BRACKET,HEADLAMP PANEL,BRACE PANEL,FRONT BUMPER REINFORCEMENT,FRONT SUPPORT PANEL,TAILGATE STRIKER,TAILGATE HINGE,REAR FENDER AND FLOOR PANEL.		1,600.00	1,300.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS ,RECONNECT AND CHECK FUNCTIONS INCLUDING FOCUSING HEADLAMPS & TAILLAMPS.		100.00	40.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA /PANEL.		1,600.00	1,400.00
	TO REMOVE,REFIT TAILGATE COMPONENTS TO REPLACE TAILGATE ,CHECK AND RE-ADJUST CLOSE GAP ,ALIGNMENT AND WATER SEEPAGE.		100.00	60.00
	TO REMOVE AND REFIT INTERIOR UPHOLSTERY TO FACILITATE REPAIR WORK.		200.00	100.00

Report Ref No. CC6/CTI21013083/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT BOTH REAR FENDER GLASS TO FACILITATE THE REPAIR.	NOT NECESSARY	300.00	-
	TO ALIGN REAR CHASSIS FRAME AND TO CONDUCT CHASIS ALIGNMENT ON CAR-O-LINER.	NOT NECESSARY	300.00	-
	TO REMOVE AND REFIT REAR WINDSCREEN TO FACILITATE REPAIR WORK.		150.00	120.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.		100.00	90.00
			4,450.00	3,110.00
GRAND TOTAL			20,739.50	11,918.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,100.00

Report Ref No. CC6/CTI21013083/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJN 8576K

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

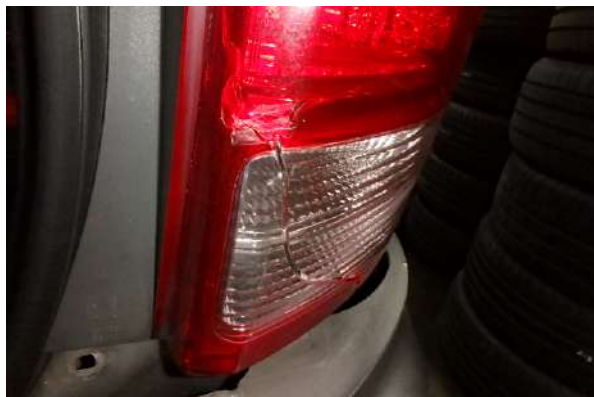



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

