



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203628

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 13/06/2022
Reference CC3/CTI21013114/Gea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 4209D
Insured Veh. XD 3882X
Claim No. SNM21D204474/C02
Policy No. DMCVSNA00004922101
Accident Date 12/08/2021
Inspection Date 24/12/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21013114/Gea3q2 Date: 13/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 3882X	Veh. Inspected	SHC 4209D	
Policy No.	DMCVSNA00004922101	Coverage (\$)	0.00	
Claim No.	SNM21D204474/C02	Excess (\$)	0.00	
Assign From		Assign Date	24/12/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	JTDKN36U905766317	Colour	MAROON	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	6 mm	
L/H Front Tyre	195/65 R15	SAILUN	6 mm	
R/H Rear Tyre	195/65 R15	SAILUN	6 mm	
L/H Rear Tyre	195/65 R15	SAILUN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	12/08/2021	Inspection Date	24/12/2021	
Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4209D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
10	BUMPER CLIPS @\$2.10 (DISC 25%)	NECESSARY	21.00	15.75
1	BUMPER SIDE RETAINER RR/RH (DISC 25%)	DEFORMED	94.80	71.10
1	BUMPER REAR (DISC 25%)	CRACKED	458.60	343.95
1	BUMPER FRT (DISC 25%)	DEFORMED	482.00	361.50
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.08
1	FENDER FRT/RH (DISC 25%)	BUCKLED	723.40	542.55
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.93
1	FENDER LINER FRT/RH (DISC 25%)	DEFORMED	171.70	128.78
1	DOOR FRT/RH (DISC 25%)	BENT	894.40	670.80
1	HINGE LOWER RHF, DOOR (DISC 25%)	BENT	90.10	67.58
1	HINGE UPPER RHF ,DOOR (DISC 25%)	BENT	80.50	60.38
1	CHECK ASSY ,FR DOOR (DISC 25%)	BENT	150.30	112.73
1	DOOR OUTER HANDLE FRT/RH (DISC 25%)	CUT	370.80	278.10
1	DOOR LOCK FRT/RH (DISC 25%)	JAMMED	575.80	431.85
1	DOOR RR/RH (DISC 25%)	BENT	954.50	715.88
1	DOOR LOCK RR/RH (DISC 25%)	JAMMED	709.30	531.98
1	DOOR HINGE LOWER RR/RH (DISC 25%)	BENT	90.10	67.58
1	DOOR HINGE UPPER RR/RH (DISC 25%)	BENT	90.10	67.58
1	CHECK ASSY ,RR DOOR (DISC 25%)	BENT	150.30	112.73
1	DOOR OUTER HANDLE RR/RH (DISC 25%)	BENT	69.80	52.35
1	FENDER RR/RH (DISC 25%)	BUCKLED	766.80	575.10
1	DOOR GLASS RR/RH (DISC 25%)	SMASHED	420.30	315.23
1	BUMPER LIP COVER RR/RH (DISC 25%)	CRACKED	118.10	88.58
1	FENDER PROTECTOR FRT/RH SIDE (DISC 25%)	CRACKED	113.90	85.43
1	DOOR REGULATOR SUB-ASSY ,FRT/REAR RH (DISC 25%)	BENT	224.80	168.60
1	DOOR REGULATOR SUB-ASSY ,FRT/REAR RH (DISC 25%)	BENT	224.80	168.60
1	FRAME SUB-ASSY ,REAR DOOR OUTSIDE HANDLE (DISC 25%)	BROKEN	138.90	104.18
1	BUMPER SUPPORT F/RH (DISC 25%)	BROKEN	76.40	57.30
1	GUIDE SUB-ASSY ,RR DOOR RH (DISC 25%)	BENT	74.00	55.50

Report Ref No. CC3/CTI21013114/Gea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL LAMP RH (DISC 10%)	CRACKED	557.80	502.02
1	LENS & BODY ,FR TURN RH (DISC 10%)	CRACKED	511.80	460.62
1	HEAD LAMP RH (DISC 10%)	CRACKED	945.20	850.68
1	DOOR REGULATOR MOTOR FRONT RH (DISC 10%)	NOT WORKING	947.80	853.02
1	DOOR REGULATOR MOTOR REAR RH (DISC 10%)	NOT WORKING	947.80	853.02
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	STICKER DECAL SMRT (DOOR) (SN)	NECESSARY	60.00	60.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 65558888 (SN)	NECESSARY	21.60	21.60
1	SOLAR FILM (SIDE WINDOW GLASS) (SN)	NECESSARY	125.00	125.00
1	SOLAR FILM (SN)	NECESSARY	125.00	125.00
1	BUMPER REINFORCEMENT REAR	NOT NECESSARY	205.70	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
1	BUMPER SEAL ,RR RH	NOT NECESSARY	65.70	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	BUMPER LIP REAR	NOT NECESSARY	228.90	-
1	UNDER COVER RR SHIELD	NOT NECESSARY	63.90	-
1	DUCT ASSY ,QAUARTER	NOT NECESSARY	70.40	-
1	TYRE	NOT NECESSARY	126.74	-
1	WHEEL HUB REAR	NOT NECESSARY	489.40	-
1	SHOCK ABSORBER REAR	NOT NECESSARY	112.30	-
1	LENS & BODY ,FR TURN RH	NOT NECESSARY	511.80	-
1	BUMPER LIP FRT	NOT NECESSARY	139.60	-
1	FENDER SEAL TO COWL SIDE RH	NOT NECESSARY	15.20	-
1	FENDER LINER PAD ,FR WHEEL RH	NOT NECESSARY	49.30	-
1	FENDER APRON SUB FRT/RH	NOT NECESSARY	637.80	-
1	TYRE	NOT NECESSARY	126.74	-
1	PILLAR ,FR BODY	NOT NECESSARY	363.10	-
1	WHEEL HUB FRT	NOT NECESSARY	549.70	-
1	LOWER ARM FRT/RH	NOT NECESSARY	625.90	-
1	TIE ROD END RH	NOT NECESSARY	159.30	-
1	STEERING KNUCKLE RH FRT	NOT NECESSARY	580.80	-
1	UNDER COVER SIDE /RH	NOT NECESSARY	46.10	-

Report Ref No. CC3/CTI21013114/Gea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	QUARTER GLASS FRT/RH	NOT NECESSARY	234.90	-
1	MIRROR ASSY ,RH	NOT NECESSARY	1,307.10	-
1	MIRROR LAMP RH	NOT NECESSARY	65.30	-
1	WEATHERSTRIP RHR DR ,OPENING	NOT NECESSARY	229.70	-
1	DOOR WEATHERSTRIP RR/RH	NOT NECESSARY	171.20	-
1	WIRE RHR ,DOOR	NOT NECESSARY	280.20	-
1	FENDER LINE RR/RH	NOT NECESSARY	141.30	-
1	TAIL LAMP BRACKET ,RH	NOT NECESSARY	30.70	-
1	WHEEL DISC	TO REPAIR SEE LABOUR	1,484.20	-
1	WHEEL DISC ,FRONT	TO REPAIR SEE LABOUR	1,484.20	-
1	PILLAR ,CTR BODY RH	TO REPAIR SEE LABOUR	307.70	-
1	MOULDING DODY ,RH	TO REPAIR SEE LABOUR	673.60	-
1	COVER OUTER MIRROR RH	TO REPAIR SEE LABOUR	107.40	-
			24,716.88	10,281.46
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF WHEEL DISC,WHEEL DISC ,FRONT,PILLAR ,CTR BODY RH ,MOULDING DODY ,RH AND COVER OUTER MIRROR RH .		1,183.00	800.00
	SPRAY PAINT.		3,528.00	1,750.00
	TO DO WHEEL ALIGNMETN /TYRE BALANCING.		120.00	60.00
	TO RMEOVE AND REFIX WING MIRROR .		120.00	30.00
	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE).		240.00	60.00
	TO TRANSFER DOOR MECHANISM.		240.00	120.00
	TO REMOVE & REFIX FRONT LHS/RHS QUARTER GLASS	NOT NECESSARY	120.00	-
	TO PROVIDE LABOUR & MATERIAL FOR SOLAR .	NOT NECESSARY	250.00	-
	TOWING CHARGE.		56.00	40.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIX REAR LHS/RHS QUARTER GLAS		120.00	60.00
			5,977.00	2,920.00
GRAND TOTAL			30,693.88	13,201.46
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				11,200.00

Report Ref No. CC3/CTI21013114/Gea3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4209D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

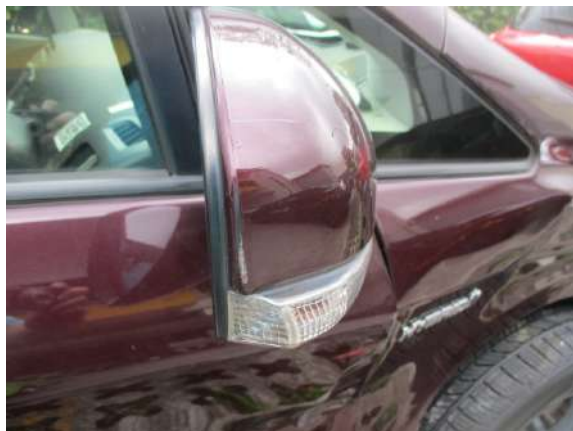



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4209D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 4209D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

