

ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7896 Email: absolute.app.svcs@gmail.com

Invoice

Customer: Low Lena

C/o:

7 Sin Ming Industrial Estate Sector C #01-94

Singapore 575642

Date:

30.11.2021

Invoice No: NS-2021-264

			Amount		
Vehicle	No:	SLU9717D			
Make 8	Model:	Mercedes Benz E250 (A)			
Our ref	erence:	AAS/2021/264			
Service	es rendered for	appraiser / inspection	report		
Survey	Fee				
Photog	raphs				
Transp	ort Fees				
Re-insp	ection Fees				
SGD Do	llar : Six hundre	d fifty one dollar only	Total:	SGD	\$ 651.00

Notes

All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd" Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.

Absolute Appraisal Services Pte Ltd

n



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: C/o: Low Lena

7 Sin Ming Industrial Estate Sector C #01-94

Date of report: Date of request: 30.11.2021 08.11.2021

Singapore 575642

Date of inspection:

08.11.2021

Date of accident:

25.09.2021

Report No: AAS/2021/264

Claim type: Third Party Claim

Particulars of affected vehicle:

Registration no:

SLU9717D

Odometer:

141300 km

Make/Model:

Mercedes Benz E250 (A)

Engine Capacity:

1796 cc

Year of registration:

2012/13

Engine no:

27186030519053

Colour:

Metallic Blue

Chassis no:

WDD2120472A660607

Condition of tires:

Front Left:

6mm

Front Right:

6mm

6mm

Make:

Goodyear 6mm

Make:

Goodyear

Rear Left: Make:

Goodyear

Rear Right: Make:

Goodyear

Type of road wheel:

Alloy

(The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork

Paintwork

: Good : Good

Handbrake

: In order

Footbrake

: In order

Steering Apparent engine modification

: In order : Nil

The Assignment

The inspection was conduct at M/s.

MIE Motor

7 Sin Ming Industrial Estate Sector C #01-94

Singapore 575642

(Subsequent inspection was conducted)

Assessment

Repairer's estimate:

\$ 12.809.00

Revised estimate:

8,306,00

Recommended reserve:

6,650.00 (Lump sum)

Estimated normal duration of repairs: 5 Working days

·	
	x
	-
	*
	-



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Vehicle No: SLU9717D

Report No: AAS/2021/264

W/O PREJUDICE

Point of impact

At the rear portion

General description of damages

The boot lid, rear bumper, rear end panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s MJE Motor as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$8,306.00

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$6,650.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 5 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a 'Without Prejudice' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 56 photographs.

Your Faithfully Absolute Appraisal Services Pte Ltd



	E			
),¥	16.	
			, =	
				6
				(4)



ABSOLUTE APPRAISAL SERVICES PTE LTD LOSS ADJUSTERS & MOTOR APPRAISERS

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Veh	nicle No: SLU9717D				_	Re	port No: AAS,	/2021	/264
App	oraisement Schedule							. 7	,
S/N	I Parts Description	Qty	Condition			Re	pairer's Est	Re	vised Est
1	Boot lid	1	Dented/Distorted			\$	3,116.00	\$	3,116.00
2	Boot lid emblem	1	Necessary			\$	54.00	\$	54.00
3	Boot lid nameplate 'E250'	1	Necessary			\$	87.00	\$	87.00
4	Boot lid nameplate '7G-Tronic'	1	Necessary			\$	72.00	\$	72.00
5	Boot lid C&C badge	1	Necessary			\$	46.00	\$	46.00
6	Boot lid chrome moulding	1	Necessary			\$	131.00	\$	131.00
7	Boot lid lamp LH/RH	2	Refit	\$	508.00	\$	1,016.00		(4)
8	Boot lid latch	1	Refit			\$	328.00		*
9	Boot lid weather-strip	1	Refit			\$	202.00		
10	Rear bumper	1	Dented			\$	1,603.00	\$	1,603.00
11	Rear bumper lower trim	1	Dented			\$	513.00	\$	513.00
12	Rear bumper tow hook cover	1	Refit			\$	53.00		=
13	Rear bumper PDC sensor	4	2pc Malfunctioned	\$	197.00	\$	788.00	\$	394.00
14	Rear bumper PDC coupling	4	Necessary	\$	7.00	\$	28.00	\$	28.00
15	Rear bumper retainer LH/RH	2	Refit	\$	63.00	\$	126.00		-
16	Rear bumper under bracket	2	Broken	\$	36.00	\$	72.00	\$	72.00
17	Rear bumper reinforcement	1	Dented			\$	730.00	\$	730.00
18	Rear bumper support LH/RH	2	Refit	\$	54.00	\$	108.00		*
19	Tail lamp LH/RH	2	Refit		793.00	\$	1,586.00		=
20	Rear panel		Dented/Repair				_		â
				List to	tal:	\$	10,659.00	\$	6,846.00
S/N	Labour Description					Rei	pairer's Est	Rev	vised Est
1	Check rear section lightings & w	irings.				\$	40.00	\$	30.00
2	Dismantle & transfer boot lid con		nts.			\$	100.00	\$	80.00
3	Removal & refitting of rear trims			S.		\$	100.00	\$	60.00
4	Renew & transfer reverse sensor		1			\$	50.00	\$	50.00
5	Anti rust treatment on rear affec		iels.			\$	60.00	\$	40.00
6	To conduct panel beating, weldir	_		anels, ren	ew	\$	800.00	\$	500.00
	rear damaged parts, realign affect					4	00000	Ψ	500.00
7	Spray painting on rear replacem					\$	1,000.00	\$	700.00
				Labour T	Fotal:	<u> </u>	2,150.00	\$	1,460.00
37								Ψ	1,100.00
The	final adjusted home some and and	٠	t. (F0 00	Grand T	otal:	\$ 1	12,809.00	\$	8,306.00

The final adjusted lump sum amount is \$6,650.00

Under normal circumstances, the repair should be completed within a reasonable period of 5 working days.

56 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.

		(4)		
			ž:	V S
x				
				18
				:-
				1
				¥3




ny. A	* · ·
	5
May 1	



	-



	, x ,
0.00	

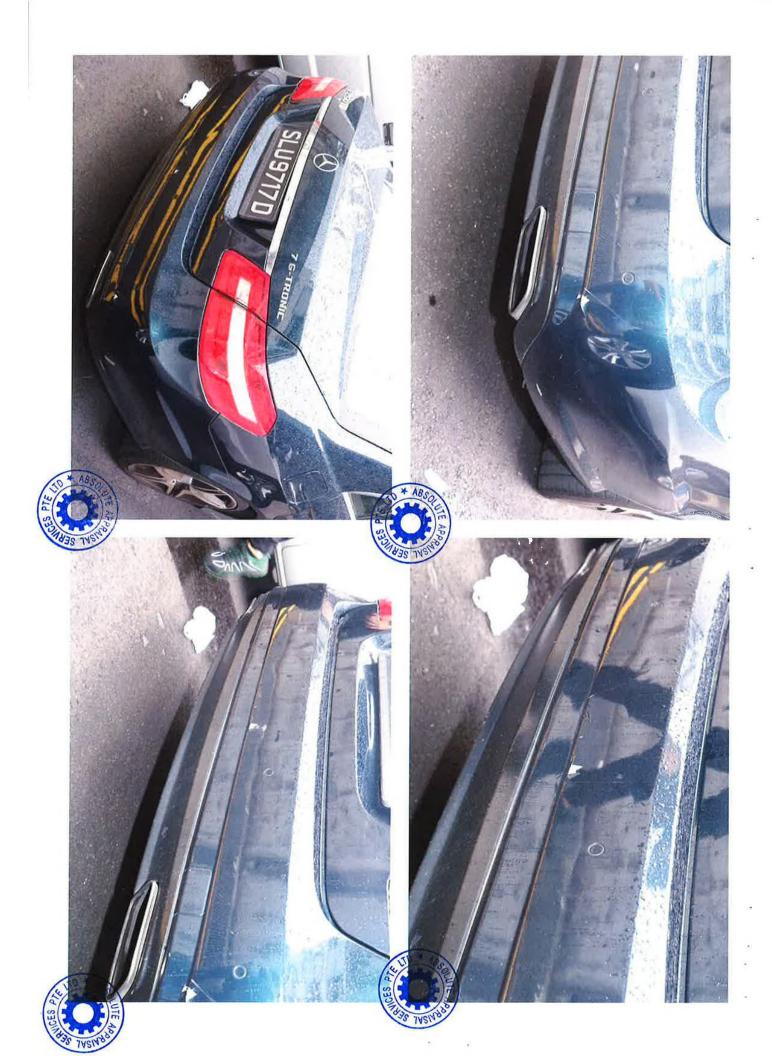

*		
* * *		





Y		
36.		






.

	a a		
=			
ė:			
			359
		4.5	
7			



5 5	



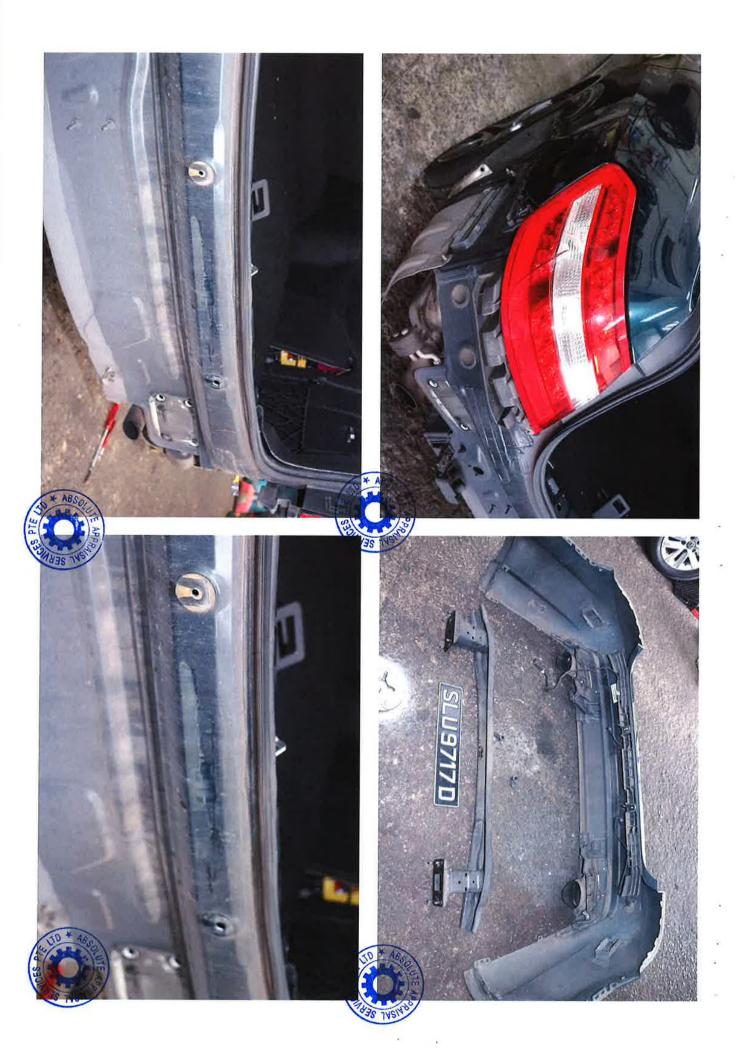

e.		

(6)



S (M) (9)		



e e e e e e e e e e e e e e e e e e e	



v.		
*		
х и		



		2
W (19)		
res (f. V)a		