

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Yr Regn:

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading:

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO orFrontRear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

CNY 1-2-22

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

Add Fee:

☐

Site Insp (\$

) S + RS SI

☐

Interview (\$

) Photos

☐

Tech. Invs (\$

) Others

☐

Weekend (\$

)

Report Format :

Lump Sum / I.B.I. (\$))

TOTAL

Jin, Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMG7954K

Repairer Reference: SMG7954K

Date calculated: 19/01/2022 11:27 AM

Full Report

Registration: SMG7954K

Printed: 19/01/2022 11:27 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMG7954K	Date of Incident:	15/01/22
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	SYLPHY (B17T)		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 PT 01		
Registration:	SMG7954K		
VIN number:	MNTBBAB17Z0033943		
Odometer:	43606		
Model Specs			
RR PARK DIST CONTROL	1.6 LTR 85 KW	GEARBOX CVT	ABS
WHEELS 5.5J X 15	WHEEL COVER 15"	TWO COAT METALLIC	PREPARE OFF VEHICLE

*Not Adhered
to
20/1/22
the ph. bebugang.
20 days.
p/2*


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

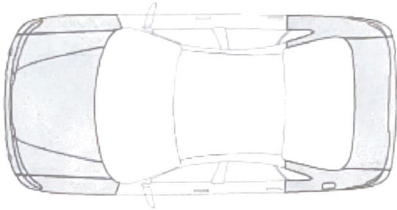

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner),Tread (Right Outer),Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	Middle, mm	

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
UA10A1	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS		9.0	37.80
VB10A1)	R + R L/R DOOR SILL COVER		1.0	4.20
VB10A1)	R + R R/R DOOR SILL COVER		1.0	4.20
UT20A1	R + R LEFT ROOF MOULDING		2.0	8.40
UT20A1	R + R RIGHT ROOF MOULDING		2.0	8.40
NO NUMBER	RENEW L/R SIDE PANEL AND END PANEL INCLUDES: R + R REAR SEAT, SEAL, TAIL LAMPS, REAR BUMPER AND ALL TRIMS IN THE REPAIR SECTION		90.0	378.00
NO NUMBER	RENEW R/R SIDE PANEL (ADD/WORK) INCLUDES: R + R TRIMS AND NECESSARY ATTACHED PARTS		50.0	210.00
8004A1)	R + R L/R QTR GLASS		7.0	29.40
8004A1)	R + R R/R QTR GLASS		7.0	29.40
NO NUMBER	RENEW LEFT REAR OUTER WHEELHOUSE		15.0	63.00

Code	Description	WU	Price SGD
NO NUMBER	RENEW RIGHT REAR OUTER WHEELHOUSE	15.0	63.00
UC10A1)	RENEW REAR BUMPER (REMOVED)	2.0	8.40
NO NUMBER	R + R L/R PARKING SYSTEM SENSOR	1.0	4.20
NO NUMBER	R + R REAR CENTRE PARKING AID SENSOR	1.0	4.20
NO NUMBER	R + R R/R PARKING SYSTEM SENSOR	1.0	4.20
7700A1)	R + R FUEL TANK	11.0	46.20
UM10A1	RENEW BOOTLID	20.0	84.00
	INCLUDES: LOAD COMP COVER, BOTH INNER TAILLAMPS AND REQUIRED ATTACHED PARTS R + R		
UM12A1)	R + R BOOT LID BOTH HINGES	5.0	21.00
8002A1)	R + R REAR WINDOW	20.0	84.00
	INCLUDES: R + R ADDITIONAL BRAKE LAMP		
NO NUMBER	RENEW BOOT FLOOR	40.0	168.00
NO NUMBER	RENEW L/R SIDEMEMBER (COMPOSITE WORK) (REAR END PANEL AND BOOT FLOOR REMOVED)	58.0	243.60
NO NUMBER	RENEW R/R SIDEMEMBER (COMPOSITE WORK) (REAR END PANEL AND BOOT FLOOR REMOVED)	58.0	243.60
7712A1)	R + R REAR SILENCER	1.0	4.20
1781	L/R DOOR REPAIR	10 30.0*	126.00
1782	R/R DOOR REPAIR	10 30.0*	126.00
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	48.20	482.0
	Total of Labour		2,024.40

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	L/R BUMPER BRACKET SURFACE PAINT	4.0
	R/R BUMPER BRACKET SURFACE PAINT	4.0
	REAR PANEL NEW PART PAINTING	21.0
	BOOTLID NEW PART PAINTING	13.0
	L/R SIDE PANEL CPL NEW PART PAINTING	29.0
	R/R SIDE PANEL CPL NEW PART PAINTING	29.0
	BOOTFLOOR SURFACE PAINT	8.0
	L/R SIDE MEMBER CPL SURFACE PAINT	4.0
	R/R SIDE MEMBER CPL SURFACE PAINT	4.0
	L/R OUTER WHEELHOUSE SURFACE PAINT	6.0
	R/R OUTER WHEELHOUSE SURFACE PAINT	4.0
	FRONT BUMPER NEW PART PAINT K1G/P	32.0
	REAR BUMPER NEW PART PAINT K1R	11.0
	L/R DOOR REPAIR PAINTING <50%	15.0
	R/R DOOR REPAIR PAINTING <50%	15.0

Paint Material Per Part

Code	Description	Price SGD
2627	L/R BUMPER BRACKET SURFACE PAINT	1.25
2628	R/R BUMPER BRACKET SURFACE PAINT	1.25

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	25.85
2931	BOOTLID NEW PART PAINTING	32.51
3481	L/R SIDE PANEL CPL NEW PART PAINTING	40.70
3482	R/R SIDE PANEL CPL NEW PART PAINTING	40.70
3901	BOOTFLOOR SURFACE PAINT	20.17
3991	L/R SIDE MEMBER CPL SURFACE PAINT	3.74
3992	R/R SIDE MEMBER CPL SURFACE PAINT	3.74
4161	L/R OUTER WHEELHOUSE SURFACE PAINT	9.96
4162	R/R OUTER WHEELHOUSE SURFACE PAINT	2.99
0281	FRONT BUMPER NEW PART PAINT K1G/P	129.60
2581	REAR BUMPER NEW PART PAINT K1R	51.17
1781	L/R DOOR REPAIR PAINTING <50%	25.19
1782	R/R DOOR REPAIR PAINTING <50%	25.19

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			199.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	23.20	232.0	974.40

Material Cost - Paint

	Price SGD
New Part Painting	139.76
New Part Painting - Plastic K1R	51.17
New Part Painting - Plastic K1G/PUR	129.60
Repair Painting	50.38
Surface-/Blend Paint	43.10
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	455.31

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
3016	BADGE MODEL	84890 3RA1A	Original	60.00
2977	BOOT/TAILGATE LOCK	84630 3AW0A	Original	60.00
3901	BOOTFLOOR	G4514 3STMA	Original	500.00
4978	BOOT FLOOR CARPET	84902 3SB0A	Original	260.00
2931	BOOTLID	H430M 3SMMA	Original	550.00
2987	BOOT LID MOULDING	84810 3ST1A	Original	150.00
2944	BOOTLID SEAL	84830 3SB3J	Original	55.00
1002	END PANEL BOOTLID	SENSOR	Original	80.00
3018	EQUIPMENT BADGE	84898 3RA0A	Original	0.00
0281	FRONT BUMPER	62022 3ST1H	Original	380.00
0295	FRT BUMPER ABSORBER	62090 3ST0A	Original	100.00
0419	FRT BUMPER GRILLE	62254 3ST0A	Original	250.00
0410	GRILLE	62312 3SB0A	Original	300.00
2953	L/BOOT HINGE	H4400 3RAMA	Original	60.00
4981	L/BOOT LID TRIM	84941 3SB0A	Original	225.00

Code	Description	Part Number	Part Source	Price SGD
3861	L/QTR WDW BOND KIT	KNGKW11	Original <i>neu</i>	0.00
2627	L/R BUMPER BRACKET	85213 EE530	Original <i>sent</i>	30.00
3307	L/R BUMPER REFLECTOR	26565 5C000	Original <i>neu</i>	50.00
2625	L/R BUMP IMPACT DAMP	85093 3ST0A	Original <i>neu</i>	100.00
2619	L/R INN BUMPER BRKT	85227 3ST1A	Original <i>sent</i>	30.00
3295	L/R INNER LAMP	26559 3SB3A	Original <i>neu</i>	90.00
3291	L/R OUTER LAMP	26559 3SB0A	Original <i>neu</i>	260.00
4161	L/R OUTER WHEELHOUSE	G6711 3SBMA	Original <i>?</i>	35.00
1829	L/R QUARTER GLASS	83301 3SB1A	Original <i>?</i>	300.00
3991	L/R SIDE MEMBER CPL	G5511 3STMA	Original <i>?</i>	160.00
3481	L/R SIDE PANEL CPL	G8101 3RAMA	Original <i>neu</i>	800.00
2954	R/BOOT COMPART HINGE	H4400 3RAMA	Original <i>sent</i>	60.00
4982	R/BOOT LID TRIM	84940 3SB0A	Original <i>D.S.</i>	225.00
3862	R/QTR WDW BOND KIT	KNGKW11	Original <i>neu</i>	0.00
2628	R/R BUMPER BRACKET	85212 EE530	Original <i>sent</i>	30.00
3308	R/R BUMPER REFLECTOR	26560 5C000	Original <i>neu</i>	50.00
2626	R/R BUMP IMPACT DAMP	85092 3ST0A	Original	100.00
2620	R/R INN BUMPER BRKT	85226 3ST1A	Original	30.00
3296	R/R INNER LAMP	26554 3SB3A	Original <i>neu</i>	90.00
3292	R/R OUTER LAMP	26554 3SB0A	Original <i>neu</i>	260.00
4162	R/R OUTER WHEELHOUSE	G6710 3SBMA	Original <i>?</i>	35.00
1830	R/R QUARTER GLASS	83300 3SB1A	Original <i>?</i>	300.00
3992	R/R SIDE MEMBER CPL	G5510 3STMA	Original <i>?</i>	160.00
3482	R/R SIDE PANEL CPL	G8100 3RAMA	Original <i>neu</i>	800.00
3015	REAR BADGE	84890 3RA0A	Original <i>neu</i>	40.00
2581	REAR BUMPER	85022 3ST6H	Original <i>D.S.</i>	550.00
2711	REAR PANEL	G9110 3SBMA	Original <i>sent</i>	280.00
3160	REAR SCREEN BOND KIT	G2891 89925	Original <i>neu</i>	0.00
3161	REAR SCREEN SEAL	G2716 89900	Original <i>neu</i>	0.00
1000	REVERSE SENSOR	SENSOR	Original <i>neu</i>	200.00
2624	RR CTR BUMPER ABSORB	85090 3ST0A	Original <i>neu</i>	100.00
1004	RR FENDER VENTILATOR COVER		Original <i>neu</i>	80.00
1003	SPARE TYRE PANEL TOP	SPONGE	Original <i>neu</i>	150.00
2973	TAILGATE PILOT PIN	84620 3AW0B	Original <i>neu</i>	50.00
4985	UPP REAR PANEL TRIM	84921 3SB0A	Original <i>D.S.</i>	65.00
3017	VERSION BADGE	84895 3SH7A	Original <i>?</i>	0.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	8,540.00
Fixed Sundry Parts Price	100.00
Total	8,640.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	8,540.00	
Total Parts	100.00	8,640.00
Labour Time Base 10 WU/h		
Total 482.0 WU X 42.00 SGD/h	2,024.40	2,024.40
Paint Work Time Base 10 WU/h		
Labour Cost 232.0 WU X 42.00 SGD/h	974.40	
Material Cost	455.31	1,429.71
Repair Cost Excludes GST		12,094.11
GST (+7.00%)		846.59
Repair Cost Included GST		12,940.70

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

