

HIAP LEK AUTOMOBILE TRADING

160 Sin Ming Drive
Sin Ming Autocity
#05-17
Singapore 575722

Tel : 6453 1743 Fax: 6266 8605
E-Mail : hiaplek@hotmail.com

Date: 15th DECEMBER 2021

Vehicle No : SDV 4007S
Make/ Model : VOLVO XC60 T5
Year of Manufacture : 20 MARCH 2015
Chassis No. : YV1DZ40LDF2661858
Colour : GREY
Name : LIM SWEE KUAN
Address : 46 FLORENCE ROAD
Singapore 549497

QTY	ITEM/PARTICULARS	AMOUNT (S\$)
-----	------------------	--------------

1. Third Party Accident Claim for Motor Vehicle No. SDV 4007S
Date of Accident: 01th SEPTEMBER 2021

..... **S\$20,400.00**
(Lump Sum)

Singapore Dollars: TWENTY Thousand FOUR Hundred Only

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 31173, Fax : 645 36131.

Report No: 0099-21-HL

15 December 2021

Lim Swee Kuan
c/o Hiap Lek Automobile Trading
160 Sin Ming Drive #05-17
Sin Ming Autocity
Singapore 575722

INVOICE No. 0099-21-HL


Vehicle No. SDV4007S

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$1,282.00
Total amount payable		<u>\$1,282.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

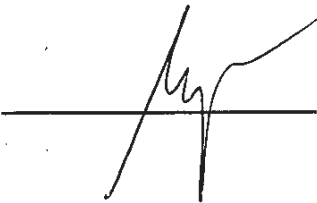

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 31173, Fax : 645 36131.

Report No: 0099-21-HL

15 December 2021

ACCIDENT VEHICLE SURVEY REPORT

Lim Swee Kuan
c/o Hiap Lek Automobile Trading
160 Sin Ming Drive #05-17
Sin Ming Autocity
Singapore 575722

VEHICLE INFORMATION:

Vehicle Reg No.:	SDV4007S	Odometer:	103004km
Make & Model:	Volvo XC60 T5	Colour:	Grey
Chassis number:	YV1DZ40LDF2661858	Date of accident:	01/09/2021
Year of Regn.:	20/03/2015	Date inspected:	17/09/2021
Repairer at:	Hiap Lek Automobile Trading 160 Sin Ming Drive #05-17 Sin Ming Autocity Singapore 575722	Date inspected (After Repair):	27/09/2021

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	6mm/Goodyear	6mm/Goodyear	235/60R18
Rear:	4mm/Goodyear	4mm/Goodyear	235/60R18

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0099-21-HL

Vehicle No: SDV4007S

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front fender LH	1	buckled	911.00	911.00
Front fender inner shield LH	1	fractured	141.00	141.00
Front headlamp LH	1	fractured	4,957.33	4,957.33
Front headlamp washer nozzle	1	deformed	135.00	135.00
Front headlamp washer nozzle cover	1	ripped	106.00	106.00
Front bumper lower garnish	1	reuse	1,573.00	0.00
Front bumper fog lamp LH	1	fractured	344.70	344.70
Front bumper	1	squashed	1,597.00	1,597.00
Front bumper sponge	1	reuse	389.70	0.00
Front bumper bracket LH	1	fractured	153.00	153.00
Front bumper reinforcement	1	bent	1,402.50	1,402.50
Front bumper retainer RH/LH	2	necessary	296.40	296.40
Front bumper air guide garnish LH	1	deformed	90.00	90.00
Front bumper lower garnish LH	1	deformed	65.00	65.00
Front support panel	1	bent	2,695.00	2,695.00
Wiper washer tank	1	bent	185.00	185.00
Wiper washer tank motor	1	bent	208.00	208.00
Horn	1	bent	130.00	130.00
Front knuckle LH	1	distorted	1,739.20	1,739.20
Front knuckle bearing LH	1	dislodged	718.50	718.50
Front linkage LH	1	bent	73.30	73.30
Front upper arm LH	1	reuse	581.17	0.00
Front lower arm LH	1	bent	581.17	581.17
Front lower arm ball joint LH	1	dislodged	249.21	249.21
Front shock absorber LH	1	bent	619.29	619.29
Front shock absorber top mounting LH	1	necessary	157.20	157.20
Front steering rack and pinion assy LH	1	distorted	4,108.88	4,108.88
Front steering tie rod end LH	1	dislodged	192.10	192.10
Front sport rim LH	1	abraded	1,739.29	1,739.29
Front chassis sub frame	1	bent	1,689.40	1,689.40
<i>Subtotal before discount</i>			27,828.34	25,284.47
<i>Percentage discount 0% and 10%</i>			0.00	2,528.45
Sub-total 1			27,828.34	22,756.02

Steering fluid	1	necessary	80.00	80.00
Front tyre	1	abraded	400.00	400.00
Front number plate c/w frame	1	reuse	50.00	0.00
<i>Subtotal before discount</i>			530.00	480.00
<i>Percentage discount 0% and 0%</i>			0.00	0.00
Sub-total 2			530.00	480.00
Parts-total			28,358.34	23,236.02

LABOUR

1. To straighten and panel beating bonnet, front fender inner panel, front support panel and front frame members. To remove and refit above parts.	1,100.00	750.00
2. To putty, re-spray painting and polish affected areas.	1,000.00	750.00
3. To check and rectify wiring system.	120.00	80.00
4. To rust proof affected areas.	180.00	60.00
5. To conduct electronic wheel alignment.	200.00	150.00
6. To remove and refit steering system and bleed system.	200.00	150.00
7. To remove and refit front suspension.	400.00	350.00
Labour total	3,200.00	2,290.00
Parts & Labour total	31,558.34	25,526.02

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

\$20,400.00

7



B J Loi (1 Eng. MIMI, AIRTE)
Automotive Appraiser