



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204426

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/07/2022
Reference CC6/CTI22000806/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLF 6215J
Insured Veh. XE 7035T
Claim No. SNM22D200688/C02
Policy No. DMCVSNA00155002100
Accident Date 23/01/2022
Inspection Date 24/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22000806/Upa3q2 Date: 20/07/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 7035T	Veh. Inspected	SLF 6215J	
Policy No.	DMCVSNA00155002100	Coverage (\$)	0.00	
Claim No.	SNM22D200688/C02	Excess (\$)	0.00	
Assign From		Assign Date	24/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA COROLLA ALTIS (A)	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	MR053REH104549609	Colour	GREY	
Odometer	58996 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/45Z R17	WEST LAKE	6 mm	
L/H Front Tyre	215/45Z R17	WEST LAKE	6 mm	
R/H Rear Tyre	215/45Z R17	WEST LAKE	6 mm	
L/H Rear Tyre	215/45Z R17	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/01/2022	Inspection Date	24/01/2022	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLF 6215J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING	NOT NECESSARY	110.20	-
1	REAR FENDER N/S	TO REPAIR SEE LABOUR	971.10	-
1	REAR DOOR N/S	BADLY DENTED	1,255.10	1,198.10
1	SET REAR DOOR FRAME BLACK STICKER N/S	NECESSARY	85.00	65.00
1	REAR DOOR GLASS OUTER CHROME N/S	NECESSARY	168.20	168.20
1	REAR DOOR GLASS REGULATOR N/S	BENT	399.00	322.50
1	REAR DOOR GLASS REGULATOR MOTOR N/S	SHORTED	650.00	580.10
1	REAR DOOR INNER LOCK N/S	SERVICEABLE	392.20	-
2	REAR DOOR HINGES N/S @\$80.00	TOP TWISTED	160.00	80.00
1	REAR DOOR CHECKER N/S	TWISTED	121.00	121.00
1	REAR DOOR INNER RUBBER N/S	NECESSARY	198.80	198.80
1	REAR DOOR INNER TRIM BOARD N/S	DEFORMED / TORN	971.30	600.10
1	FRONT DOOR N/S	BADLY DENTED	1,355.10	1,298.10
1	SET FRONT DOOR FRAME BLACK STICKER N/S	NECESSARY	85.00	65.00
1	FRONT DOOR GLASS OUTER CHROME N/S	NECESSARY	168.10	168.10
1	FRONT DOOR GLASS REGULATOR N/S	BENT	355.00	355.00
1	FRONT DOOR GLASS REGULATOR MOTOR N/S	SHORTED	650.00	580.10
1	FRONT DOOR INNER LOCK N/S	SERVICEABLE	392.20	-
1	FRONT DOOR INNER TRIM BOARD N/S	DEFORMED / TORN	950.10	681.10
1	FRONT DOOR INNER RUBBER N/S	NECESSARY	195.10	182.50
2	FRONT DOOR HINGES N/S @\$80.00	TOP BENT	160.00	80.00
1	FRONT DOOR CHECKER N/S	SERVICEABLE	121.00	-
1	CENTRE PILLAR N/S	TO REPAIR SEE LABOUR	699.20	-
1	FRONT FENDER N/S	DENTED	655.10	645.20
1	FRONT FENDER 'VVTI' EMBLEM N/S	NECESSARY	85.00	68.10
1	FRONT FENDER INNER SHIELD N/S	NOT NECESSARY	198.10	-
1	FRONT FENDER INNER SHIELD CLIPS N/S	NOT NECESSARY	50.00	-
	LESS 25% DISCOUNT		-	-1,864.25
			11,600.90	5,592.75

Report Ref No. CC6/CTI22000806/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT SPORT RIM N/S (SN)	NOT NECESSARY	850.00	-
1	SET DOOR VISOR N/S (SN)	NECESSARY	150.00	60.00
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	50.00	-
1	REAR WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	50.00	-
			1,100.00	60.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REFIX REAR REVERSE SENSOR .		80.00	40.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.	NOT NECESSARY	120.00	-
	TO TRANSFER BOTH N/S DOOR MECHANISM.		150.00	100.00
	TO DISMANTLE & REFIX SEAT CUSHION UPHOLSTERY .		120.00	60.00
	TO DISMANTLE & REFIX FUEL TANK.	NOT NECESSARY	100.00	-
	TO CONDUCT WHEEL ALIGNMENT.		120.00	60.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FENDER N/S AND CENTRE PILLAR N/S .		1,200.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,680.00	1,000.00
			3,620.00	1,880.00
GRAND TOTAL			16,320.90	7,532.75
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,000.00

Report Ref No. CC6/CTI22000806/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 6215J

INSPECTION

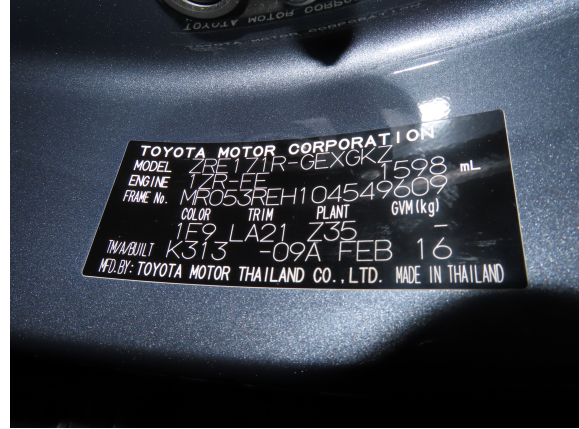



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

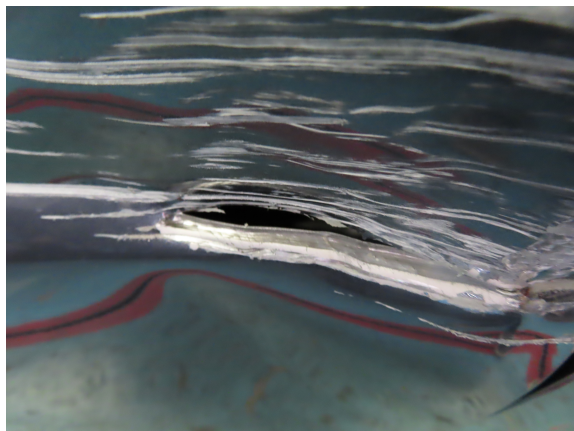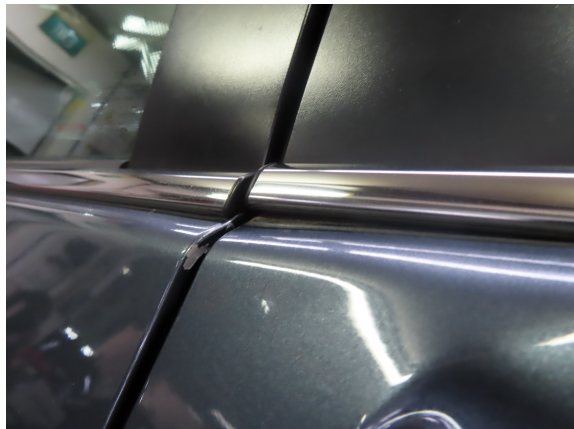



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 6215J

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

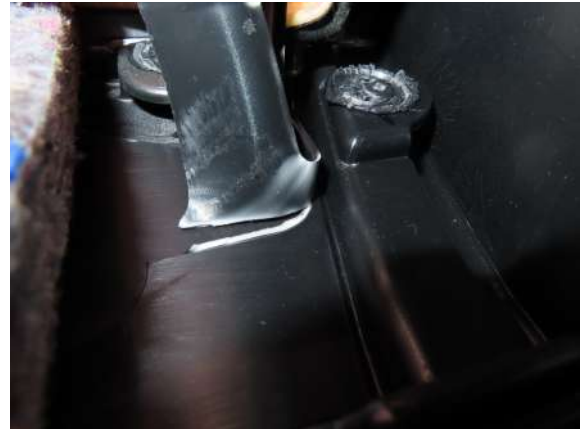



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 6215J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

