



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203812

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/06/2022
Reference CC6/CTI22001113/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLK 5326C
Insured Veh. YP 3519X
Claim No. SNM22D200908/C02
Policy No. DMCVSNW00082072101
Accident Date 06/02/2022
Inspection Date 07/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22001113/Upa3q2 Date: 20/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 3519X	Veh. Inspected	SLK 5326C	
Policy No.	DMCVSNW00082072101	Coverage (\$)	0.00	
Claim No.	SNM22D200908/C02	Excess (\$)	0.00	
Assign From		Assign Date	07/02/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VELLFIRE (A)	c.c	2362	
Engine No.	HIDDEN	Year of Reg.	2010	
Chassis No.	ANH208101096	Colour	WHITE	
Odometer	189270 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	245/45Z R18	FALKEN	6 mm	
L/H Front Tyre	245/45Z R18	FALKEN	6 mm	
R/H Rear Tyre	245/45Z R18	FALKEN	6 mm	
L/H Rear Tyre	245/45Z R18	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/02/2022	Inspection Date	07/02/2022	
Survey held at	LEE BROTHERS AUTOMOTIVE PTE LTD 1 KAKI BUKIT AVENUE 6 #02-47 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLK 5326C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	BADLY DENTED	2,120.30	2,120.20
1	TAILGATE GLASS	SERVICEABLE	1,886.90	-
1	TAILGATE LOGO	NECESSARY	68.60	68.60
1	TAILGATE EMBLEM 'VELLFIRE'	NECESSARY	110.20	110.20
1	TAILGATE LICENCE PLATE GARNISH ASSY	CRACKED	1,955.10	855.10
2	TAILGATE LAMPS -LH/RH @\$485.60	CRACKED	971.20	971.20
1	TAILGATE INNER LOCK	DENTED / SHORTED	954.65	495.10
1	TAILGATE INNER TRIM BOARD	DEFORMED /TORN	780.65	710.60
1	TAILGATE WEATHERSTRIP	TWISTED	387.66	387.66
2	TAILGATE DAMPER -LH/RH @\$286.60	NOT NECESSARY	573.20	-
2	TAILGATE SIDE STOPPER -LH/RH @\$48.60	NOT NECESSARY	97.20	-
2	TAILLAMPS -LH/RH @\$581.93	NOT NECESSARY	1,163.86	-
2	TAILLAMP MOULDINGS -RH/LH @\$141.25	NOT NECESSARY	282.50	-
2	TAILLAMP LOWER GARNISHES -RH/LH @\$241.60	N/S DENTED	483.20	241.60
2	TAILLAMP LOWER GARNISHES RETAINERS -RH/LH @\$58.60	NOT NECESSARY	117.20	-
1	REAR BUMPER	DISTORTED	1,656.91	937.30
2	REAR BUMPER REFLECTOR -LH/RH @\$89.95	N/S CRACKED	179.90	89.95
1	REAR BUMPER TOW COVER	DEFORMED	42.60	42.60
2	REAR BUMPER SIDE RETAINERS -RH/LH @\$89.95	NOT NECESSARY	179.90	-
2	REAR BUMPER BRACKETS -RH/LH @\$103.50	NOT NECESSARY	207.00	-
1	REAR END PANEL	DENTED / BENT	960.60	960.60
1	REAR END PANEL GARNISH	TWISTED	273.60	273.60
1	REAR FLOOR BOARD	NOT NECESSARY	420.60	-
1	REAR FENDER INNER TRIM BOARD -LH	NOT NECESSARY	1,359.20	-
1	REAR SMART KEYLESS ANTENNA	NOT NECESSARY	181.90	-
	LESS 25% DISCOUNT		-4,353.66	-2,066.08
			13,060.97	6,198.23
	<u>SPECIAL NETT ITEMS</u>			
1	SET TAILGATE GLASS SEALANT (SN)	NECESSARY	80.00	40.00

Report Ref No. CC6/CTI22001113/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET TAILGATE GLASS FOAM TAPE (SN)	NECESSARY	65.00	40.00
1	SET TAILGATE LICENCE PLATE GARNISH CLIP (SN)	NOT NECESSARY	80.00	-
1	SET TAILGATE TOP SPOILER CLIP (SN)	NOT NECESSARY	80.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	45.00	45.00
1	REAR BUMPER TOP CHROME PLATE (SN)	BENT	480.00	250.00
1	SET REAR REVERSE SENSOR (4 PCS) (SN)	SHORTED	380.00	250.00
1	REAR REVERSE CAMERA (SN)	SERVICEABLE	450.00	-
			1,660.00	625.00
	LABOUR			
	TO REMOVE & REPLACE TAILGATE GLASS.		180.00	120.00
	TO TRANSFER TAILGATE COMPONENTS PARTS.		150.00	80.00
	TO CHECK REAR ELECTRICAL WIRING.		50.00	30.00
	TO VACUUM ,WAX & CLEAN INTERIOR TRIMS.	NOT NECESSARY	150.00	-
	TO REMOVE AND REPLACE REVERSE CAMERA & SENSORS .		100.00	50.00
	TO TUFF KOTE.		120.00	60.00
	TO PUY ,SRPAY PAINT & POLISH AFFECTED PARTS.		1,300.00	1,000.00
	TO PANEL BEAT ,CUT ,WELD ,REMOVE & REPLACE DAMAGED PARTS.		1,200.00	600.00
			3,250.00	1,940.00
GRAND TOTAL			17,970.97	8,763.23
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,000.00

Report Ref No. CC6/CTI22001113/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLK 5326C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

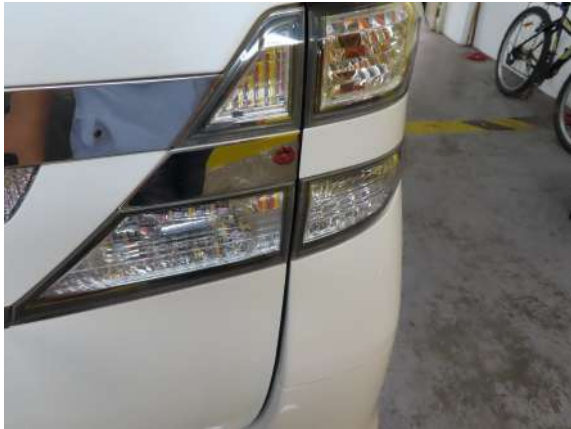



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLK 5326C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLK 5326C

RE-INSPECTION

