



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301302

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/03/2023
Reference CC6/CTI22001554/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLS 1489A
Insured Veh. SJL 731S
Claim No. SNM22D201230/C02
Policy No. DMPCSNW00059322100
Accident Date 09/02/2022
Inspection Date 16/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC6/CTI22001554/Apa3q2
3 ANSON ROAD #16-00			Date:	06/03/2023
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJL 731S		Veh. Inspected	SLS 1489A
Policy No.	DMPCSNW00059322100		Coverage (\$)	0.00
Claim No.	SNM22D201230/C02		Excess (\$)	0.00
Assign From			Assign Date	16/02/2022
2. Vehicle Particulars & Condition				
Make & Model	MAZDA 3		c.c	1496
Engine No.	HIDDEN		Year of Reg.	2017
Chassis No.	JM6BN22A8J0178274		Colour	SILVER
Odometer	82319 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
R/H Front Tyre		205/60 R16	YOKOHAMA	6 mm
L/H Front Tyre		205/60 R16	YOKOHAMA	6 mm
R/H Rear Tyre		205/60 R16	YOKOHAMA	6 mm
L/H Rear Tyre		205/60 R16	YOKOHAMA	6 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/02/2022		Inspection Date	16/02/2022
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLS 1489A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	TO REPAIR SEE LABOUR	1,289.60	-
1	BOOT LID LAMP	CUT	246.10	246.10
1	BOOT LID LOGO	NECESSARY	69.00	69.00
1	BOOT LID EMBLEM "MAZDA 3"	NECESSARY	49.50	49.50
1	BOOT LID EMBLEM "SKYACTIV TECHNOLOGY"	NECESSARY	59.60	59.60
1	BOOT LID INSULATOR	NOT NECESSARY	246.10	-
4	BOOT LID STOPPER (UPPER) @\$20.00	NOT NECESSARY	80.00	-
1	BOOT LID TOP LOCK	NOT NECESSARY	142.50	-
1	BOOT LID LOWER LOCK	NOT NECESSARY	25.10	-
1	BOOT LID WEATHERSTRIP	CUT	128.70	128.70
1	REAR BUMPER	DISTORTED	998.10	998.10
1	REAR BUMPER REINFORCEMENT	DENTED	512.30	512.30
1	REAR BUMPER REFLECTOR	CRACKED	89.80	89.80
2	REAR BUMPER TOW HOOK COVER @\$18.00	MISSING	36.00	36.00
2	REAR BUMPER LOWER CORNER GARNISH @\$47.60	O/S DEFORMED	95.20	47.60
2	REAR BUMPER SIDE RETAINER @\$53.30	O/S DAMAGED	106.60	53.30
1	REAR BUMPER CENTER BRACKET	NOT NECESSARY	196.80	-
1	TAIL LAMP	CRACKED	478.30	478.30
1	TAIL LAMP PANEL	BUCKLED	284.10	284.10
1	REAR FENDER RH	BUCKLED	1,174.20	1,174.20
1	REAR FENDER INNER TRIM	TORN	218.70	218.70
1	REAR FENDER INNER COWLING	CRACKED	142.20	142.20
1	REAR END PANEL	DENTED	469.70	469.70
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	114.60	-
1	REAR WINDSCREEN MLDG	NECESSARY	136.40	136.40
1	REAR SPARE TYRE PANEL	NOT NECESSARY	964.30	-
	LESS 20% DISCOUNT		-1,670.70	-1,038.72
			6,682.80	4,154.88
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	65.00	-

Report Ref No. CC6/CTI22001554/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
10	REAR BUMPER CLIP (SN)	NECESSARY	50.00	30.00
1	SET TAIL LAMP CLIP (SN)	NECESSARY	30.00	10.00
2	TAIL LAMP PANEL SEALANT (SN)	NOT NECESSARY	120.00	-
10	BOOT LID INSULATOR CLIP (SN)	NOT NECESSARY	50.00	-
10	REAR FENDER INNER TRIM CLIP (SN)	NECESSARY	50.00	30.00
10	REAR FENDER COWLING CLIPS (SN)	NOT NECESSARY	50.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	30.00
10	REAR END PANEL TOP GARNISH CLIP (SN)	NOT NECESSARY	50.00	-
1	REAR FLOOR PANEL SEALANT (SN)	NOT NECESSARY	200.00	-
1	REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	65.00	30.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	40.00	30.00
1	REAR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	200.00	-
1	BODY PANEL JOINT SEALER (SN)	NECESSARY	120.00	60.00
			1,460.00	220.00
	LABOUR			
	TO DISMANTLE/RENEW THE ACCIDENT DAMAGED PORTION,TO PANEL BEATING,RESHAPE,STRAIGHTEN, ORIENTATE AND ALIGN REPAIR/REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF BOOT LID.		1,800.00	1,200.00
	CARRY OUT SPRAY PAINTING ON AFFECTED AREA.		1,800.00	1,000.00
	TO DISCONNECT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS,RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER REPAIR.		120.00	30.00
	TO CONDUCT ANTI RUST OF TUFF COAT.		100.00	60.00
	REMOVE AND REFIX CUSHION SEAT/UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR.		200.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		100.00	50.00
	TRANSFER BOOTLID MECHANISM.	NOT NECESSARY	180.00	-
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	100.00	-
	REMOVE AND REFIX REAR WINDSCREEN.		200.00	120.00
	REMOVE AND REFIX REAR EXHAUST PIPE.	NOT NECESSARY	200.00	-
			4,800.00	2,520.00
GRAND TOTAL			12,942.80	6,894.88

Report Ref No. CC6/CTI22001554/Apa3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,500.00
---	--	--	----------

Report Ref No. CC6/CTI22001554/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 1489A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 1489A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

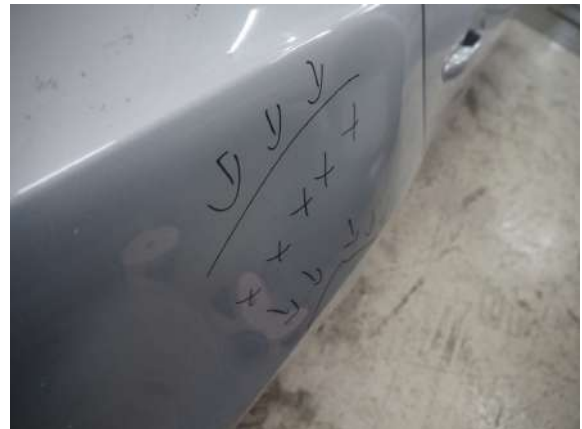



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLS 1489A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

