



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2205561

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 09/09/2022
Reference CC3/CTI22001988/Rpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 6077Z
Insured Veh. SMR 6504A
Claim No. SNM22D201442C02
Policy No. DMPCSNW00247892100
Accident Date 27/02/2022
Inspection Date 01/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI22001988/Rpa3q2 Date: 09/09/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMR 6504A	Veh. Inspected	SHD 6077Z	
Policy No.	DMPCSNW00247892100	Coverage (\$)	0.00	
Claim No.	SNM22D201442C02	Excess (\$)	0.00	
Assign From		Assign Date	01/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS HYBRID 1.8	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JTDKB3FUX03575087	Colour	MAROON	
Odometer	291615 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	6 mm	
L/H Front Tyre	195/65 R15	SAILUN	6 mm	
R/H Rear Tyre	195/65 R15	SAILUN	6 mm	
L/H Rear Tyre	195/65 R15	SAILUN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/02/2022	Inspection Date	01/03/2022	
Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 6077Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BRACKET,FR BUMPER (DISC 25%)	NECESSARY	99.80	74.85
1	COVER,RR BUMPER ASSY (DISC 25%)	CRACKED	423.90	317.92
2	PAD,RR BUMPER,RH & LH ,1 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD,RR BUMPER,RH & LH ,2 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD,RR BUMPER,RH & LH ,3 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
3	PAD,RR BUMPER,CTR @\$2.20 (DISC 25%)	NECESSARY	6.60	4.95
2	SEAL,RR BUMPER ARM,RH & LH @\$11.00 (DISC 25%)	NECESSARY	22.00	16.50
10	CLIPS PIECE,FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	GUARD,RR BUMPER LOWER (DISC 25%)	SCRATCHED	558.30	418.72
1	TAIL GATE PANEL SUB-ASSY,BACK DOOR (DISC 25%)	BENT	929.60	697.20
1	TAIL GATE WEATHERSTRIP,BACK DOOR (DISC 25%)	NECESSARY	360.70	270.52
2	TAIL GATE DAM,BACK DOOR GLASS UPPER @\$27.90 (DISC 25%)	NECESSARY	55.80	41.85
1	NAME PLATE (HYBRID) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.22
1	NAME PLATE (PRIUS) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.22
1	END PANEL SUB-ASSY,BODY LOWER BACK (DISC 25%)	BENT	629.80	472.35
1	REINFORCEMENT FRONT UPPER (DISC 25%) (ADDITIONAL)	BENT	691.10	518.33
1	ABSORBER,FR BUMPER (DISC 25%)(ADDITIONAL)	CRACKED	70.30	52.72
1	REAR BUMPER REINFORCEMENT (DISC 25%) (ADDITIONAL)	BENT	318.80	239.10
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB (DISC 25%)(ADDITIONAL)	CRACKED	891.20	668.40
1	NUMBER PLATE (SN)	BENT	35.00	35.00
1	NUMBER PLATE FRAME (SN)	CRACKED	25.00	25.00
3	SEALANT W/SCREEN (3PCS) @\$37.00 (SN)	NECESSARY	111.00	111.00
1	STICKER STRIDES TAXI WITH (DECAL 65558888)(SN)	NECESSARY	21.60	21.60
1	STICKER STRIDES TAXI WITH (GO GREEN LOGO)(SN)	NECESSARY	7.80	7.80
2	RETAINER,FR BUMPER,LH & RH	NOT NECESSARY	8.50	-
1	SUPPORT,FR BUMPER RH	NOT NECESSARY	76.90	-
1	SUPPORT,FR BUMPER LH	NOT NECESSARY	82.30	-

Report Ref No. CC3/CTI22001988/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REINFORCEMENT FRONT UPPER	NOT NECESSARY	691.10	-
1	ABSORBER,FR BUMPER	NOT NECESSARY	70.30	-
1	EXTENSION SUB-ASSY,LH	NOT NECESSARY	116.30	-
1	EXTENSION SUB-ASSY,RH	NOT NECESSARY	116.30	-
1	REINFORCEMENT FRONT LOWER	NOT NECESSARY	238.50	-
1	ABSORBER,FR BUMPER LOWER	NOT NECESSARY	117.00	-
1	SEAL,HOOD TO FR END	NOT NECESSARY	24.40	-
1	GRILLE,RADIATOR	NOT NECESSARY	165.00	-
1	GRILLE SUB-ASSY	NOT NECESSARY	335.60	-
1	CLIPS PIECE,FRT & RR BUMPER	NOT NECESSARY	1.50	-
1	COVER ASSY,ENGINE	NOT NECESSARY	180.10	-
1	LAMP ASSY,FOG,RH	NOT NECESSARY	910.20	-
1	LAMP ASSY,FOG,LH	NOT NECESSARY	910.20	-
1	UNIT,HEADLAMP LH	NOT NECESSARY	2,558.90	-
1	UNIT,HEADLAMP RH	NOT NECESSARY	2,558.90	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	318.80	-
1	RETAINER,RR BUMPER,RH	NOT NECESSARY	112.70	-
1	RETAINER,RR BUMPER,LH	NOT NECESSARY	111.50	-
1	SEAL,RR BUMPER,RH	NOT NECESSARY	85.20	-
1	FILLER RR BUMPER,RH	NOT NECESSARY	119.90	-
1	COVER,GUARD RR BUMPER LOWER	NOT NECESSARY	14.80	-
1	SENSOR REVERSE	NOT NECESSARY	180.00	-
1	ANTENNA,ELECTRICAL KEY	NOT NECESSARY	60.30	-
1	LENS & BODY,REAR COMBINATION LAMP,RH	NOT NECESSARY	438.10	-
1	LENS & BODY ASSY,RR BUMPER RH	NOT NECESSARY	486.80	-
1	COVER,REAR COMBINATION LAMP,RH	NOT NECESSARY	54.00	-
1	COVER,REAR FLOOR UNDER,RH	NOT NECESSARY	169.50	-
1	COVER,REAR FLOOR UNDER,LH	NOT NECESSARY	234.30	-
1	PANEL SUB-ASSY,FENDER REAR LH	NOT NECESSARY	824.80	-
1	LINER,REAR FENDER,LH	NOT NECESSARY	135.80	-
1	NAME PLATE (PRIUS) LUGGAGE COMPARTMENT	NOT NECESSARY	52.30	-
1	TAIL GATE GLASS SUB-ASSY BACK DOOR	NOT NECESSARY	1,569.70	-

Report Ref No. CC3/CTI22001988/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL GATE LOWER GLASS SUB-ASSY BACK DOOR	NOT NECESSARY	725.90	-
1	TAILGATE TRIM,UPPER	NOT NECESSARY	50.50	-
1	TAILGATE TRIM,RH	NOT NECESSARY	92.10	-
1	TAILGATE TRIM,LH	NOT NECESSARY	92.10	-
1	TAILGATE TRIM,LOWER	NOT NECESSARY	218.50	-
1	TAILGATE BOARD ASSY	NOT NECESSARY	251.50	-
1	TAILGATE BOARD,COVER	NOT NECESSARY	24.10	-
1	TAILGATE BOARD,HANDLE PULL	NOT NECESSARY	19.50	-
2	TAIL GATE BACK DOOR HINGE ASSY,RH & LH	NOT NECESSARY	59.10	-
2	TAIL GATE BACK DOOR HINGE ASSY,RH & LH	NOT NECESSARY	59.10	-
1	TAIL GATE STAY ASSY,BACK DOOR,RH	NOT NECESSARY	235.00	-
2	TAIL GATE BOLT,BACK DOOR STAY,RH & LH	NOT NECESSARY	11.80	-
1	TAIL GATE LOCK ASSY,BACK DOOR	NOT NECESSARY	452.10	-
1	TAIL GATE LOCK COVER,BACK DOOR	NOT NECESSARY	25.30	-
1	TAIL GATE STRIKER ASSY,BACK DOOR	NOT NECESSARY	24.90	-
1	SPOILER SUB-ASSY,REAR	NOT NECESSARY	1,322.10	-
1	LAMP SET,STOP CENTER	NOT NECESSARY	186.50	-
1	SPARE TYRE PANEL,PAN,REAR FLOOR	NOT NECESSARY	564.80	-
2	STOPPER,RR BUMPER,RH & LH	NOT NECESSARY	4.30	-
1	SEAL,RR BUMPER,LH	NOT NECESSARY	85.20	-
1	FILLER,RR BUMPER,LH	NOT NECESSARY	119.90	-
1	REAR BUMPER GROMMET SCREW	NOT NECESSARY	2.20	-
1	LENS & BODY,REAR COMBINATION LAMP,LH	NOT NECESSARY	438.10	-
1	LENS & BODY ASSY,RR BUMPER,LH	NOT NECESSARY	486.80	-
1	COVER,REAR COMBINATION LAMP,LH	NOT NECESSARY	54.00	-
1	CLIP (FOR FRONT BODY PILLAR GARNISH)	NOT NECESSARY	2.20	-
1	COVER,REAR FLOOR UNDER CENTER (ADDITIONAL)	NOT NECESSARY	222.60	-
1	INLET,AIR CLEANER NO 3 (ADDITIONAL)	NOT NECESSARY	35.30	-
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB	TO REPAIR SEE LABOUR	891.20	-
1	COVER,FR BUMPER	TO REPAIR SEE LABOUR	495.50	-
1	COVER,REAR FLOOR UNDER CENTER	NOT NECESSARY	222.60	-
			27,006.00	4,100.60

Report Ref No. CC3/CTI22001988/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF TAIL GATE BACK DOOR OUTSIDE GARNISH SUB AND COVER,FR BUMPER.		1,521.00	900.00
	SPRAY PAINT.		2,552.00	800.00
	TOWING CHARGE.	NOT NECESSARY	56.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION .	NOT NECESSARY	120.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	40.00
	TO TRANSFER REAR TAILGATE MECHANISM.		100.00	60.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	40.00
	TO REMOVE AND REFIX REAR WINDSCREEN.		120.00	120.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			4,849.00	1,960.00
	GRAND TOTAL		31,855.00	6,060.60
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,250.00

Report Ref No. CC3/CTI22001988/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6077Z

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

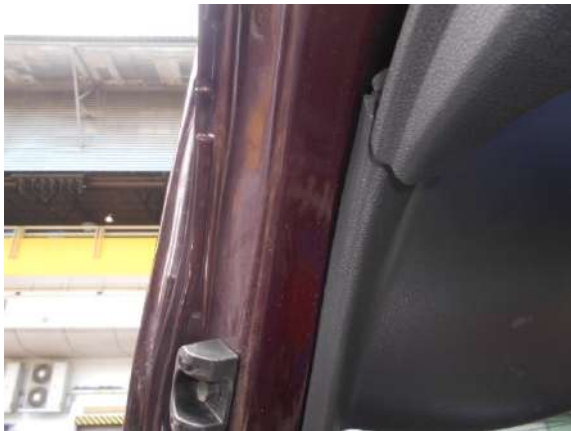



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

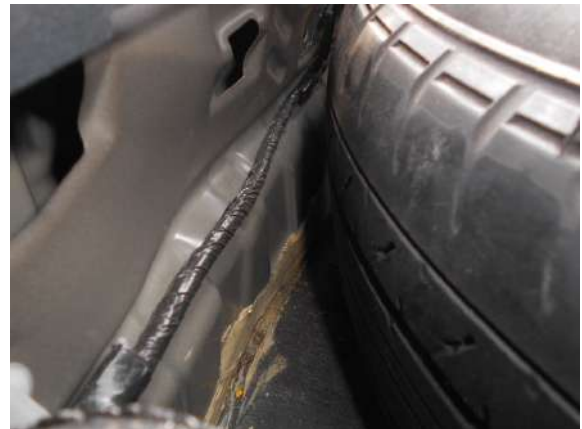



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6077Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 6077Z

RE-INSPECTION

