



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2205986

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/09/2022
Reference CC6/CTI22002279/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMJ 4906D
Insured Veh. SJL 647C
Claim No. SNM22D201687/C02
Policy No. DMPCSNW00171162101
Accident Date 09/03/2022
Inspection Date 11/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22002279/Apa3q2 Date: 27/09/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJL 647C	Veh. Inspected	SMJ 4906D	
Policy No.	DMPCSNW00171162101	Coverage (\$)	0.00	
Claim No.	SNM22D201687/C02	Excess (\$)	0.00	
Assign From		Assign Date	11/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	KIA CERATO FORTE	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2010	
Chassis No.	KNAFW411MA5174804	Colour	SILVER	
Odometer	232871 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/45 R17	FALKEN	6 mm	
L/H Front Tyre	215/45 R17	FALKEN	6 mm	
R/H Rear Tyre	215/45 R17	FALKEN	6 mm	
L/H Rear Tyre	215/45 R17	FALKEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/03/2022	Inspection Date	11/03/2022	
Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMJ 4906D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOTLID	DENTED	1,159.20	792.00
1	REAR BOOTLID LOCK	DAMAGED	187.60	187.60
2	REAR BOOTLID HINGE @\$65.70	NOT NECESSARY	131.40	-
1	REAR BOOTLID INNER TRIM	NOT NECESSARY	187.10	-
1	REAR BOOTLID EMBLEM LOGO	NECESSARY	87.50	87.50
1	REAR BOOTLID EMBLEM CERATO	NECESSARY	73.20	73.20
1	REAR BOOTLID EMBLEM FORTE	NECESSARY	64.70	64.70
1	REAR BOOTLID OUTER CHROME MOULDING	NOT NECESSARY	375.60	-
2	REAR BOOTLID LAMP @\$489.30	NOT NECESSARY	978.60	-
2	REAR BOOTLID NUMBER PLATE LAMP @\$42.30	NOT NECESSARY	84.60	-
1	REAR BUMPER	DISTORTED	895.50	548.00
1	REAR BUMPER REINFORCEMENT	CRACKED	489.60	304.00
1	REAR BUMPER SPONGE	CRACKED	240.70	135.00
2	REAR BUMPER SIDE RETAINER @\$68.60	NECESSARY	137.20	90.00
1	REAR END PANEL	DENTED	658.20	469.00
1	REAR END PANEL TOP GARNISH	DEFORMED	227.80	227.80
2	REAR TAILLAMP @\$659.40	CUT	1,318.80	560.00
2	REAR TAILLAMP LOWER BRACKET @\$55.60	NOT NECESSARY	111.20	-
2	REAR TAILLAMP INNER PANEL @\$243.50	BUCKLED	487.00	487.00
1	REAR SPARE TYRE COMPARTMENT PANEL	TO REPAIR SEE LABOUR	1,036.80	-
1	REAR SPARE TYRE TOP BOARD	DEFORMED	378.10	245.00
2	REAR FENDER @\$858.10	TO REPAIR SEE LABOUR	1,716.20	-
2	REAR FENDER INNER TRIM @\$437.80	TORN	875.60	590.00
1	REAR WINDSCREEN GLASS MOULDING	NOT NECESSARY	236.80	-
1	REAR WEATHER STRIPE	CUT	254.60	254.60
4	REAR BUMPER REVERSE SENSOR @298.50	DAMAGED (2 PCS ONLY)	1,194.00	400.00
4	REAR BUMPER REVERSE SENSOR COVER	DAMAGED (2 PCS ONLY)	138.40	70.00
1	REAR BUMPER REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	386.40	-

Report Ref No. CC6/CTI22002279/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR EXHAUST MUFFLER	NOT NECESSARY	763.80	-
2	REAR EXHAUST MUFFLER RUBBER MOUNTING @\$32.80	NOT NECESSARY	65.60	-
1	REAR EXHAUST MUFFLER SHIELD	NOT NECESSARY	94.30	-
1	REAR FLOOR PANEL	NOT NECESSARY	1,225.30	-
1	FRONT BUMPER	DEFORMED	899.60	576.00
1	FRONT BUMPER REINFORCEMENT	BENT	487.60	328.00
1	FRONT BUMPER SPONGE	CRACKED	240.70	128.00
2	FRONT BUMPER SIDE RETAINER @\$56.80	NECESSARY	113.60	113.60
1	FRONT BUMPER NUMBER PLATE GARNISH	CRACKED	55.70	55.70
1	FRONT BUMPER LOWER GRILLE	DEFORMED	398.10	125.00
1	BONNET	DENTED	785.60	785.60
1	BONNET LOCK	DAMAGED	153.60	153.60
2	BONNET HINGE @\$45.10	NOT NECESSARY	90.20	-
1	BONNET RUBBER	NOT NECESSARY	48.10	-
1	FRONT GRILLE	CRACKED	588.80	320.00
1	FRONT GRILLE LOGO	NECESSARY	89.10	89.10
2	FRONT BUMPER FOG LAMP @\$230.40	CRACKED	460.80	460.80
2	FRONT BUMPER FOG LAMP COVER @\$119.30	DEFORMED	238.60	130.00
2	FRONT HEADLAMP @\$865.20	CRACKED	1,730.40	1,180.00
2	FRONT HEADLAMP LOWER BRACKET @\$70.30	NOT NECESSARY	140.60	-
2	FRONT FENDER @\$547.10	TO REPAIR SEE LABOUR	1,094.20	-
1	FRONT SUPPORT PANEL	CRACKED	681.70	681.70
1	AIR CON CONDENSER	NOT NECESSARY	1,224.90	-
1	RADIATOR (ADDITIONAL)	BENT	1,286.40	1,286.40
1	RADIATOR FAN WITH COWLING/MOTOR (ADDITIONAL)	CRACKED	689.10	105.00
2	RADIATOR SIDE GUARD @\$65.30 (ADDITIONAL)	DEFORMED	130.60	130.60
1	WIPER TANK (ADDITIONAL)	NOT NECESSARY	149.60	-
1	FRONT BUMPER UNDER COVER (ADDITIONAL)	DEFORMED	178.40	178.40
2	FRONT FENDER INNER SEAL @\$160.30 (ADDITIONAL)	NOT NECESSARY	320.60	-
2	REAR BUMPER REINFORCEMENT BRACKET @\$98.60 (ADDITIONAL)	BENT	197.20	197.20
5	REAR BUMPER BRACKET @\$34.60 (ADDITIONAL)	DAMAGED	173.00	90.00
	LESS 10% DISCOUNT		-2,890.82	-1,270.01

Report Ref No. CC6/CTI22002279/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
			26,017.38	11,430.09
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	FRONT BUMPER LOWER SPOILER (SN)	CRACKED	680.00	500.00
1	FRONT BUMPER LOWER SPOILER SEALANT (SN)	NECESSARY	120.00	60.00
1	FRONT BUMPER STICKER (SN)	NOT NECESSARY	350.00	-
1	BONNET STICKER (SN)	NECESSARY	450.00	350.00
1	FRONT GRILLE CLIPS (SN)	NECESSARY	60.00	20.00
1	FRONT NUMBER PLATE WITH CASING (SN)	CRACKED	60.00	60.00
1	REAR BOOTLID EMBLEM C&C LOGO (SN)	NECESSARY	45.00	45.00
1	REAR BOOTLID SPOILER (SN)	NOT NECESSARY	480.00	-
1	REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR BUMPER LOWER SPOILER (SN)	CRACKED	680.00	580.00
1	REAR BUMPER LOWER SPOILER SEALANT (SN)	NECESSARY	120.00	60.00
1	REAR NUMBER PLATE WITH CASING (SN)	BENT	60.00	60.00
1	REAR SPARE TYRE COMPARTMENT INSULATOR (SN)	NOT NECESSARY	250.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	80.00	60.00
1	REAR WINDSCREEN GLASS SEALANT (SN)	NOT NECESSARY	100.00	-
2	REAR TAILLAMP CLIPS @\$20.00 (SN)	NECESSARY	40.00	20.00
2	REAR TAILLAMP INNER PANEL SEALANT @\$60.00 (SN)	NECESSARY	120.00	40.00
1	REAR BUMPER STICKER (SN) (ADDITIONAL)	NECESSARY	250.00	180.00
			4,105.00	2,095.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE COMPARTMENT PANEL,REAR FENDER AND FRONT FENDER.		2,400.00	1,800.00
	LABOUR FOR SPRAY PAINTING.		1,600.00	1,500.00
	WIRING CHECK.		80.00	80.00
	TO APPLY TUFF COATING/RUST PROOF ACCIDENT AREAS.		400.00	80.00
	LABOUR FOR REMOVE & TRANSFER REAR BOOTLID FITTING.		300.00	80.00
	LABOUR FOR REMOVE & REFIX REAR WINDSCREEN GLASS.	NOT NECESSARY	150.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR FOR REMOVE & RENEW REAR EXHAUST MUFFLER,TO REPAIR & STRAIGHTEN REAR EXHAUST PIPE.	NOT NECESSARY	300.00	-
	LABOUR FOR REMOVE & RENEW AIR CON CONDENSER,TOP UP GAS.		150.00	120.00
	LABOUR FOR REMOVE & REFIX REAR UPHOLTERY/ROOF LINING.		300.00	80.00
			5,680.00	3,740.00
GRAND TOTAL			35,802.38	17,265.09
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				13,800.00

Report Ref No. CC6/CTI22002279/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 4906D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

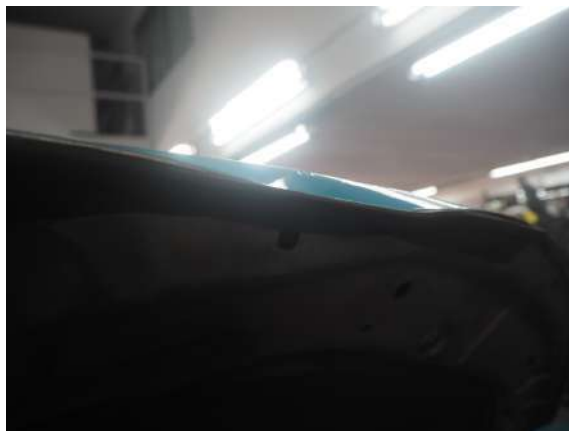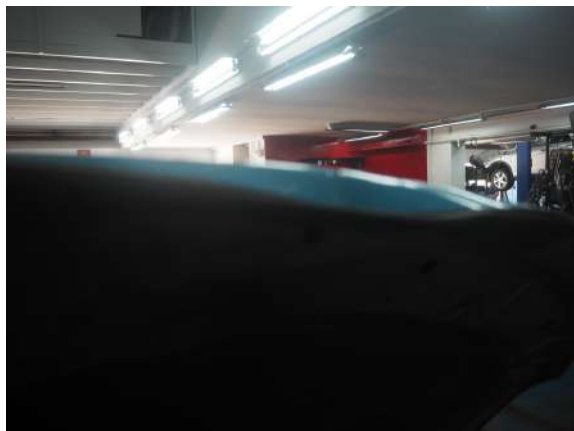



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 4906D

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

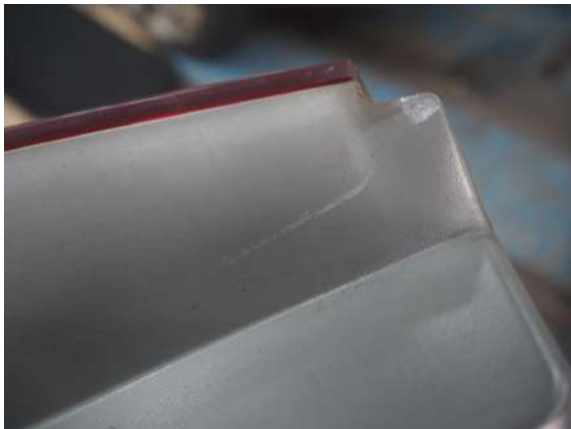



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

