



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204782

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 03/08/2022
Reference CC6/CTI22002622/Rea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMJ 2510A
Insured Veh. SDZ 9881E
Claim No. SNM22D201917/C02
Policy No. DMPCSNW00132332100
Accident Date 19/03/2022
Inspection Date 22/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22002622/Rea3q2 Date: 03/08/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SDZ 9881E	Veh. Inspected	SMJ 2510A	
Policy No.	DMPCSNW00132332100	Coverage (\$)	0.00	
Claim No.	SNM22D201917/C02	Excess (\$)	0.00	
Assign From		Assign Date	22/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA SHUTTLE 1.5G CVT	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	GK81201957	Colour	GREY	
Odometer	040581 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/60 R15	BRIDGESTONE	6 mm	
L/H Front Tyre	185/60 R15	BRIDGESTONE	6 mm	
R/H Rear Tyre	185/60 R15	BRIDGESTONE	6 mm	
L/H Rear Tyre	185/60 R15	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	19/03/2022	Inspection Date	22/03/2022	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMJ 2510A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	1,200.00	1,200.00
10	REAR BUMPER CLIP @\$5.00	NECESSARY	50.00	50.00
1	REAR BUMPER RETAINER LH	NOT NECESSARY	50.00	-
1	REAR BUMPER RETAINER RH	NOT NECESSARY	50.00	-
1	REAR BUMPER GRILLE RH	NOT NECESSARY	80.00	-
1	REAR BUMPER GRILLE LH	NOT NECESSARY	80.00	-
1	REAR BUMPER GRILLE INNER BRACKET RH	NOT NECESSARY	90.00	-
1	REAR BUMPER GRILLE INNER BRACKET LH	NOT NECESSARY	90.00	-
1	REAR BUMPER GRILLE REFLECTOR LH	NOT NECESSARY	70.00	-
1	REAR BUMPER GRILLE REFLECTOR RH	NOT NECESSARY	70.00	-
1	REAR BUMPER TOW EYE COVER	NOT NECESSARY	50.00	-
1	REAR TAIL LAMP LH	NOT NECESSARY	680.00	-
1	REAR TAIL LAMP RH	NOT NECESSARY	680.00	-
1	REAR TAILGATE LAMP RH	NOT NECESSARY	520.00	-
1	REAR TAIL LAMP PANEL LH	NOT NECESSARY	220.00	-
1	REAR TAIL LAMP PANEL RH	NOT NECESSARY	220.00	-
1	REAR TAILGATE LAMP LH	NOT NECESSARY	520.00	-
1	REAR TAILGATE	BUCKLED	1,500.00	1,500.00
1	REAR TAILGATE CHROME GARNISH	NOT NECESSARY	540.00	-
1	REAR TAILGATE SHUTTLE EMBLEM	NECESSARY	80.00	80.00
1	REAR TAILGATE HONDA EMBLEM	NECESSARY	80.00	80.00
1	REAR TAILGATE LOCK	NOT NECESSARY	150.00	-
1	REAR TAILGATE ABSORBER RH	NOT NECESSARY	150.00	-
1	REAR TAILGATE ABSORBER LH	NOT NECESSARY	150.00	-
1	REAR TAILGATE INNER TRIM	NOT NECESSARY	420.00	-
1	REAR / END PANEL GARNISH NO.10	DEFORMED	220.00	220.00
1	REAR OUTLET AIR GRILLE LH	NOT NECESSARY	60.00	-
1	REAR OUTLET AIR GRILLE RH	NOT NECESSARY	60.00	-
1	REAR / END PANEL GARNISH COVER NO.7	NOT NECESSARY	120.00	-
1	END PANEL	BENT	720.00	720.00
1	REAR FLOOR PANEL SINK	NOT NECESSARY	1,500.00	-

Report Ref No. CC6/CTI22002622/Rea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE BOARD COVER NO.3	NOT NECESSARY	400.00	-
1	REAR SPARE TYRE BOARD TRAY NO.6	NOT NECESSARY	300.00	-
1	REAR WINDSCREEN MOLDING	NECESSARY	100.00	100.00
1	REAR EXHAUST	NOT NECESSARY	880.00	-
2	REAR EXHAUST RUBBER MOUNT @\$50.00	NOT NECESSARY	100.00	-
1	REAR TAILGATE WEATHERSTRIP (ADDITIONAL)	NECESSARY	180.00	180.00
	LESS 20% DISCOUNT		-	-826.00
			12,430.00	3,304.00
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR LICENCE PLATE (SN)	NOT NECESSARY	35.00	-
1	REVERSE SENSOR (SN)	CUT	200.00	200.00
			275.00	240.00
	<u>LABOUR</u>			
	SPRAY PAINTING REAR BUMPER, TAILGATE, BOTH REAR FENDER INCLUDING BLENDING.		1,000.00	600.00
	REMOVE, REPLACE AND REPAIR ACCIDENT AFFECTED AREA.		1,000.00	600.00
	APPLY RUST PROOFING ON REPLACED / REPAIRED PANEL.		100.00	60.00
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR.		100.00	60.00
	REMOVE AND REFIT REAR EXHAUST PIPE AND SILENCER, RE-ALIGN.	NOT NECESSARY	100.00	-
	REMOVE AND REFIT REAR WINDSCREEN.		100.00	100.00
	REMOVE AND REFIT REAR REVERSE SENSOR.		100.00	60.00
	ANTI-RUST TUFF COAT.	NOT NECESSARY	40.00	-
	CHECK AND RECTIFY ELECTRICAL WIRING.	NOT NECESSARY	30.00	-
			2,570.00	1,480.00
	GRAND TOTAL		15,275.00	5,024.00



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,000.00
---	--	--	----------

Report Ref No. CC6/CTI22002622/Rea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 2510A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

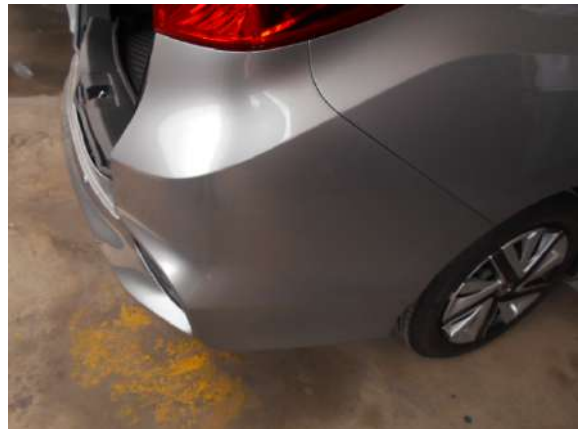



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 2510A

RE-INSPECTION

