



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2202034

INV Date 07/04/2022

Reference CS/EQI22002706/Uqy3e2

Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. JPM 8077
Insured Veh. GBD 6200E
Claim No. DM22HO00446/JT
Policy No.
Accident Date 20/02/2022
Inspection Date 24/03/2022

Description	Total
Survey Inspection	160.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	160.00
GST (7%)	11.20
Grand Total	171.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD
5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX SINGAPORE 069110

Ref: CS/EQI22002706/Uqy3e2

Date: 07/04/2022

Code: EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBD 6200E	Veh. Inspected	JPM 8077
Policy No.		Coverage (\$)	0.00
Claim No.	DM22HO00446/JT	Excess (\$)	0.00
Assign From	JAIME TAY	Assign Date	24/03/2022

2. Vehicle Particulars & Condition

Make & Model	YAMAHA 135LC	c.c	135
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	PMYKG0540D0123310	Colour	RED
Odometer	95495 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	110-70-17	PIRELLI	6 mm
L/H Front Tyre			mm
R/H Rear Tyre	110-70-17	PIRELLI	6 mm
L/H Rear Tyre			mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S, O/S BODY AND REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	20/02/2022	Inspection Date	24/03/2022
Survey held at	EROFIA MOTOR TRADING PTE LTD 1 KAKI BUKIT AVENUE 6 #02-62 SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **4 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. JPM 8077

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
2	FRONT FORK TUBE ASSY	NOT NECESSARY	640.00	-
1	FORK UNDER BRACKET	NOT NECESSARY	185.00	-
1	HANDLE BAR	BENT	88.00	88.00
1	SET HANDLE BAR ENDS	CUT	78.00	50.00
1	SET HAND GRIP	NOT NECESSARY	75.00	-
1	SET SIDE MIRRORS	BROKEN	110.00	80.00
1	SIDE MIRROR BRACKETS	NOT NECESSARY	80.00	-
1	BRAKE LEVER (CUT)	NOT CONSISTENT WITH THE IMPACT	32.00	-
1	SET FAIRING ASSY	CUT / CRACKED	525.00	450.00
1	FRONT FOOTREST BRACKET	BENT	65.00	65.00
2	FRONT FOOTREST RUBBERS	N/S TORN	70.00	35.00
1	GEAR PEDAL	BENT	58.00	58.00
1	SIDE STAND	NOT NECESSARY	85.00	-
2	REAR FOOTRESTS	N/S CUT	80.00	40.00
2	REAR FOOTREST BRACKETS	BENT / CRACKED	156.00	156.00
1	SET REAR SIGNAL	NOT NECESSARY	150.00	-
1	EXHAUST ASSY	TO REPAIR SEE LABOUR	585.00	-
1	EXHAUST PROTECTOR CAP	SERVICEABLE	75.00	-
1	EXHAUST PROTECTOR - BLACK	MISSING	55.00	55.00
1	REAR WHEEL RIM	BENT / WARPED	380.00	300.00
1	REAR RIM SHAFT	SERVICEABLE	60.00	-
1	REAR RIM BEARING	DAMAGED	52.00	52.00
1	CHAIN COVER	TO REPAIR SEE LABOUR	68.00	-
1	ENGINE COVER	NOT NECESSARY	225.00	-
1	REAR FENDER	DEFORMED	220.00	140.00
1	REAR SWING ARM	TO REPAIR SEE LABOUR	480.00	-
1	REAR HANDLE BAR	CUT	198.00	148.00

Report Ref No. CS/EQI22002706/Uqy3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-487.50	-171.70
			4,387.50	1,545.30
	<u>SPECIAL NETT ITEMS</u>			
1	SET NUMBER PLATE (SN)	BENT / NECESSARY	38.00	30.00
2	FORK OILS (SN)	NOT NECESSARY	30.00	-
2	FORK OIL SEALS (SN)	NOT NECESSARY	56.00	-
1	SET STEERING CONE (SN)	NOT NECESSARY	90.00	-
1	E.R.P. IU (SN)	CUT	180.00	165.00
1	REAR BOX (SN)	CUT	380.00	250.00
1	REAR BOX BRACKET (SN)	BENT	180.00	120.00
			954.00	565.00
	<u>LABOUR</u>			
	TO CHECK WIRING AND RESET HEADLAMP FOCUSING.	NOT NECESSARY	80.00	-
	TO PROVIDE LABOUR. INCLUSIVE OF THE REPAIR OF EXHAUST ASSY, CHAIN COVER AND REAR SWING ARM.		420.00	280.00
	TO REPAIR BODY FRAME.	NOT NECESSARY	350.00	-
			850.00	280.00
	GRAND TOTAL		6,191.50	2,390.30
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,400.00

Report Ref No. CS/EQI22002706/Uqy3e2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



**SINGAPORE
POLICE FORCE**



T/20220223/2093

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

1 of 3

Report No. T/20220223/2093

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 23/02/2022 23:42	Vide Report No.:	Station Diary No.: 160
--	------------------	---------------------------

Informant's Particulars			
Name of Informant: PHANG WEI LOON		Address:	
ID Type / ID No.: FIN NO / G2318742L		Contact No.: Home/Office: Mobile: 90557086	
Nationality: MALAYSIAN		Email: weiloonphang@gmail.com	
Sex: Male	Age: 32	Date of Birth: 02/04/1989	Type of Informant: Rider
Race: Chinese		Language:	Institution / School Name:
Occupation: MECHANIC		Driving Licence Information: Class: 2B,3,4 Date of Expiry:	

General Information of the Accident				
Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No	Date/Time of Accident: 20/02/2022 18:00	Type of Location: Straight Road
Location: SIMS WAY				
Weather: Cloudy		Road Surface: Wet		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
GBD6200E	Lorry	TOYOTA	DYNA 3.0 DIESEL TURBO M/T 2WD LORRY	Silver		0
JPM8077	Motorcycle				Seriously Damaged	0



Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Name	Unknown	ID No.	NIL
Related Vehicle	GBD6200E (Lorry)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Rider			
Name	PHANG WEI LOON	ID No.	G2318742L
Related Vehicle	JPM8077 (Motorcycle)	Contact No.	90557086
Hospital/Clinic	TAN TOCK SENG HOSPITAL	Class of Driving Licence & Expiry Date	Class: 2B,3,4 Date of Expiry: NIL
Date Treatment	20/02/2022	Date Discharge	20/02/2022
No. of Days granted Medical Leave	05	Degree of Injury	Serious

Brief Details.

On 20/02/2022 at about 1800hrs, I was riding my motorcycle JPM8077 along PIE towards Tuas. At the point of time, I was travelling along lane 4. Subsequently, I heard a long loud horn and I check around my surroundings however I did not notice anything. Suddenly about 3 seconds later, I felt a huge impact on my rear of my motorcycle and I flew out of my motorcycle. I landed on the ground and I could not move. I do not know what happened to the lorry driver GBD6200E that collided onto me. At about 5 minutes later, Ambulance and Traffic Police at scene.

I was conveyed to Tan Tock Seng Hospital and was given 5 days MC with follow up appointments dates. My right arm was fractured, broken right ribs, left knee abrasion and my front teeth was chipped off. My hand phone and watch was badly damaged due to the accident. I do have a witness who saw the whole accident happened. His name is Max HP: 90215298.



**SINGAPORE
POLICE FORCE**



T/20220223/2093

Police Station Of Origin:
Jurong West N.P.C
700 Corporation Road SINGAPORE 649818
Tel No: 1800-2689999

3 of 3

Report No. T/20220223/2093

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Recording The Report:
J / SGT 1 LIM FANG JIE

Signature Of Informant:

Loun

Signature Of Interpreter:
Not applicable

Date/Time:
23/02/2022 23:42

Officer In Charge Of Case:
TP / GIT /
SI GOH WEI LI
Contact No.: 65476394

Classification Of Case:



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. JPM 8077

INSPECTION

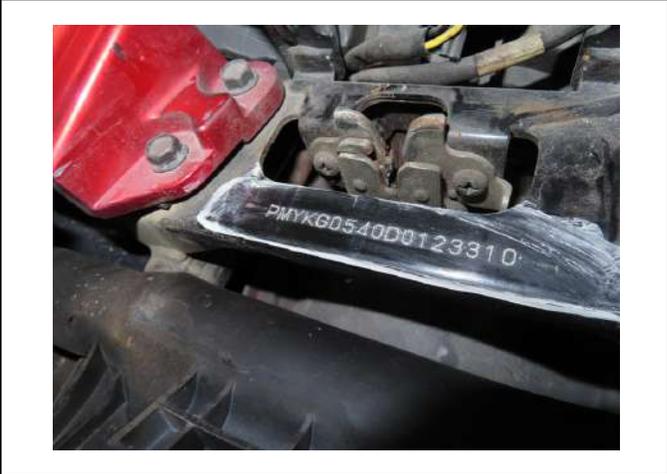



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

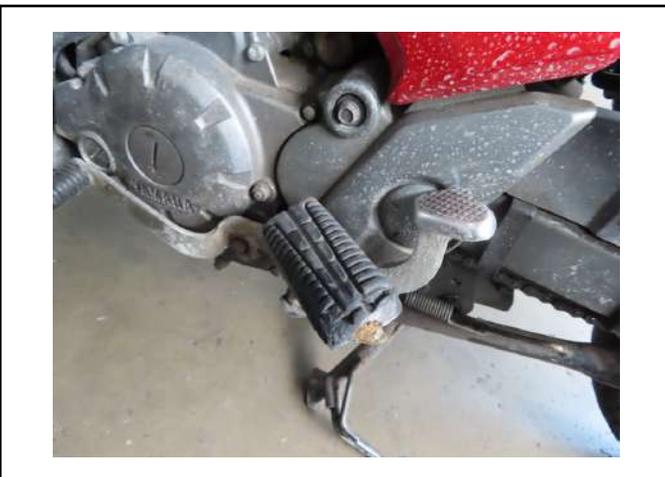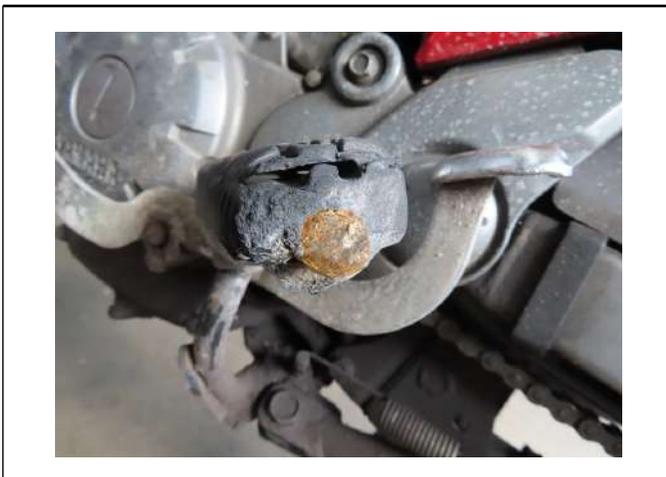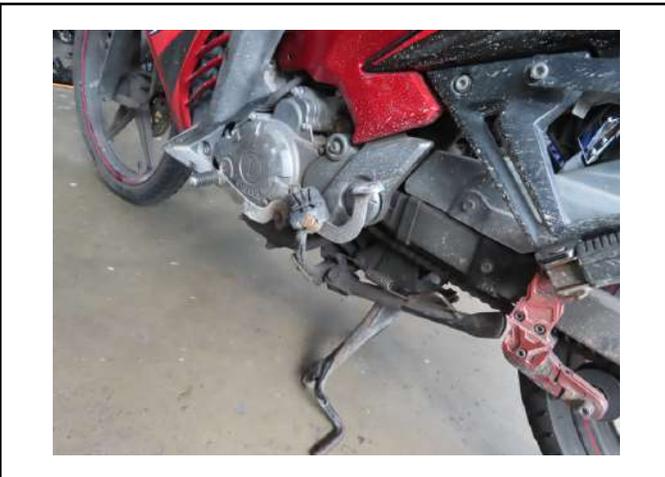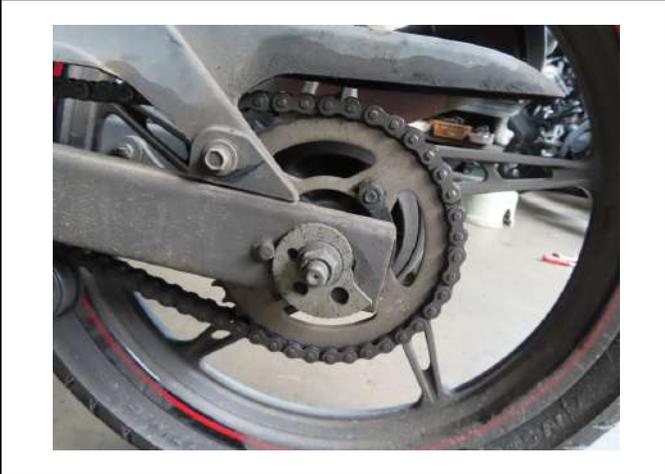



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

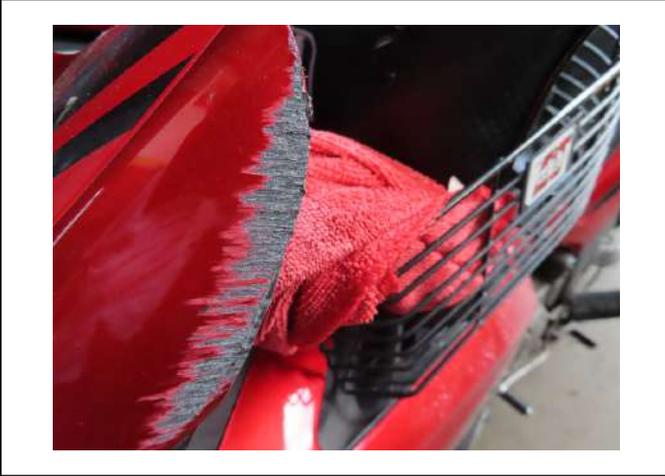



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

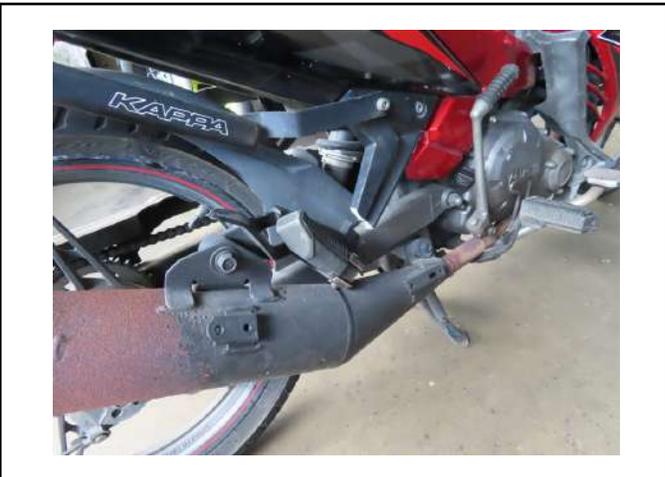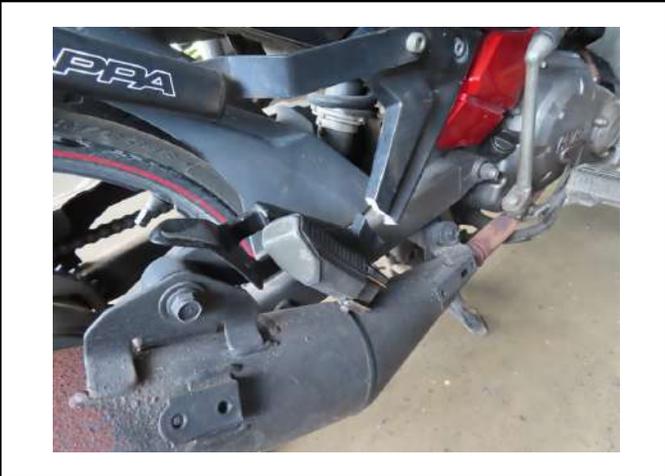






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

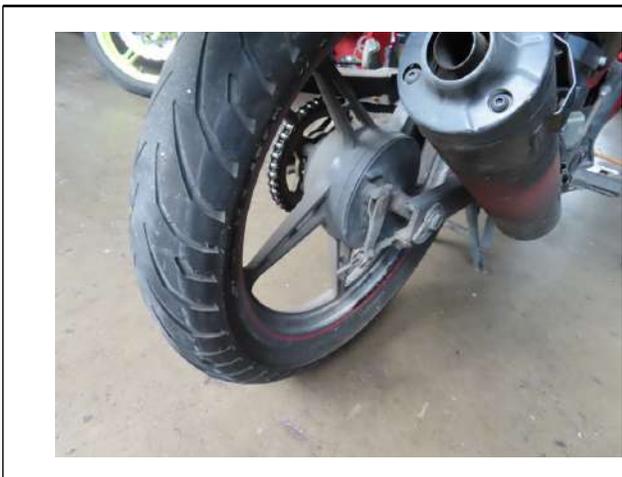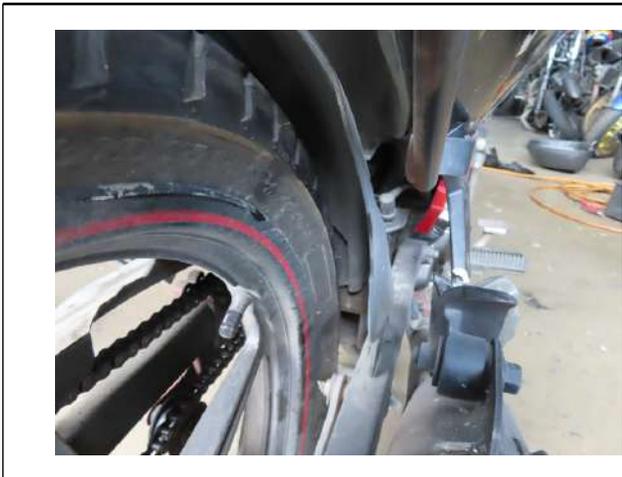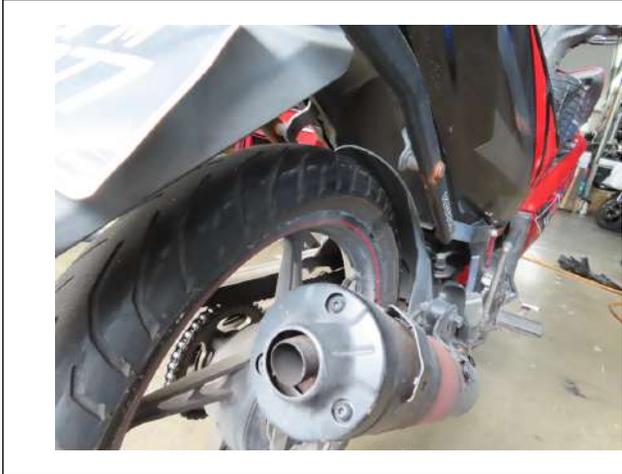



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. JPM 8077

RE-INSPECTION

