

ASS. REC. BY:

REF:

CC4/ASM22002952/Dec³

ASSIGNMENT

COE Nov 2024

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 12 days Res.: Yes or No

Lump Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No:

GBB 7025

Yr Regn:

Nov / 2009

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Dyna

c.c

2982

Colour

Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

N.A.

T/Radio:

Insured / Std / NI / NA

Eng/No:

1KD1958207

C/No:

JTFAT35TXOK200956

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195 R15

R:

155 R12

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Maxxis

Front

Rear

R/Bal.

3

mm

R/Bal.

4/4

mm

L/Bal.

3

mm

L/Bal.

4/5

mm

D.O.A.

28/03/2022

D.O.I.

31/03/2022

Survey held at

Alpha And AMK

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

4/5 Front y O/S Front y O/S Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

AS AXA SGU 1619R

Vehicle balance 32 mtins

MV 24K

MV using average dep of 9K/yr

L/A 6-9K

HL 17.1K

09/05/22 Insured 4516,001- with 12 days of work

Date/Time, File Pass to?

☐

: Preli. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Rep. Form:

Lump Sum / L.B.:

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

TOTAL




ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim

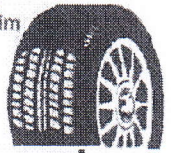

Reference No.: 3003222

[WITHOUT PREJUDICE SAVE AS TO COSTS]

Date: 30.03.2022

Nam Sing Auto Services Pte Ltd
10 Ang Mo Kio Industrial Park 2A
#02-05 AMK Auto Point
Singapore 568047.

Toyota Dyna 150

Estimate Repair Cost for Vehicle Reg. No: GBB 7102 J

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

1 Pc. Front Panel <i>Double</i>		1,144.00 ✓
1 Pc. Front Top panel <i>HN</i>		258.00 X
1 Pc. Front Centre Panel Garnish <i>HN</i>		298.35 X
<i>H/S HN</i> 2 Pcs. Front Top Corner Garnish <i>o/s dislodged</i>	@ 110.45	220.90 ✓
<i>H/S HN</i> 2 Pcs. Front Corner Panel <i>o/s Double</i>	@ 256.45	512.90 ✓
8 Pcs. Front Top Corner Garnish Clips <i>4 pc HN @ 8.00</i>		64.00 ✓ 15/- SH
1 Pc. Dyna Emblem <i>HN</i>		65.30 ✓
1 PC. Grille <i>dislodged</i>		258.95 ✓
1 Pc. Grille Logo <i>dislodged NP</i>		66.30 HN X
2 Pcs. Head Lamp <i>o/s broken H/S HN</i> <i>mainly crack</i>	@ 899.45	1,798.90 ✓
2 Pcs. Head Lamp Clips <i>HN</i>	@ 12.90	25.80 X
10 Pcs. Grille Clips <i>HN</i>	@ 6.30	63.00 ✓ 15/- SH
1 Pc. Bumper <i>o/s Double</i>		461.10 ✓
1 Pc. LH Door <i>Double</i>		1,608.35 ✓ 1294.80
2 Pcs. LH Door Hinger <i>HN</i>	@ 86.10	172.20 X
1 Pc. LH Door Stopper <i>HN</i>		110.30 X
1 Pc. LH Door Rubber <i>deform</i>		165.10 ✓
1 Pc. LH Door Board <i>HN</i>		573.95 X
1 Pc. LH Door Lower Procter Rubber <i>deform</i>		69.30 ✓
1 Pc. LH Step Garnish <i>broken</i>		268.10 ✓
1 Pc. LH Door Frame <i>Double</i>		466.45 ✓
1 Pc. LH Door Frame <i>Step</i> Garnish <i>src</i>		148.20 X
1 Pc. LH Door Frame Lower Rubber <i>HN</i>		66.10 ✓
1 Pc. LH Door Frame Rubber <i>HN</i>		68.30 X
1 Pc. LH Door Frame Lower Dust Cover <i>HN</i>		65.10 X
1 Pc. LH Door Lock Assy. <i>src</i>		509.20 X
1 Pc. LH Door Pillar <i>src</i>		435.10 X
1 Pc. Windscreen <i>src</i>		1,089.00 X
1 Pc. Windscreen Rubber <i>HN</i>		210.45 ✓

6635.45




ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
 Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00 E
 Email: alfredauto@hotmail.com

Tyre &
Sports Rim

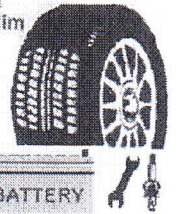

1 Pc. E.R.P Bracket <i>new</i>	28.00 (S.Nett) ✓
1 Pc. RH Door <i>new</i>	1,608.35 ✓ 1294.80
2 PCs. RH Door Hinger o/s <i>new</i> H/S 1pc @ 74.10	148.20 ✓
1 Pc. RH Door Catch <i>new</i>	110.10 X
1 Pc. RH Door Rubber <i>new</i>	145.20 ✓
1 Pc. RH Door Channel Rubber <i>new</i>	110.35 ✓
1 Pc. RH Door Moudling Outer <i>new</i>	120.40 ✓
1 Pc. RH Door Moudling Inner <i>new</i>	120.40 ✓
1 Pc. RH Door Glass <i>new</i>	404.35 ✓
1 Pc. RH Door Glass Motor Regulator Assy. <i>new</i>	519.00 ✓ 355.90
1 Pc. RH Door Lower Procter Rubber <i>new</i> H/S	65.30 X ✓
1 Pc. RH Step Garnish <i>new</i>	258.10 ✓
1 Pc. RH Door Board <i>new</i>	572.95 ✓
1 Pc. RH Door Lock Handle <i>new</i>	110.40 X
1 Pc. RH Door Lock Assy. <i>new</i> H/S	509.10 ✓ 388.50
1 Pc. RH Door Mirror <i>new</i>	210.40 ✓
1 Pc. RH Door Pillar <i>new</i> H/S	435.10 ✓
1 Pc. RH Door Frame <i>new</i>	466.45 ✓
1 Pc. RH Door Frame Step Garnish <i>new</i>	145.10 ✓
1 Pc. RH Door Frame Lower Rubber <i>new</i> H/S	66.10 ✓
1 Pc. RH Door Frame Rubber <i>new</i>	65.10 X
1 Pc. RH Door Frame Lower Dust Cover <i>new</i> H/S	66.35 X
1 Pc. Wheel Dust Garnish <i>new</i>	110.45 X
2 Pcs. Door Company Sticker <i>new</i>	50.00 (S.Nett) ✓
1 Pc. Dashboard <i>new</i> H/S <i>new</i> H/S <i>new</i> H/S	694.00 ✓
1 Pc. Dashboard Meter Cover <i>new</i>	258.00 X
1 Pc. Dashboard Beam <i>new</i>	650.35 X
2 Pcs. Dashboard Side Bracket <i>new</i> @ 110.40	220.80 X
1 Pc. Dashboard Support Panel <i>new</i>	404.00 X
1 Pc. Rear Side Hinger <i>new</i> H/S <i>new</i> H/S	110.35 <i>new</i> X
2 Pcs. Rear Procter Rubber o/s H/S <i>new</i> @ 34.00	68.00 <i>new</i> X
1 Pc. Door Console Box RH <i>new</i> H/S	390.40 ✓
1 Pc. RH Door Power Window Central Switch <i>new</i>	404.00 X
1 Pc. RH Door Control Switch Cover <i>new</i>	110.10 X
2 Pcs. 15-inch Rim o/s <i>new</i> H/S <i>new</i> H/S @ 404.95	809.90 ✓ 224.70
<i>For dep</i> 2 Pcs. 195 x 15 Tyre <i>new</i> H/S <i>new</i> H/S @ 280.00	560.00 ✓ 54.00 SH
2 Pcs. Knuckle Arm o/s <i>new</i> H/S <i>new</i> H/S @ 499.55	999.10 ✓
2 Pcs. Hup o/s <i>new</i> H/S <i>new</i> H/S @ 210.45	420.90 ✓
2 Pcs. Hup Bearing <i>new</i> @ 210.66	421.32 X
2 Pcs. Top Arm o/s <i>new</i> H/S <i>new</i> H/S @ 695.40	1,390.80 ✓ 345.50 x 2 = 691.00
2 Pcs. Lower Arm o/s <i>new</i> H/S <i>new</i> H/S @ 499.50	999.00 ✓




ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim

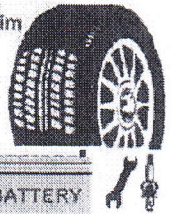

2 Pcs. Absorber <i>o/s damaged 4/s</i>	@ 120.45	240.90 ✓
1 Pc. Engine Cross Member <i>HH</i>		1,405.00 X
1 Pc. Accelerator Pedal <i>Down</i>		509.10 ✓ 371.85
1 Pc. Air-con Condenser <i>4+ 1 pumper</i>		1,024.00 ✓ 756.70
1 Pc. Air-con Condenser Liqui Pipe <i>HH</i>		210.10 X
1 Pc. Air-con Condenser Discharge Pipe <i>HH</i>		180.35 X
1 Pc. Air-con Fan <i>Motor Assy. mainly broken</i>		509.10 ✓
1 Pc. Air-con Holder Bracket <i>HH</i>		210.45 X
1 Set I-Road Camera (64GB) <i>SVZ</i>		890.00 X
1 Pc. Number Plate <i>4+</i>		40.00 (S.Nett) ✓ 20/- SH
1 Pc. Steering Lower Cover <i>* SVZ</i>		110.35 X
1 Pc. Steering Key Cover Assy. <i>HH</i>		202.10 X
1 Pc. Roof Carpet <i>SVZ 4+ 1 pumper SVZ</i>		2,050.45 HH X
1 Pc. Gever Lever Rubber <i>HH torn</i>		169.50 ✓
1 PC. Gever Lever Garnish <i>HH</i>		210.00 X

2048.05

Total (Panels / Parts): **34,580.37 (SGD)**

SH - 182.00

List 18,336.10

25% 13,752.07

LABOR CHARGES

To remove & refit wiring & check all accident affected Damaged area.	280.00 30/-
To remove & refit interior garnish, board, roof carpet & all affected area.	480.00 120/-
To remove & refit windscreen.	200.00 120/-
To remove & refit dashboard assy. Meter & all accident Affected parts with all cushion & floor carpet.	580.00 150/-
To knocking, straightening, welding repair & renew all accident damaged affected area.	2,800.00 1500/-
To respray painting inner & outer panel cabin & all Accident affected area.	2,800.00 1200/-
To rust proof all welding affected area.	280.00 40/-



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim



To remove & repair, renew all undercarriage accident
Affected area. 1,800.00 150/-

To adjust camber castor, computer wheel alignment. 180.00 60/-

To remove & renew balancing tyre & rim. 120.00 20/-

To install I-Road camera. 180.00 30/-

To remove & refit air-con system & top-up gas & oil.
(Cooling Coil, pipe, condenser & fan) 580.00 120/-

To press knuckle hub bearing & renew bearing 2 sides. 180.00 40/-

Total (Labor Charges): 10,460.00 (SGD)

TOTAL COST SUMMARY

PANELS / PARTS 17,474.07
LABOR CHARGES 2504.00
19,978.07
34,580.37
10,460.00
45,040.37

Grand Total: 45,040.37 (SGD)

We shall be glad if you can forward the payment at your early convenience.

**For internet banking transfer – OCBC Current Account No. 620-453233-001 or
PAYNOW UEN 39108900E**

ACKNOWLEDGED BY	DATE	ALFRED AUTO SERVICES & SUPPLIES
		Alfred Quah

Note: Full payment must be completed 7 days from the invoice date. There will be an interest of 1.5% imposed per month on overdue invoice. Thank you.

31/03/2022 @ 0945hrs

Not Acknowledged

2/4/2022 12 days.

Check MV

Page 4 of 4

Repair Unit

1 year

2kk Auto



ALFRED AUTO


Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538

Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E

Email: alfredauto@hotmail.com

Tyre &
Sports Rim

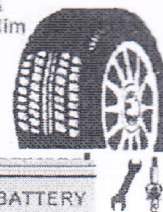

Reference No.: 3003222

[WITHOUT PREJUDICE SAVE AS TO COSTS]

Date: 04.04.2022

Nam Sing Auto Services Pte Ltd
10 Ang Mo Kio Industrial Park 2A
#02-05 AMK Auto Point
Singapore 568047.

Toyota Dyna 150

Supplementary Repair Cost for Vehicle Reg. No: GBB 7102 J

1 Pc. Lower Brake Air Booster	410.00	✓
2 Pcs. Lower Brake Booster Hose	@ 90.00	180.00 X
1 Pc. Steering Shaft Assy.	1,999.00	✓
1 Pc. Steering Base Cover	248.00	X
1 Pc. Steering Coupling	482.00	✓
1 Pc. Engine Chassis Sticker	90.00 (S.Nett)	20/- SN
2 Pcs. Company Sticker	@ 60.00	120.00 (S.Nett) X
1 Set Floor Carpet	699.00	✓ 421.00

Grand Total: 4,228.00 (SGD)

SN 20.00 =

3312.00

2500 2484.00

2504.00

We shall be glad if you can forward the payment at your early convenience.

For internet banking transfer – OCBC Current Account No. 620-453233-001 or
PAYNOW UEN 39108900E

ACKNOWLEDGED BY	DATE	ALFRED AUTO SERVICES & SUPPLIES
		Alfred Quah

Note: Full payment must be completed 7 days from the invoice date. There will be an interest of 1.5% imposed per month on overdue invoice. Thank you.