


REF:

CS3/SMR 22002979/Bq43

ASSIGNMENT

From: PRS Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MY  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s: Bak Heng Motor  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. TAX/03/22/2068  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

Veh No: SKZ 3545H Yr Regn: 2016/Jan  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: HONDA 522 C.C. 1318  
 Colour: Brown A/C: Insured / Std / NI / NA  
 Sp. Reading: 96146 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: JHMGK3850 GX220094  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or  
 Brake: In order / Jammed / Leaked / Burnt or  
 Modi: Nil S/Rim / STD A/Rim or \_\_\_\_\_  
 Tyre Size: F: 175/65 R15 DUNLOP  
 R: 185/65 R15 KAPSEN

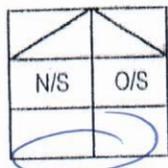

(Policy Condition)  
 Remark: The veh had commenced its repair at the time of inspection.

BS DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or \_\_\_\_\_  
 Front \_\_\_\_\_ Rear \_\_\_\_\_  
 R/Bal. S mm R/Bal. S mm  
 L/Bal. S mm L/Bal. S mm  
 D.O.A. 29/3/22 D.O.I. 19/4/22  
 Survey held at \_\_\_\_\_

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: 4 days Res.: Yes or No  
 Lum Sum: 20 % 3 Val.: Yes or No

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or  
Rear  
 The U/C / Chassis frame / Body Structure affected due to collision.

CA / REV / REP. / 24 HRS  
 Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Date / Time	Action / Instruction
	<u>submit 453,500/- with 4 days jom (cost \$5600, 62%)</u>

Date/Time, File Pass to?  : Preli. Report  
1/30/8 fun3A  : Final Report  
 Date/Time, File Return to?  
 2) \_\_\_\_\_

Days Of Repair: 4  
 Resurvey No. of Trip: \_\_\_\_\_

Report Format: TP  
 Lump Sum / I.B.F. (\$) 3500

Add Fee:  : Site Insp (\$)  
 : Interview (\$)  
 : Tech. Invs (\$)  
 : Weekend (\$)

Survey Fee:	
Transportation:	
_____ S + RS _____ SI	
) Photos	
) Others	
) _____	
TOTAL	


**CARLINK CONSULTANCY**60 Hillside Drive  
Singapore 549009

Tel : 62856178

Fax : 62874788

**ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT**

Our Ref: CL 12367 SKZ 3545 H

<b>1 REFERENCE</b>			
Date of request	:	19th April 2022	
Requested by	:	Ngu Ah Tea C/o Blk 5032 Ang Mo Kio Industrial Park 2, #01-291, SE 569535	
Type of claim	:	Third party	
Workshop	:	M/S Bak Heng Motor Repairing Co Blk 5032 Ang Mo Kio Industrial Park 2, #01-291 Singapore 569535	
Accident date	:	29th March 2022	
Date of survey	:	19th April 2022 (10.30am)	
Date of dismantle	:	19th April 2022 (12.00pm)	
Date of after repair	:	21st April 2022	
<b>2 DETAILS OF VEHICLE</b>			
Registration No.	:	SKZ 3545 H	
Make & Model	:	Honda Jazz 1.3 CVT ABS D/Airbag 2WD	
Date of registration	:	20th January 2016	
Engine No.	:	L13B11010122	
Chassis No.	:	JHMGK3850GX220094	
Speedometer reading	:	96146 Km	
Transmission	:	Automatic	
Colour	:	Brown	
<b>3 STATIC CHECK</b>			
Steering	:	see annex(es)	Paintwork : Good
Footbrake	:	see annex(es)	Modification : Nil
Handbrake	:	see annex(es)	General condition : Good
<b>4 TYRE CONDITION</b>			
		<u>Nearside/Make</u>	<u>Offside/Make</u> <u>Size</u>
Front tyre	:	6mm/Dunlop	6mm/Dunlop      : 175/65 R15
Rear tyre	:	6mm/Dunlop	6mm/Dunlop      : 175/65 R15
<b>5 POINT OF IMPACT</b>			
See Annex(es) and Motor Accident Reports			
<b>6 REMARK</b>			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

Items indicated as NH due to no photo or photo show no damage.

## Annex A : Assesment / Adjustment on Spare Parts

SKZ 3545 H							
Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)	
<b>List Items</b>							
1	Tail gate assy	Buckled	841.00 1	\$1,149.93	20%	\$919.94	✓ 672.80
2	Tail gate hinges L/R	Repair	2	\$99.60	100%	\$0.00	✓ R
3	Tail gate inner lock	Distorted/jammed	1	\$135.15	20%	\$108.12	✓
4	Tail gate rubber seal	Deformed/cut	1	\$172.60	20%	\$138.08	✓
5	Tail gate lock striker	Bent	1	\$44.46	20%	\$35.57	✓ R
6	Tail gate inner trim board clips	Necessary	1set	\$50.00	20%	\$40.00	✓ H
7	Tail gate outer chrome garnish	Grazed/cracked	181.20 1	\$230.10	20%	\$184.08	✓ 144.96
8	Tail gate outer chrome garnish clips	Necessary	4	\$24.40	20%	\$19.52	✓
9	Tail gate weatherstrip	Deformed/cut	1	\$96.80	20%	\$77.44	✓
10	Tail gate JAZZ emblem	Necessary	1	\$38.00	20%	\$30.40	✓
11	Tail gate badge	Necessary	1	\$39.50	20%	\$31.60	✓
12	Tail gate spray nozzle	Leaked	1	\$28.10	20%	\$22.48	✓
13	Tail gate wiper arm cover	Slack	1	\$12.00	20%	\$9.60	✓
14	Tail gate wiper motor	Serviceable	1	\$401.80	100%	\$0.00	✓
15	Tail gate RH inner trim	Cut	1	\$128.00	20%	\$102.40	✓
16	Tail gate LH inner trim	Cut	1	\$128.00	20%	\$102.40	✓
17	Rear windscreen glass moulding top	Necessary	1	\$58.00	20%	\$46.40	✓
18	Rear windscreen glass moulding bottom	Necessary	1	\$45.00	20%	\$36.00	✓
19	Rear bumper assy	Bent/cut	492.00 1	\$978.50	20%	\$782.80	✓ 394.40
20	Rear bumper side retainer	Necessary	50.00 2	\$76.00	20%	\$60.80	✓ 40.00
21	Rear bumper bracket	Bent	2	\$52.00	20%	\$41.60	✓
22	Rear bumper clips	Necessary	10	\$41.00	20%	\$32.80	✓
23	Rear bumper side garnish cover L/R	Distorted	2	\$124.20	20%	\$99.36	✓
24	Rear bumper tapping screw clips	Necessary	4	\$24.00	20%	\$19.20	✓
25	Tail lamp assy LH	Grazed/chipped	1	\$383.40	20%	\$306.72	✓
26	Tail lamp sealant LH	Necessary	1	\$59.60	20%	\$47.68	✓
27	Tail lamp clips LH	Necessary	2	\$15.20	20%	\$12.16	✓
28	Tail lamp assy RH	Grazed/cut	1	\$383.40	20%	\$306.72	✓
29	Tail lamp sealant RH	Necessary	1	\$59.60	20%	\$47.68	✓
30	Tail lamp clips RH	Necessary	2	\$15.20	20%	\$12.16	✓
31	Rear end panel	Dented/bent	1	\$582.30	20%	\$465.84	✓ R
32	Rear end panel top trim	Bent/cut	1	\$109.20	20%	\$87.36	✓
33	Rear end panel top trim clips	Necessary	2340.45 4	\$15.60	20%	\$12.48	✓
34	Rear floor panel	Repair	1	\$582.30	100%	\$0.00	✓
35	Rear floor sponge tray	Deformed/cut	2070 1	\$258.14	20%	\$206.51	✓
36	Rear floor panel board	Bent	1	\$189.90	20%	\$151.92	✓
37	Rear fender splash cowling LH	Cut	1872.36 1	\$109.20	20%	\$87.36	✓
38	Rear fender splash cowling clips LH	Necessary	4	\$15.60	20%	\$12.48	✓
39	Rear fender splash cowling RH	Cut	1	\$81.72	20%	\$65.38	✓
40	Rear fender splash cowling clips RH	Necessary	4	\$15.60	20%	\$12.48	✓
41	Rear fender inner trim board clips LH	Necessary	8	\$40.00	20%	\$32.00	✓
42	Rear fender inner trim board clips RH	Necessary	8	\$50.00	20%	\$40.00	✓
43	Spare tyre retainer screw lock	Bent	1	\$69.70	20%	\$55.76	✓
<b>S/Nett Items</b>							
44	Reverse sensor	Slack/cut/faulty	4	\$720.00		\$720.00	✓
45	Reverse sensor wiring harness	Cut	1	\$118.00		\$118.00	✓
46	Reverse sensor holder	Slack/distorted	4	\$72.00		\$72.00	✓

SKZ 3545 H

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)	
47	Reverse camera	Grazed/faulty	1	\$680.00		\$680.00	II
48	Rear windscreen glass sealant	Necessary	1	\$80.00		<del>\$80.00</del>	40 / II
49	Rear spare tyre	Grazed/bulge	1	\$350.00		\$350.00	II
50	Rear number plate	Grazed/bent	1	\$38.00		\$38.00	II
51	Rear number plate holder	Slack	1	\$40.00		\$40.00	II
				<b>Total for Spare Parts :</b>	<b>\$9,310.80</b>	<b>\$7,001.28</b>	

950.00 =

## Annex B : Adjustment on Labour and Spray Painting

SKZ 3545 H

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)
1	Anti rust treatment	\$200.00	\$120.00 40/-
2	To check wiring system and lights system	\$150.00	\$100.00 HW
3	To remove & refix interior upholstery	\$150.00	\$120.00 80/-
4	To remove & replace reverse sensor	\$150.00	\$120.00 40/-
5	To remove & replace reverse camera	\$250.00	\$200.00 HW
6	To remove & refix rear windscreen glass to assist in repair	\$150.00	\$120.00 ✓
7	To transfer tail gate mechanism	\$100.00	\$80.00 ✓
8	To check & adjust computer wheel alignment	\$150.00	\$100.00 HW
9	To putty and respray paint on affected area	\$1,600.00	\$1,250.00 600/-
10	To renew damaged parts, straighten/repair and aligned all parts.	\$1,800.00	\$1,500.00 700/-
<b>TOTAL FOR LABOUR &amp; SPRAY PAINTING :</b>		<b>\$4,700.00</b>	<b>\$3,710.00</b>

### Summary

	Workshop Est. (\$)	Adjusted Cost (\$)
TOTAL FOR SPARE PARTS :	\$9,310.80	\$7,001.28
TOTAL FOR LABOUR & SPRAY PAINTING :	\$4,700.00	\$3,710.00
<b>TOTAL REPAIR COSTS :</b>	<b>\$14,010.80</b>	<b>\$10,711.28</b>

4 days.

4482.36

4/S 3500 ✓