



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2304617

INV Date 19/07/2023

Reference CC4/LPC22003084/Upa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBA 4653K
Insured Veh. GY 6095Y
Claim No. 21/22/22/VC05/025633
Policy No. Z21VC05007441
Accident Date 02/04/2022
Inspection Date 04/04/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22003084/Upa3q2 Date: 19/07/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GY 6095Y	Veh. Inspected	GBA 4653K	
Policy No.	Z21VC05007441	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/025633	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	04/04/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE (M)	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2007	
Chassis No.	JTFHT02P800004910	Colour	SILVER	
Odometer	219810 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15	OHTSU	6 mm	
L/H Front Tyre	195 R15	OHTSU	6 mm	
R/H Rear Tyre	195 R15	OHTSU	6 mm	
L/H Rear Tyre	195 R15	OHTSU	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	02/04/2022	Inspection Date	04/04/2022	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBA 4653K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN	NOT NECESSARY	1,499.80	-
1	REAR WIPER ARM	NOT NECESSARY	245.50	-
1	REAR WIPER ARM MOTOR	NOT NECESSARY	655.10	-
1	REAR WIPER BLADE	NOT NECESSARY	108.00	-
1	TAILGATE	BADLY DENTED	2,159.10	2,159.10
1	TAILGATE OUTER HANDLE	SERVICEABLE	455.80	-
1	TAILGATE INNER LOCK	DENTED/JAMMED	425.80	425.80
1	TAILGATE INNER LOCK ACTUATOR	DAMAGED	455.20	455.20
1	TAILGATE LOCK STRIKER	NOT NECESSARY	45.00	-
1	TAILGATE WEATHERSTRIP	TWISTED	399.80	399.80
2	TAILGATE DAMPERS @\$366.10	NOT NECESSARY	732.20	-
1	TAILGATE INNER TRIM BOARD	TORN	455.10	399.10
1	TAILGATE REAR LOGO	NECESSARY	85.00	85.00
1	REAR BUMPER	DISTORTED	681.10	681.10
4	REAR BUMPER LOWER BRACKETS @\$35.00	BENT	140.00	140.00
2	REAR BUMPER SIDE RETAINERS @\$105.00	CRACKED	210.00	210.00
1	REAR END PANEL OUTER	BADLY DENTED	981.10	725.10
1	REAR END PANEL INNER	BADLY DENTED	988.50	855.30
1	REAR END PANEL TOP STEEL PLATE	TO REPAIR SEE LABOUR	366.80	-
2	TAILLAMPS @\$455.10	CRACKED	910.20	772.20
2	TAILLAMP LOWER GARNISHS @\$165.00	TWISTED	330.00	330.00
2	TAILLAMP HOUSING PANELS @\$688.50	N/S TO REPAIR SEE LABOUR/ O/S DENTED	1,377.00	688.50
1	REAR SPARE TYRE BRACKET	BENT	455.10	405.30
1	REAR SPARE TYRE BRACKET HOLDER	TO REPAIR SEE LABOUR	165.30	-
1	REAR FENDER	TO REPAIR SEE LABOUR	1,971.10	-
	LESS 25% DISCOUNT		-	-2,182.87
			16,297.60	6,548.63



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE (SN)	SERVICEABLE	50.00	-
1	SET REAR TAILGATE CORPORATE STICKER (SN)	NOT NECESSARY	500.00	-
1	SET TAILGATE 70KM/H & 8 PAX STICKER (SN)	NECESSARY	20.00	20.00
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	40.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	40.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
			1,100.00	430.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REPLACED REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REPLACED REAR WINDSCREEN.		150.00	120.00
	TO TRANSFER TAILGATE MECHANISM.		100.00	60.00
	TO DISMANTLE & REFIX REAR EXHAUST.	NOT NECESSARY	100.00	-
	TO SPRAY RUST PROOFING.		120.00	80.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS. INCLUSIVE OF THE REPAIR OF REAR END PANEL TOP STEEL PLATE, TAILLAMP HOUSING PANEL(N/S), REAR SPARE TYRE BRACKET HOLDER AND REAR FENDER.		1,800.00	900.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	900.00
			3,900.00	2,130.00
GRAND TOTAL			21,297.60	9,108.63
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,250.00

Report Ref No. CC4/LPC22003084/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBA 4653K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

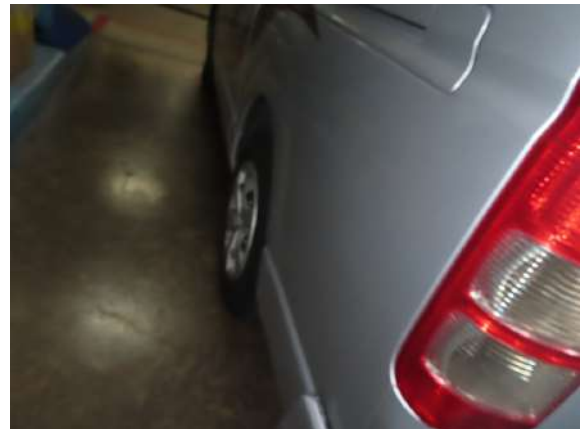



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBA 4653K

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

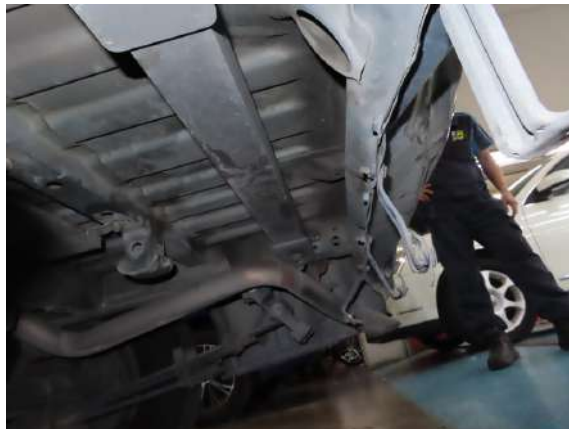



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBA 4653K

RE-INSPECTION

