

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Tel/Fax: 6886 1106 Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Max Toh Wei Jie
Blk 997A Buangkok Crescent
#12-807
Singapore 531997

Date : 25/01/2022

Reference No : CAS/22-01/023

General Information

Registration No. : SNC 5435P
Accident Date : 31/12/2021

Particulars of Damaged Vehicle

Colour	: White	Make & Model	: Volkswagen Golf GTI
Engine Capacity	: 1984 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 197886	Engine No.	: CCZ048377
Chassis No.	: WVWZZZ1KZAW278141	Steering	: In Order
Registration Date	: 17/06/2010	Brake	: In Order

Tyre Condition

	Size	Make	Balance
R/H Front Tyre	235/40R18	BRIDGESTONE	60%
L/H Front Tyre	235/40R18	BRIDGESTONE	60%
R/H Rear Tyre	235/40R18	BRIDGESTONE	60%
L/H Rear Tyre	235/40R18	BRIDGESTONE	60%

Inspection

Repairer : Toh Painting & Services Pte Ltd
Blk 3C Woodlands Road, 391C/G Yew Tee Industrial Estate, Singapore 677966

Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$21,908.93
Revised Amount : \$14,200.00
Less Excess : -
Nett Total : \$14,200.00

Remarks

- (A) Survey was done on 03/01/2022
- (B) Re-survey was done on 04/01/2022
- (C) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (D) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – LIST ITEMS</u>					
1	1pc	Front bumper ✓	Broken	1,412.13	1,412.13 1215.32
2	1pc	Front bumper lower grille ✓	Broken	1,027.60	1,027.60 690
3	1pc	Front bumper side grille RH ✓	Broken	253.61	253.61 ✓
4	1pc	Front bumper side grille lamp RH ✓	Broken	821.51	821.51 295
5	1pc	Front bumper side grille LH X SVC	Broken	253.61	253.61
6	1pc	Front bumper side grille lamp LH	Serviceable	821.51	-
7	1pc	Front bumper reinforcement X SVC	Dented/Twisted	764.14	764.14
8	2pcs	Front bumper retainer @ \$191.75 ✓	Necessary	383.50	383.50 145.2
9	2pcs	Front bumper nozzle cover @ \$62.25 X SVC	Broken	124.50	124.50
10	4pcs	Front bumper parking sensor @ \$264.48 ✓	2pcs Damaged	1,57.92	528.96 398
11	2pcs	Front bumper parking sensor holder @ \$40.46 ✓	Necessary	80.92	80.92 ✓
12	1pc	Front bumper lower beam X SVC	Dented/Twisted	299.64	299.64
13	1pc	Front bumper lower lid X SVC	Broken	604.96	604.96
14	1pc	Front grille ✓	Broken	732.69	732.69 472
15	1pc	Front grille emblem (logo) ✓	Broken	88.20	88.20 ✓
16	1pc	Front grille emblem (GTI)	Serviceable	41.20	-
17	1-2pcs	Headlamp @ \$2,138.24 ✓	O/S Broken	4,276.48	2,138.24 ✓
18	2pcs	Headlamp top panel @ \$77.66 ✓	O/S Twisted	155.32	77.66 ✓
19	2pcs	Headlamp lower bracket @ \$64.98 ✓	O/S Broken	129.96	64.98 ✓
20	2pcs	Headlamp nozzle @ \$135.67 X SVC	O/S Broken	271.34	135.67
21	2pcs	Headlamp nozzle holder @ \$104.10 X SVC	O/S Broken	208.20	104.10
22	1pc	Headlamp nozzle hose	Serviceable	54.47	-
23	1pc	Support panel X SVC	Broken	1,246.91	1,246.91
24	1pc	Washer tank	Serviceable	189.05	-
25	1pc	Washer tank motor X SVC	Broken	173.73	173.73
26	1pc	Washer tank motor hose	Serviceable	54.47	-
27	1pc	Front fender RH ✓	Dented/Buckled	663.17	663.17 ✓
28	1pc	Front fender cowling RH ✓	Torn	369.83	369.83 186.2
29	1pc	Front shock absorber RH X SVC	Bent	1,486.20	1,486.20
30	1pc	Front lower arm RH X SVC	Bent	482.50	482.50
31	1pc	Front knuckle arm RH X SVC	Bent	795.27	795.27
32	1pc	Front knuckle arm bearing RH X SVC	Necessary	615.09	615.09

Constant Appraiser Services

Vehicle No : SNC 5435P

Our ref : CAS/22-01/023

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – LIST ITEMS (CONT'D)</u>					
33	1pc	Front stabilizer bar	Serviceable	528.97	-
34	1pc	Front stabilizer bar link RH	Serviceable	132.57	-
			6768.5	19,543.25	15,729.32
		Less 10%	6091.65	(1,954.32)	(1,572.93)
			Sub total	17,588.93	14,156.39
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>					
1	1set	Front bumper clip ✓	Necessary	55.00	55.00 ✓
2	1set	Front grille clip ✓	Necessary	22.00	22.00 ✓
3	1set	Front fender cowling clip RH ✓	Necessary	43.00	43.00 ✓
4	1pc	Front sport rim RH ✓	Grazed/Warped	820.00	820.00 500
5	1pc	Front tyre RH ✓	Grazed (60%)	550.00	330.00 270
			Part total	19,078.93	15,426.39 890
<u>LABOUR & MISC. CHARGES</u>					
1		To repair & replace damaged parts		1,000.00	900.00 400
2		Spray paint affected area		1,000.00	800.00 400
3		Check wiring system & refocus headlamp		40.00	20.00 ✓
4		Check wheel alignment		120.00	100.00 60
5		Remove, refix aircon condenser & refill gas		150.00	120.00 ✗
6		Remove, refix front undercarriage		400.00	280.00 ✗
7		Spray anti rust on affected area		120.00	60.00 ✓
			Grand total	21,908.93	17,706.39 940
Recommended cost of lump sum repair (To its pre-accident condition)					14,200.00

7921.65

-20%: 6300

6 Days

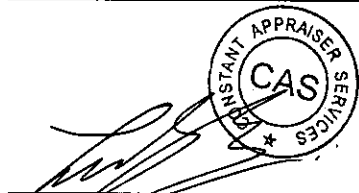
Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$14,200.00** on a contractual basis. Under normal circumstances, the repair period would be about **10 (Ten)** working days.

Yours faithfully,

Constant Appraiser Services

A circular stamp for Constant Appraiser Services (CAS) is positioned over a handwritten signature. The stamp features the text "CONSTANT APPRAISER SERVICES" around the perimeter and "CAS" in the center, with a small star at the bottom. The signature is written in black ink and appears to be "Lim Yong Tian".

Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA