

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
 Blk 2 Rivervale Link, #09-02 Singapore 545040
 Tel/Fax: 6886 1106 Mobile: 9007 5234
 Email: constant_as@yahoo.com.sg
 RCB No. 53138015K

Automobile Inspection Report

To: Aston Air Control Pte Ltd c/o 1 Kaki Bukit Ave 6 #01-106 Autobay@Kaki Bukit Singapore 417883		Date : 28/02/2022	Reference No : CAS/22-02/012
<u>General Information</u>			
Registration No.	: GBL 4280U		
Accident Date	: 19/01/2022		
<u>Particulars of Damaged Vehicle</u>			
Colour	: White	Make & Model	: Nissan NV200
Engine Capacity	: 1597 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 12068	Engine No.	: HR16184772D
Chassis No.	: VM20165907	Steering	: In Order
Registration Date	: 07/07/2021	Brake	: In Order
<u>Tyre Condition</u>			
	Size	Make	Balance
R/H Front Tyre	165/80R14	TOYO	90%
L/H Front Tyre	165/80R14	TOYO	90%
R/H Rear Tyre	165/80R14	TOYO	90%
L/H Rear Tyre	165/80R14	TOYO	90%
<u>Inspection</u>			
Repairer	: A S Auto Service 1 Kaki Bukit Ave 6, #01-106 Autobay@Kaki Bukit, Singapore 417883		
<u>Adjustment And Recommendation Cost Of Repair</u>			
Repairer's Estimate	: \$4,801.47	Submit 4/5 \$1500 2 days.	
Revised Amount	: \$3,000.00		
Less Excess	: -		
Nett Total	: \$3,000.00		
<u>Remarks</u>			
(A) Survey was done on 21/02/2022			
(B) Re-survey was done on 21/02/2022			
(C) Re-survey after repair was done on 23/02/2022			
(D) The survey was conducted entirely on WITHOUT PREJUDICE basis.			
(E) We have NOT given any instruction to authorize the repair of the vehicle.			

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Constant Appraiser Services

Vehicle No : GBL 4280U

Our ref : CAS/22-02/012

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
<u>PARTS REPLACEMENT – NETT ITEMS</u>					
1	1pc	Rear bumper	Dented/Deformed	563.20	De 563.20 ✓
2	1pc	Rear bumper inner sponge	Serviceable	230.87	su - X
3	1pc	Rear bumper side retainer RH	Necessary	52.18	ner 52.18 ✓
4	1pc	Taillamp RH	Broken	314.66	su 314.66 ✓
5	1pc	Rear end panel	Repair	417.51	R - X
6	1pc	Rear fender RH	Dented/Buckled	1,791.60	R 1,791.60 X
7	1pc	Rear fender air vent RH	Serviceable	90.50	SVC - X
				3,460.52	2,721.64
Less 10%				(346.05)	(272.16)
Sub total				3,114.47	2,449.48
<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>					
1	1set	Rear bumper clip set	Necessary	35.00	nu 35.00 ✓
2	1set	Rear fender inner trim clip set RH	Necessary	32.00	nu 32.00 ✓
Part total				3,181.47	2,516.48
<u>LABOUR & MISC. CHARGES</u>					
1		To check rear electrical wiring		30.00	20.00 ✓
2		To remove, refix reverse sensor		80.00	60.00 su
3		To respray undercoating		60.00	30.00 ✓
4		To respray painting & etc		650.00	500.00 400
5		Panel beating, remove & refix above damaged parts		800.00	600.00 500
Grand total				4,801.47	3,726.48
Recommended cost of lump sum repair (To its pre-accident condition)					3,000.00

P- 930.04
 102
 837.03
 1067


Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of \$3,000.00 on a contractual basis. Under normal circumstances, the repair period would be about 3 (Three) working days.

Yours faithfully,

Constant Appraiser Services

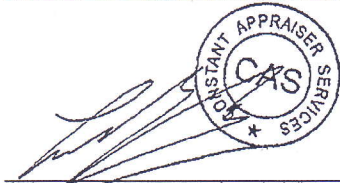

Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA