

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/ Adjusters Cargo Surveyors & Licensed Appraisers

227 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



AUTOMOBILE INSPECTION REPORT

To:

**Dynacle Transportation & Workshop
Pte Ltd**

**C/O 22 SIN MING LANE #06-76 MIDVIEW
CITY SINGAPORE 573969**

INSURANCE DETAILS

Insured : -
Policy No. / Claim No. : -
Sum Insured : -
Excess Clause : -
Windscreen Coverage : -
Type of Claims : Third Party Claims
Third Party Insurer : -
Third Party Policy No. : -

REFERENCE

Assigned By : As above
Accident Date : 06 April 2022
Assignment Date : 19 April 2022
Inspection Date : 20 April 2022
Our Reference No. : PAS/DT/220213/TP

Inspection Report Date : 06 May 2022

Name of Workshop :

Dynacle Transportation & Workshop Pte Ltd

Inspection Address :

**22 SIN MING LANE #06-76 MIDVIEW CITY
SINGAPORE 573969**

PARTICULARS OF VEHICLE

Registration No.	: CB 7545 C	Mileage	: 349699	Km/h
Make/Model	: MITSUBISHI ROSA BUS BE641JRMDEB 23 Jun	Radio/Cassette	: Fitted	
Yr of Manuf/Regn	: 24 Feb 2015	CD Disc Player	: Fitted	
Carrying Capacity	: 23 Passengers	Air Conditioner	: Fitted	
Chassis No.	: BE641JJ10132	Clock	: Fitted	
Engine No.	: 4P10B26434	Seat Belt	: Fitted	
Colour	: Metallic White	Wing Mirror	: Fitted	
Class	: School Bus	Other Accessories	: Fitted	

PRE-ACCIDENT CONDITION (Static Check Only)

Body Work : Good
Paint Work : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Any Apparent
Eng Modifications : None

VEHICLE VALUE

Market Value : X
Wreck Value (Parf) : X

TYRE SIZE & CONDITION

Front N/s Size : 205/85R16 80 %
Make : TRIANGLE
Rear N/s size : 205/85R16 80 %
Make : WESTLAKE
Spare Size : 205/85R16 80 %
Make : TRIANGLE

Front O/s Size : 205/85R16 80 %
Make : TRIANGLE
Rear O/sSize : 205/85R16 80 %
Make : WESTLAKE
Spare Size
Make
Jack & Tools : Intact/Missing

Type of Wheel Rims: Standard

Note: The above percentage % represent the estimated remaining tyre threads.

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/Adjusters Cargo Surveyors & Licensed Appraisers




VEHICLE REGISTRATION NO. : CB 7545 C

APPENDIX A

POINT OF IMPACT

Direction of impact/damage marked (→) (X)

The vehicle sustained impact on its Rear Portion (see Diagram A)

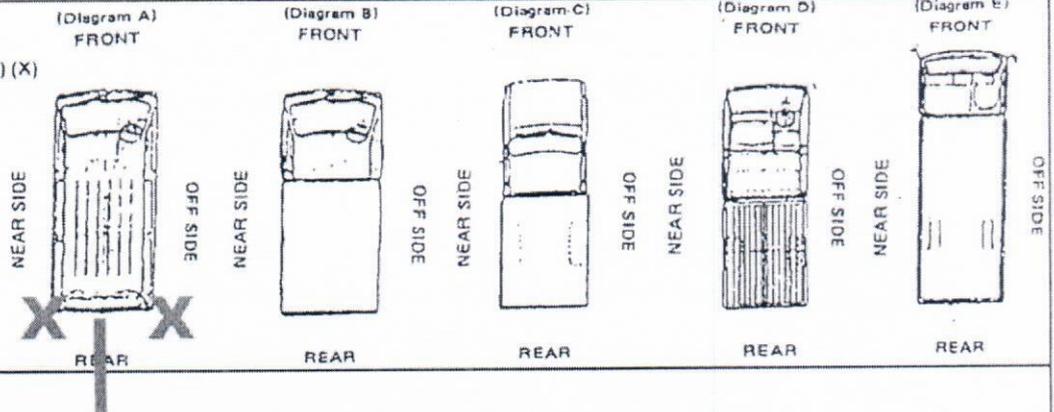

GENERAL DESCRIPTION OF DAMAGES

Parts damaged were :

The rear n/s door and lower hinge, rear o/s door and lower hinge, rear bumper and panel, rear panel lower beam were dented.

ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 20/04/2022 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s Dynacle Transportation & Workshop Pte Ltd as per attached Appraisal Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Lump Sum Repair Basis of \$9,900.00 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts :	15030	33	8630	92
Towing Charges :	X	X	X	X
PB Labour Charges :	1800	00	1400	00
Others Misc Charges :	1200	00	960	00
Paintwork :	1800	00	1400	00
Total :	\$ 19830	33	\$ 12390	92

Under normal circumstances, the duration of repairs should not exceed Ten(10) days including Pre - Repair Inspection (PRI) / Pre - Repair Survey (PRS) waiting time frame & Public Holidays .

Attached photographs taken during inspection Fifty - Nine(59) Photographs

SPECIAL REMARKS

1. The inspection was conducted on a 'without prejudice' basis
2. On 23/04/2022, we examined the extent of damages
3. On 29/04/2022, we examined the repaired vehicle.

Yours FaithFully

TF PHILIP FOO
AIMI CAE, AMIMI
AIAME, AMSAE-A
Licensed Appraiser/Adjuster

Inspection Report Date: 06 May 2022

VEHICLE REGN NO : CB 7545 C
 OUR REFERENCE : PAS/DT/220213/TP
 INSPECTION REPORT DATE : 6-May-22

APPRAISEMENT SCHEDULE

CONTINUATION SHEET NO : 1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount \$ cts	Recommendation / Revised Amount \$ cts
<u>PARTS SUPPLY - LIST ITEMS</u>					
1	1pc	Rear bumper	Badly Crumpled	1485.74	1485.74
2	12pcs	Rear bumper nuts@\$6	Necessary	72.00	72.00
3	1pc	Rear bumper tow hook cover	Broken	220.00	220.00
4	1pc	Rear bumper reflector n/s	Broken	240.00	240.00
5	1pc	Rear bumper reflector o/s	Broken	240.00	240.00
6	1pc	Rear n/s door	Badly Dented/Warped	3828.28	3828.28
7	1pc	Rear o/s door	Badly Dented/Warped	3936.67	3936.67
8	1pc	Rear n/s door lower hinge	Bent	320.00	Repair
9	1pc	Rear o/s door lower hinge	Bent	320.00	Repair
10	1pc	Rear panel lower centre beam	Badly Dented/Warped	1485.20	1485.20
11	1pc	Rear frame panel	Badly Dented	2882.44	Repair
				15030.33	11507.89
		Less: 25% discount		-	2876.97
				15030.33	8630.92
<u>LABOUR & MISC. CHARGES</u>					
1		Remove the necessary affected parts, straighten rear lower frame panel, both rear chassis, rear n/s door lower hinge, rear o/s door lower hinge and replace parts		1800.00	1400.00 800
2		Remove and refit rear n/s door parts		150.00	120.00 X
3		Putty and Spraypaint on all affected parts		1800.00	1400.00 400
4		Check electrical		100.00	80.00 30
5		Remove and refit rear o/s door parts		150.00	120.00 30
6		Remove and refit rear n/s door window		150.00	120.00 X
7		Remove and refit rear o/s door window		150.00	120.00 30
8		Straighten both rear chassis using Chassis Alignment Bench		500.00	400.00 X
		Note: Recommended lump sum repair at \$9,900.00nett			7 days
				xxx 19830.33	12390.92
SUB / GRAND TOTAL					

PRECISION APPRAISAL SERVICES

[Handwritten signature]