

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD INV No. AC2300697

3 ANSON ROAD #16-00 INV Date 06/02/2023 SPRINGLEAF TOWER Reference CC3/CT122

SPRINGLEAF TOWER
SINGAPORE 079909
Reference CC3/CTI22004051/Tpa3q2

Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 7672D

Insured Veh. SGU 2641T

Claim No. SNM22D203221/C02

Policy No. DMPCSNW00173742100

Accident Date 27/04/2022

Inspection Date 28/04/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile									
	CHINA TAIPING IN	ISURANCE (S) PTE LTD		Ref:	CC3/CTI22004051/Tpa3q2				
	3 ANSON ROAD # SPRINGLEAF TOV	16-00 VERSINGAPORE 079909		Date:	06/02/2023				
				Code:	CTI				
1.		Policy Particulars :	:- THIRD PART	Y CLAIN					
	Insured Veh.	SGU 2641T	Veh. Inspected	d	SHC 7672D				
	Policy No.	DMPCSNW00173742100	Coverage (\$)		0.00				
	Claim No.	SNM22D203221/C02	Excess (\$)		0.00				
	Assign From		Assign Date		28/04/2022				
2.	2. Vehicle Particulars & Condition								
	Make & Model	HYUNDAI IONIQ	c.c		1580				
	Engine No.	HIDDEN	Year of Reg.		2019				
	Chassis No.	KMHC851CVLU180942	Colour		YELLOW				
	Odometer	282089 KM	Steering		IN ORDER				
	Brakes	IN ORDER	Modification		NIL				
	General	GOOD							
3.		Condition	ons of Tyres						
		Size	Make		Balance				
	R/H Front Tyre	195/65 R15	WEST LAKE		6 mm				
	L/H Front Tyre	195/65 R15	WEST LAKE WEST LAKE		6 mm				
	R/H Rear Tyre	195/65 R15			6 mm				
	L/H Rear Tyre	195/65 R15	WEST LAKE		6 mm				
4.		Description	on of Damages						
	THE VEHICLE SUS	STAINED DAMAGES AT THE REA	AR PORTION.						
	DAMAGES SEE DETAILS.								
5.		General	Information						
	Accident Date	27/04/2022	Inspection Da	te	28/04/2022				
	Survey held at	urvey held at COMFORTDELGRO ENGINEERING PTE LTD							
		59 LOYANG DRIVE SINGAPORE 508969							
5a.		Re	emarks						
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.								
5b.	Estimate Days of Repair								
	ESTIMATED NORM	STIMATED NORMAL PERIOD FOR REPAIR: 2 Working Days							



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 7672D

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER	TO REPAIR SEE LABOUR	459.40	-
2	REAR BUMPER SIDE BRACKET LH/RH @\$55.80	NOT NECESSARY	111.60	-
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	394.80	-
2	REAR BUMPER REINFORCEMENT STAY LH/RH @\$138.10	NOT NECESSARY	276.20	-
1	REAR BUMPER CENTRE MOULDING	DEFORMED	451.25	451.25
1	REAR BUMPER LOWER CENTRE MOULDING	NOT NECESSARY	155.00	-
1	REAR BUMPER TOW COVER	NOT NECESSARY	98.80	-
1	REAR BUMPER FOG LAMP	NOT NECESSARY	201.50	-
2	REAR NUMBER PLATE LAMP @\$85.30	NOT NECESSARY	170.60	-
1	REAR SMART KEY SENSOR	NOT NECESSARY	40.50	-
2	REAR BUMPER REFLECTOR LH/RH @\$41.45	NOT NECESSARY	82.90	-
10	REAR BUMPER CLIPS @\$2.20	NECESSARY	22.00	22.00
	LESS 20% DISCOUNT		-492.91	-94.65
			1,971.64	378.60
	SPECIAL NETT ITEMS			
1	REAR BUMPER MAT (SN)	NOT NECESSARY	50.00	-
1	REAR REVERSE SENSOR (SN)	NOT WORKING	180.00	180.00
1	REAR BUMPER NUMBER PLATE W/HOLDER (SN)	CRACKED	55.00	55.00
			285.00	235.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR BUMPER .		600.00	350.00
	SPRAY PAINTING CHARGE.		300.00	250.00
	CHECK LIGHTING AND WIRING.	NOT NECESSARY	60.00	-
	TUFF KOTE.	NOT NECESSARY	60.00	-
	REMOVE/REFIX REVERSE SENSOR .		60.00	30.00
			1,080.00	630.00
	GRAND TOTAL		3,336.64	1,243.60

Report Ref No. CC3/CTI22004051/Tpa3q2



Page No.:2 of 2

RECOMMENDED COST OF REPAIRS 1,243.60

Report Ref No. CC3/CTI22004051/Tpa3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

mont

HO LEONG CHUAN

Automotive Assessor



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 7672D

INSPECTION
















51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





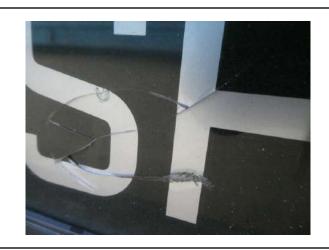









51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R











