

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors/ Adjusters Cargo Surveyors & Licensed Appraisers
227 Simei St 4 #06-42 Singapore 520227 Fax: 64444886 Company Registration No. 53139926E



AUTOMOBILE INSPECTION REPORT

To:

THO WAI YEAP

**C/O Block 1, 387 Woodlands Road Yew
Tee Industrial Estate Singapore 677954**

INSURANCE DETAILS

Insured : -
Policy No. / Claim No. : -
Sum Insured : -
Excess Clause : -
Windscreen Coverage : -
Type of Claims : Third Party Claims
Third Party Insurer : -
Third Party Policy No. : -

REFERENCE

Assigned By : As above
Accident Date : 01 March 2022
Assignment Date : 14 March 2022
Inspection Date : 14 March 2022
Our Reference No. : PAS/EH/220131/TP

Inspection Report Date : 21 March 2022

Workshop Name :

ENG HUP AUTO PARTS ACCESSORIES CO

Inspection Address :

**Block 1, 387 Woodlands Road Yew Tee
Industrial Estate Singapore 677954**

PARTICULARS OF VEHICLE

Registration No. : PEQ 6382
Make/Model : PROTON WIRA 1.3GL A/BACK
Yr of Manuf/Regn : -
Carrying Capacity : 4 Seater
Chassis No. : PL1C96LNRYB489153
Engine No. : 4G13PHA1755
Colour : Metallic Grey
Class : Passenger (Private)

Mileage : 332324 Km/h
Radio/Cassette : Fitted
CD Disc Player : Fitted
Air Conditioner : Fitted
Clock : Fitted
Seat Belt : Fitted
Wing Mirror : Fitted
Other Accessories : Fitted

PRE-ACCIDENT CONDITION (Static Check Only)

Body Work : Good
Paint Work : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Any Apparent :
Eng Modifications : None

VEHICLE VALUE

Market Value : -
Wreck Value (Parf) : -

TYRE SIZE & CONDITION

Front N/s Size : 175/70R13 80 %
Make : EVOTECHNO
Rear N/s size : 175/70R13 80 %
Make : EVOTECHNO
Spare Size : 175/70R13 80 %
Make : EVOTECHNO

Front O/s Size : 175/70R13 80 %
Make : EVOTECHNO
Rear O/sSize : 175/70R13 80 %
Make : EVOTECHNO
Spare Size :
Make :
Jack & Tools : Intact

Type of Wheel Rims: Alloy

Note: The above percentage % represent the estimated remaining tyre threads.

PRECISION APPRAISAL SERVICES

Insurance Loss Assessors / Adjusters Cargo Surveyors & Licensed Appraisers



VEHICLE REGISTRATION NO. : PEQ 6382

APPENDIX A

POINT OF IMPACT

(Diagram A)

FRONT

(Diagram B)

FRONT

(Diagram C)


FRONT

(Diagram D)

FRONT

Direction of impact/damage marked (→) (X)


The vehicle sustained impact on its Rear O/s Portion. (see Diagram D)

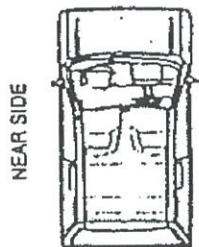

NEAR SIDE

OFF SIDE

REAR

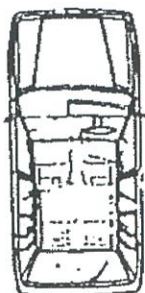


REAR

NEAR SIDE

OFF SIDE

REAR

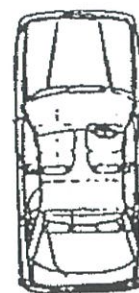

NEAR SIDE

OFF SIDE

REAR



NEAR SIDE

OFF SIDE

GENERAL DESCRIPTION OF DAMAGES

Parts damaged were : **The bootlid, rear o/s fender and taillamp panel, rear bumper were dented.**

ADJUSTMENTS & RECOMMENDATIONS

A static inspection was carried out on 14/03/2022 & our report is here with enclosed for your perusal. The Repairs Estimate submitted by M/s ENG HUP AUTO PARTS ACCESSORIES CO as per attached Appraisal Schedule have been revised and scrutinised thoroughly by us & in our opinion, we consider it to be fair and reasonable. The repairer has agreed to effect repairs to the owners satisfaction & to roadworthy condition on an agreed Lump Sum Repair Basis of \$4,900.00 after deducting the Policy Excess Clause of \$ NA. As instructed, we have not authorised any of the repairs on your behalf.

	Repairer's		Our	
	Estimate	Amount	Revised	Amount
Spares Parts	5012	00	4104	50
Towing Charges	X	X	X	X
PB Labour Charges	1200	00	980	00
Others Misc Charges	100	00	70	00
Paintwork	1400	00	980	00
Total	\$ 7712	00	\$ 6134	50

Under normal circumstances, the duration of repairs should not exceed Five (05) days

including Pre-Repair Inspection (PRI) / Pre - Repair Survey (PRS) waiting time frame.

Attached photographs taken during inspection Sixty (60) Photographs.

SPECIAL REMARKS

Yours Faithfully,

1. The inspection was conducted on a 'without prejudice' basis
2. On 15/03/2022, we examined the extent of damages.
3. On 18/03/2022, we examined the repaired vehicle.



TF PHILIP FOO
AIMI CAE, AMIMI
AIAME, AMSAE-A
Licensed Appraiser/Adjuster

Inspection Report Date: 21 March 2022

VEHICLE REGN NO : PEQ 6382
OUR REFERENCE : PAS/EH/220131/TP
INSPECTION REPORT DATE : 21-Mar-22

APPRAISEMENT SCHEDULE

CONTINUATION SHEET NO : 1

S/No	Qty	Parts / Labour Descriptions	Remarks / Condition	Repairer's Estimate Amount	Recommendation / Revised Amount
		<u>PARTS SUPPLY - LIST ITEMS</u>		\$ cts	\$ cts
1	1pc	Bootlid	Dented/Defaced	1400.00	1400.00
2	1pc	Bootlid 'Proton' emblem	Necessary	56.00	56.00
3	1pc	Bootlid 'Wira' emblem	Necessary	56.00	56.00
4	1pc	Bootlid reflector pad o/s	Necessary	20.00	20.00
5	1pc	Bootlid reflector o/s	Cracked	155.00	155.00
6	1pc	Rear o/s fender	Badly Dented	1088.00	1088.00
7	1pc	O/s Taillamp	Cracked	298.00	298.00
8	1pc	O/s Taillamp panel	Badly Dented	418.00	418.00
9	1pc	O/s Taillamp pad	Necessary	20.00	20.00
10	1pc	Rear panel	Badly Dented	457.00	Repair
11	1pc	Rear bumper	Badly Dented	704.00	704.00
12	1pc	Rear bumper beam	Badly Dented	290.00	290.00
				4962.00	4505.00
		Less: 10% discount		-	450.50
				4962.00	4054.50
		<u>SPECIAL NETT ITEMS</u>			
1	1set	Rear panel sealant	Necessary	50.00	50.00
				5012.00	4104.50
		<u>LABOUR & MISC. CHARGES</u>			
1		Remove the necessary affected parts, straighten rear panel, rear o/s fender, o/s taillamp panel and replace parts		1200.00	980.00
2		Putty and Spraypaint		1400.00	980.00
3		Check electrical		50.00	40.00
4		Tuff Kote		50.00	30.00
		Note: Recommended lump sum repair at \$4,900.00nett			
SUB / GRAND TOTAL				7712.00	6134.50

PRECISION APPRAISAL SERVICES

