

(DB/11/20) wef


ASS. REC. BY:

REF: CS/CTI 22004355/Dm<sup>3</sup>**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
 repair at the time of inspection.

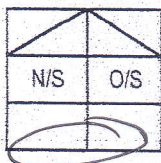

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: 7 days Res.: Yes or No  
 Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: GBD 2759 L Yr Regn: Aug 2014  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Hiace C.C. 2982  
 Colour: White A/C: Insured / Std / NI / NA  
 Sp. Reading: 203405 T/Radio: Insured / Std / NI / NA  
 Eng/No: 1KD2427577  
 C/No: JTFHT02P100146368

Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 195/7 195R15R: — 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Maxxis

Front 5 mm Rear 5 mm  
 R/Bal. 5 mm R/Bal. 5 mm  
 L/Bal. 5 mm L/Bal. 5 mm  
 D.O.A. 07/05/2022 D.O.I. 11/05/2022

Survey held at Goh Lee Hwa AMK

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

China Taping GBC 6155LMV 31KLTA 8.7KHL 22.3K30/07/22 Insured L/S 7,200/- with 7 dgs.

Date/Time, File Pass to?

☐ : Preli. Report  
☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee: \_\_\_\_\_

Transportation: \_\_\_\_\_

Add Fee: ☐

Site Insp (\$

Interview (\$

Tech. Invs (\$

Weekend (\$

) \$ + RS. SI

) Photos

) Others

Report Format : \_\_\_\_\_

Lump Sum / I.B.I. (\$) \_\_\_\_\_

TOTAL

# GOH LEE HWA AUTOMOBILE PTE LTD

Block 5033 Ang Mo Kio Industrial Park 2

#01-255 Singapore 569536

Tel No: (65) 6482 5168

Fax No. (65) 6482 4452

Co.reg no. 200808259H

Reference No: 90522

[WITHOUT PREJUDICE SAVE AS TO COSTS]

Date: 09.05.2022

ASIA Fabrication Pte Ltd

31 Woodlands Close #07-13 Woodlands Horizon

Singapore 737855.

Toyota Hiace

Estimated Repair Cost for Vehicle Reg. No: GBD 2759 L

## REPLACEMENT OF DAMAGED PANELS / PARTS

|                                                           |          |                    |
|-----------------------------------------------------------|----------|--------------------|
| 1 Pc. Rear Boot <i>Buc</i>                                |          | 2,190.80 ✓ 1855.00 |
| 1 Pc. Rear Boot Inner Board <i>HH</i>                     |          | 580.70 X           |
| 2 Pcs. Rear Boot Hinger <i>HH</i>                         | @ 68.40  | 136.80 X           |
| 2 Pcs. Rear Boot Absorber <i>HH</i>                       | @ 399.50 | 799.00 X           |
| 1 Pc. Rear Boot Inner Lock <i>Dam</i>                     |          | 509.10 ✓ 376.90    |
| 1 Pc. Rear Boot Open Handle <i>HH</i>                     |          | 110.40 X           |
| 1 Pc. Rear Boot Centre Handle Garnish <i>mainly crack</i> |          | 218.40 ✓           |
| 2 Pcs. Rear Boot No. Plate Lamp <i>HH</i>                 | @ 69.20  | 138.40 X           |
| 1 Pc. Rear Boot Logo <i>Hec</i>                           |          | 71.40 ✓ 59.10      |
| 1 Pc. Rear Boot 70 KM/H Sticker <i>Hec</i>                |          | 10.00 ✓ SH         |
| 1 Pc. Rear Boot Lock Catch <i>req</i>                     |          | 69.90 X            |
| 1 Pc. Rear Windscreen <i>broken</i>                       |          | 910.40 ✓           |
| 1 Pc. Rear Windscreen Repair Kit, Sealant <i>Hec</i>      |          | 180.00 ✓ 40/- SH   |
| 1 Pc. Rear Windscreen Seal <i>HH</i>                      |          | 110.10 X           |
| 2 Pcs. Rear Lamp Assy. <i>crack/broken</i>                | @ 331.00 | 662.00 ✓           |
| 2 Pcs. Rear Lamp Lower Garnish <i>o/s HH w/s cut</i>      | @ 69.10  | 138.20 ✓           |
| 1 Pc. Rear Bumper <i>Dent/broken</i>                      |          | 481.40 ✓           |
| 2 Pcs. Rear Bumper Bracket <i>o/s HH w/s broken</i>       | @ 65.10  | 130.20 ✓           |
| 10 Pcs. Rear Bumper Clips <i>Hec</i>                      | @ 6.90   | 69.00 ✓ 20/- SH    |
| 2 Pcs. Rear Bumper Side Retainer <i>o/s HH w/s 1st</i>    | @ 68.30  | 136.60 ✓           |
| 1 Pc. Rear End Panel <i>Dent</i>                          |          | 480.80 ✓           |
| 1 Pc. Rear End Inner Panel <i>Dent</i>                    |          | 690.10 ✓           |
| 1 Set. Rear Parking Sensor <i>Dam</i>                     |          | 398.00 220/- SH    |
| 1 Set. Rear Camera <i>SVC</i>                             |          | 499.00 X           |
| 1 Pc. Rear LH Fender <i>Dent</i>                          |          | 1,346.40 ✓         |
| 1 Pc. Rear Boot mirror <i>assy broken</i>                 |          | 498.00 ✓           |

**GOH LEE HWA AUTOMOBILE PTE LTD**

Block 5033 Ang Mo Kio Industrial Park 2

#01-255 Singapore 569536

Tel No: (65) 6482 5168

Fax No. (65) 6482 4452

Co.reg no. 200808259H

|                                                               |                       |
|---------------------------------------------------------------|-----------------------|
| 1 Pc. Rear LH Fender Air Dust <del>310.35</del> <i>230.50</i> | 110.50 <del>*</del> ✓ |
| 1 Pc. Rear Spare Tyre Screw <del>204.10</del> <i>151</i>      | 204.10 <del>*</del> ✓ |
| 1 Pc. Spare Tyre Bracket <del>310.35</del> <i>151</i>         | 310.35 ✓ 230.50       |
| 1 Pc. Floorboard Panel <del>1,999.00</del> <i>599.00</i>      | 1,999.00 <del>x</del> |
| 1 Pc. Floorboard Wood <del>599.00</del> <i>44</i>             | 599.00 <del>x</del>   |
| 1 Pc. Floorboard Carpet <del>890.00</del> <i>44</i>           | 890.00 <del>x</del>   |
| 1 Pc. No. Plate & Box <del>50.00</del> <i>45/- SH</i>         | 50.00 45/- SH         |

Total (Panels / Parts): **15,230.05 (SGD)**

SH 335.00 = List 8011.50 8426.10 8326.10  
 25% 6008.62 6319.57 6244.57

**LABOR CHARGES**

To remove &amp; refit wire &amp; check all wiring on all Accident affected area.

200.00 30/-

To vacuum, cleaning all damaged glass.

120.00 50/-

To remove &amp; refit rear inner tools box &amp; floorboard Cover.

400.00 180/-

To renew rear windscreen.

2420.00 =

150.00 120/-

To welding, knocking, straightening repair &amp; renew All accident damaged affected area.

1,800.00 1000/-

To respray painting on inner side, outer &amp; all accident affected area.

1,800.00 1000/-

To rust proof all welding &amp; accident affected area.

200.00 40/-

Total (Labor Charges): **4,670.00 (SGD)**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Page 2 of 3

11/05/2022 @ 1030hrs

Not Andon

LKK Auto 7 days.

LKK Auto

8999.57

L/S 7,200/-

**GOH LEE HWA AUTOMOBILE PTE LTD**

Block 5033 Ang Mo Kio Industrial Park 2

#01-255 Singapore 569536

Tel No: (65) 6482 5168

Fax No. (65) 6482 4452

Co.reg no. 200808259H

**TOTAL COST SUMMARY**

|                |                               |
|----------------|-------------------------------|
| PANELS / PARTS | 15,230.05                     |
| LABOR CHARGES  | 4,670.00                      |
| <hr/>          |                               |
| Grand Total:   | <b><u>19,900.05 (SGD)</u></b> |

For payment.

1. PAYNOW: UEN 200808259H
2. BANK TRANSFER: Maybank Singapore Acct. No. 04141090974

| ACKNOWLEDGED BY | DATE | GOH LEE HWA AUTOMOBILE PTE LTD |
|-----------------|------|--------------------------------|
|                 |      | <i>Alfred Quah</i>             |

Note: Full payment must be completed 7 days from the invoice date. There will be an interest of 1.5% imposed per month on overdue invoice. Thank you.