



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301304

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/03/2023
Reference CC6/CTI22004458/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 3976Y
Insured Veh. SJP 8770E
Claim No. SNM22D203056/C02
Policy No. DMPCSNW00077052201
Accident Date 05/05/2022
Inspection Date 09/05/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22004458/Apa3q2 Date: 06/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJP 8770E	Veh. Inspected	SKZ 3976Y	
Policy No.	DMPCSNW00077052201	Coverage (\$)	0.00	
Claim No.	SNM22D203056/C02	Excess (\$)	0.00	
Assign From		Assign Date	09/05/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	RU11107809	Colour	WHITE	
Odometer	446214 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	TOURADOR	6 mm	
L/H Front Tyre	215/55 R17	TOURADOR	6 mm	
R/H Rear Tyre	215/55 R17	TOURADOR	6 mm	
L/H Rear Tyre	215/55 R17	TOURADOR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/05/2022	Inspection Date	09/05/2022	
Survey held at	MAX MOTORS 1 KAKI BUKIT AVE 6 #01-98 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 3976Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAILGATE	DENTED	1,287.10	1,100.00
1	SET TAILGATE GLASS MOULDING	NOT NECESSARY	121.20	-
1	TAILGATE OUTER GARNISH	NOT NECESSARY	391.40	-
1	TAILGATE EMBLEM 'H'	NOT NECESSARY	48.60	-
1	TAILGATE EMBLEM 'VEZEL'	NECESSARY	58.60	58.60
2	TAILGATE LAMPS -L/R @\$470.30	NOT NECESSARY	940.60	-
1	TAILGATE INNER LOCK	DAMAGED	280.60	280.60
1	TAILGATE INNER TRIM BOARD	CRACKED	486.90	305.00
1	TAILGATE INNER PULL POCKET	NOT NECESSARY	89.90	-
1	TAILGATE W/STRIP	CUT	198.70	198.70
2	TAILGATE DAMPERS -L/R @\$140.40	NOT NECESSARY	280.80	-
2	TAILGATE STOPPERS @\$12.60	NOT NECESSARY	25.20	-
2	TAILLAMPS -L/R @\$528.10	NOT NECESSARY	1,056.20	-
1	REAR BUMPER	DEFORMED	891.60	745.00
2	REAR BUMPER REFLECTORS -L/R @\$171.20	CRACKED	342.40	242.00
2	REAR BUMPER SIDES -L/R @\$241.60	TO REPAIR SEE LABOUR	483.20	-
2	REAR BUMPER SIDE RETAINERS -L/R @\$48.60	NECESSARY	97.20	97.20
1	REAR END PANEL	DENTED	759.10	585.00
1	REAR END PANEL TRIM	DEFORMED	241.20	241.20
1	REAR EXHAUST SILENCER	NOT NECESSARY	547.60	-
1	REAR EXHAUST INSULATOR	NOT NECESSARY	130.20	-
1	REAR FLOOR BOARD	NOT NECESSARY	370.60	-
1	REAR FLOOR TOOL TRAY	NOT NECESSARY	361.80	-
1	REAR FLOOR PANEL	NOT NECESSARY	965.80	-
1	REAR FLOOR PANEL UNDERCOVER	DEFORMED	281.60	281.60
2	FENDER WHEEL ARCH GARNISHES @\$341.20	NOT NECESSARY	682.40	-
2	FENDER INNER TRM BOARDS -L/R @\$641.20	NOT NECESSARY	1,282.40	-
1	SMART KEYLESS ANTENA	DAMAGED	191.20	132.00
1	REAR SMARY KEYLESS BUZZEL	DAMAGED	196.80	95.00

Report Ref No. CC6/CTI22004458/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 20% DISCOUNT		-2,618.18	-872.38
			10,472.72	3,489.52
	<u>SPECIAL NETT ITEMS</u>			
1	SET TAILGATE GLASS SEALANT (SN)	NECESSARY	80.00	60.00
1	SET TAILGATE GLASS FOAM TAPE (SN)	NECESSARY	65.00	40.00
1	REAR BUMPER CHROME PLATE (SN)	DISTORTED	450.00	350.00
1	REAR BUMPER LOWER SPOILER (SN)	DEFORMED	650.00	500.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	45.00	30.00
1	SET REAR REVERSE SENSOR -4 PCS (SN)	DAMAGED	420.00	300.00
1	REAR REVERSE CAMERA (SN)	NOT NECESSARY	480.00	-
1	SET TAILGATE SURROUND MOULDING (SN)	NECESSARY	300.00	200.00
			2,490.00	1,480.00
	<u>LABOUR</u>			
	TO CHECK REAR ELECTRICAL WIRING.		80.00	30.00
	TO REMOVE,REFIX TAILGATE GLASS.		180.00	120.00
	TO REMOVE,REFIX REAR INTERIOR TRIMS TO ASSIST REPAIR.		150.00	60.00
	TO REMOVE,REFIX REAR REVERSE SENSOR /CAMERA.		120.00	100.00
	TRANSFER & REINSTALL TAILGATE COMPONENTS TO NEW TAILGATE.		150.00	80.00
	TO RESPRAY UNDERCOATING.		60.00	60.00
	TO RESPRAY PAINTING AND ETC.		1,300.00	800.00
	PANEL BEATING ,CUT ,WELD REMOVE & REPLACING ABOVE PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER SIDES -L/R.		1,500.00	800.00
			3,540.00	2,050.00
GRAND TOTAL			16,502.72	7,019.52
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,300.00

Report Ref No. CC6/CTI22004458/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 3976Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 3976Y

RE-INSPECTION

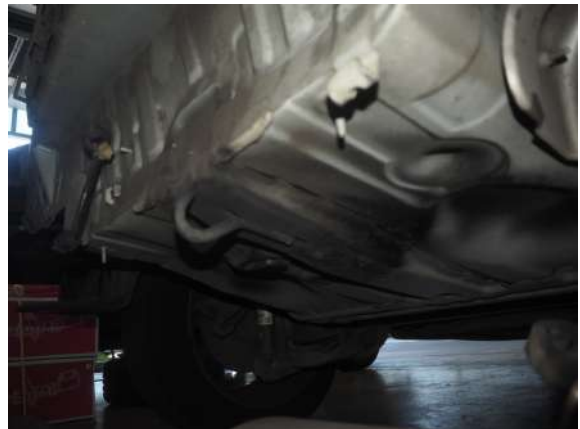



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 3976Y

RE-INSPECTION

