



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2303951

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/06/2023
Reference CC6/CTI22004533/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBC 8051K
Insured Veh. PA 8146R
Claim No. SNM22D203343C02
Policy No.
Accident Date 06/05/2022
Inspection Date 17/05/2022

Description	Total
Survey Inspection	280.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	280.00
GST (8%)	22.40
Grand Total	302.40

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22004533/Upa3q2 Date: 20/06/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	PA 8146R	Veh. Inspected	GBC 8051K	
Policy No.		Coverage (\$)	0.00	
Claim No.	SNM22D203343C02	Excess (\$)	0.00	
Assign From		Assign Date	17/05/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA HIACE (M)	c.c	2982	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	JTFHT02P900124909	Colour	WHITE	
Odometer	407601 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195 R15	AUSTONE	6 mm	
L/H Front Tyre	195 R15	AUSTONE	6 mm	
R/H Rear Tyre	195 R15	AUSTONE	6 mm	
L/H Rear Tyre	195 R15	AUSTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & REAR WINDSCREEN SHATTERED. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/05/2022	Inspection Date	17/05/2022	
Survey held at	LIU'S BROTHER AUTO ENGINEERING WORKSHOP 1 KAKI BUKIT AVENUE 6 #01-01 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBC 8051K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR TAILGATE	DENTED	2,050.00	2,050.00
1	REAR TAILGATE LOCK	SERVICEABLE	359.00	-
1	REAR TAILGATE WEATHERSTRIP	NOT NECESSARY	387.90	-
1	REAR TAILGATE (TOP) SIDE MIRROR	NOT NECESSARY	234.80	-
1	REAR TAILGATE WIPER MOTOR	NOT NECESSARY	604.40	-
1	REAR TAILGATE WIPER ARM	NOT NECESSARY	98.00	-
1	REAR TAILGATE WIPER BLADE	NOT NECESSARY	60.20	-
1	REAR TAILGATE NUMBER PLATE (METAL)	NOT NECESSARY	35.00	-
1	REAR TAILGATE NUMBER PLATE LAMP OUTER GARNISH	TO REPAIR SEE LABOUR	346.50	-
1	REAR TAILGATE 'TOYOTA LOGO' MOTIF	NECESSARY	70.50	70.50
1	REAR TAILGATE WINDSCREEN GLASS	SHATTERED	1,311.30	1,115.20
1	REAR TAILGATE WINDSCREEN MOULDING	NO SUCH PARTS	219.00	-
1	REAR 3RD BRAKE LAMP	NOT NECESSARY	234.20	-
2	REAR TAIL LAMP @\$365.10	NOT NECESSARY	730.20	-
1	REAR BUMPER	DEFORMED	465.00	465.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR END PANEL OUTER	TO REPAIR SEE LABOUR	566.10	-
	LESS 25% DISCOUNT		-	-937.68
			7,822.10	2,813.02
<u>SPECIAL NETT ITEMS</u>				
1	REAR TAILGATE '70KM/H' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR TAILGATE '8 PAX' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR BUMPER REVERSE SENSOR (SN)	SHORTED	220.00	200.00
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	50.00	-
			350.00	260.00
<u>LABOUR</u>				
	TO CHECK ALL WIRING & ELECTRICAL COMPONENT FOR PROPER FUNCTION .		80.00	20.00

Report Ref No. CC6/CTI22004533/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIX REAR TAILGATE COMPONENTS & WIPER MECHANISM .		100.00	60.00
	REMOVE AND REFIX REAR BUMPER REVERSE SENSOR .		120.00	50.00
	LABOR FOR PANEL BEATING ,CUT ,WELD ,STRAIGHTEN & REPLACING PARTS ETCS .INCLUSIVE OF THE REPAIR OF REAR TAILGATE NUMBER PLATE LAMP OUTER GARNISH AND REAR END PANEL OUTER .		700.00	300.00
	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED AREAS .		600.00	400.00
	TO APPLY RUST PROOFING ,RESEAL TUFF-COATING TREATMENT ON ACCIDENT AREA .		80.00	30.00
	REMOVE & REINSTALL TAILGATE GLASS TO FACILITATE REPAIRS .		120.00	120.00
			1,800.00	980.00
GRAND TOTAL			9,972.10	4,053.02
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,200.00

Report Ref No. CC6/CTI22004533/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 8051K

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

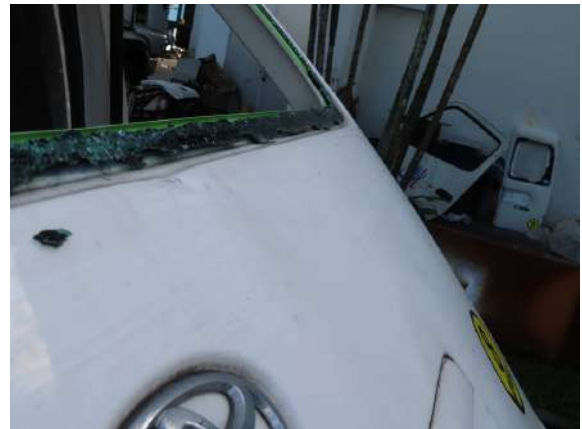



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBC 8051K

RE-INSPECTION

