



T & C AUTOMOBILE ASSESSORS

CHEW KIM YONG
C/O MING HUA AUTO SERVICES
160 Sin Ming Drive
#02-16 Singapore 575722

REF : TC/2019/469

DATE : 23/9/2018

VEHICLE SURVEY REPORT

REFERENCE

Requested By : Workshop, on behalf of owner
Date of Request : 11/9/2018
Date of Accident : 9/9/2018
Date of Inspection : 11/9/2018
Inspected At : Ming Hua Auto Services
160 Sin Ming Drive
#02-16 Singapore 575722

PARTICULARS OF VEHICLE

Vehicle Registration No : SLH7253G Make & Model : TOYOTA HARRIER PREMIUM 2.0 A
Year Make : 2016 Colour : RED
Engine No : 3ZRB866969 Chassis No. : ZSU600087515
Engine Capacity : 1986cc

CONDITION OF VEHICLE AND TYRES

General Condition : Good Mileage : 62124
Brakes : Serviceable Modification : None
Steering : Serviceable Handbrake : Serviceable

<u>Tyres</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>
Front RHS	Bridgestone	235/55R18	5
Front LHS	Bridgestone	235/55R18	5
Rear RHS	Bridgestone	235/55R18	6
Rear LHS	Bridgestone	235/55R18	6

DESCRIPTION OF DAMAGES

The Vehicle sustained damages at the rear portion.
(For information of damages, please refer to Parts/Labour/Photographs attached)

INSTRUCTION

This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.

**T & C AUTOMOBILE ASSESSORS****ADJUSTMENT ON REPAIR COST & REPLACEMENT OF PARTS**

Vechile No : SLH7253G

Report No : TC/2019/469

<u>S/NO</u>	<u>QTY</u>	<u>DESCRIPTION</u>	<u>CONDITION/ REMARKS</u>	<u>REPAIRER'S ESTIMATES</u> S\$	<u>OUR ASSESSMENT</u> S\$
1	1	Front bumper	Deformed	1,398.70	1,398.70
2	1	Front bumper lower lid	Deformed	641.20	641.20
3	1	Front bumper lower splash guard	Deformed	582.70	582.70
4	1	Front LH bumper side retainer	Broken	96.30	96.30
5	1	Front bumper reinforcement	Bent	949.80	949.80
6	1	Front LH bumper sponge	Broken	82.40	82.40
7	1	Front LH bumper bracket	Bent	163.90	163.90
8	1	Front bumper top bracket	Bent	571.60	571.60
9	1 set	Front bumper clips	Necessary	60.00	60.00
10	1	Front grille assy	Broken	982.10	982.10
11	1	Front grille top rubber moulding	Torn	118.70	118.70
12	1	Front bonnet	Buckled	1,497.20	1,497.20
13	1	Front LH fender	Dented	744.90	744.90
14	1	Front LH fender inner shield	Deformed	283.40	283.40
15	1 set	Front fender inner shield clips	Necessary	50.00	50.00
16	1	Front LH foglamp	Broken/cracked	566.70	566.70
17	1	Front LH foglamp cover	Necessary	191.50	191.50
18	1	Front LH headlamp	Broken/cracked	2,756.30	2,756.30
19	1	Front LH headlamp bracket	Bent	43.80	43.80
20	1	Front LH headlamp panel	Bent	272.50	272.50
21	1	Front RH headlamp	Broken/cracked	2,756.30	2,756.30
22	1	Front support LH side panel	Bent	647.20	647.20
23	1	Front LH lower arm	Bent	682.30	682.30
24	1	Front LH knuckle arm	Bent	733.10	733.10
25	1	Front LH wheel hub & bearing	Deformed	457.30	457.30
26	2	Front shock absorber	Bent	759.40	759.40
27	1	Drive shaft	Broken	1,143.10	1,143.10
				19,232.40	19,232.40
Less : Discount 10%				-1,923.24	-1,923.24
Total :				17,309.16	17,309.16

SPECIAL NETT ITEMS

28	1	18" sport rim	Dented	780.00	780.00
29	1	Tyre	Torn	650.00	650.00
30	1	Front number plate and casing	Dented	80.00	80.00
				1,510.00	1,510.00
Total Spare Parts :				18,819.16	18,819.16

**T & C AUTOMOBILE ASSESSORS****LABOUR CHARGES**

Vechile No : SLH7253G

Report No : TC/2019/469

<u>S/NO</u>	<u>DESCRIPTION</u>	<u>REPAIRER'S ESTIMATES S\$</u>	<u>OUR ASSESSMENT S\$</u>
1	To tow vehicle from Kluang to Singapore workshop.	1,200.00	1,200.00 X
2	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts.	2,200.00	1,900.00 600
3	To putty and respray painting on affected areas.	2,000.00	1,700.00 1,000
4	To rewire and check lightings for front portion.	150.00	100.00 30
5	To remove, refix front undercarriage.	750.00	650.00 120
6	To conduct computerised wheel alignment test.	150.00	120.00 60
7	To apply undersealing.	300.00	250.00 60
Total Labour Charges :		6,750.00	5,920.00
Total Spare Parts :		18,819.16	18,819.16
Total Repair Costs :		25,569.16	24,739.16

Assessor's Recommendation

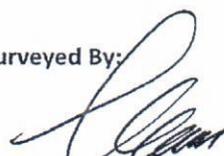
Repairer Estimate : 25,569.16

Our Adjustment : 24,739.16**Remarks**

The repairer has agreed to undertake the repair of S\$24,739.16, with a repair period of 13 working days.

6 days

Surveyed By:


 THAM KOK SANG