

LONG VIEW MOTOR WORKS

Block 4 Kranji Loop
#01-17, Singapore 739540
Tel: 6365 1775 / Fax: 6368 9791

29 April 2022

Vehicle No. : SLZ 4929 R
Make/Model : Kia Cerato K3
Chassis No. : KNAFZ411MJ5761577

Name : Ismail Bin Ahmad
Address : c/o Blk 4 Kranji Loop
#01-17
Singapore 739540

QTY	ITEM / PARTICULARS	\$
-----	--------------------	----

Third Party Accident Claim for vehicle no. SLZ 4929 R
Date of Accident: 16-Mar-2022

Lump Sum Costs of Repairs @ \$6,700.00
=====

SINGAPORE DOLLARS: SIX THOUSAND AND SEVEN HUNDRED ONLY

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
Blk 2 Rivervale Link, #09-02 Singapore 545040
Tel/Fax: 6886 1106 Mobile: 9007 5234
Email: constant_as@yahoo.com.sg
RCB No. 53138015K

Automobile Inspection Report

To: Ismail Bin Ahmad
110 Gangsa Road
#11-87
Singapore 670110

Date : 31/03/2022

Reference No : CAS/22-03/026

General Information

Registration No. : SLZ 4929R
Accident Date : 16/03/2022

Particulars of Damaged Vehicle

Colour	: Grey	Make & Model	: Kia Cerato K3
Engine Capacity	: 1591 cc	Pre-Accident Condition	: Good
Mileage (KM)	: 61112	Engine No.	: G4FGHH691646
Chassis No.	: KNAFZ411MJ5761577	Steering	: In Order
Registration Date	: 07/05/2018	Brake	: In Order

Tyre Condition

	Size	Make	Balance
R/H Front Tyre	215/45R17	BRIDGESTONE	90%
L/H Front Tyre	215/45R17	BRIDGESTONE	90%
R/H Rear Tyre	215/45R17	BRIDGESTONE	90%
L/H Rear Tyre	215/45R17	BRIDGESTONE	90%

Inspection

Repairer : Long View Motor Works
60 Jalan Lam Huat, #02-28 Carros Centre, Singapore 737869

Adjustment And Recommendation Cost Of Repair

Repairer's Estimate : \$11,290.74
Revised Amount : \$6,700.00
Less Excess : -
Nett Total : \$6,700.00

Remarks

- (A) Survey was done on 22/03/2022
- (B) Re-survey after repair was done on 28/03/2022
- (C) The survey was conducted entirely on WITHOUT PREJUDICE basis.
- (D) We have NOT given any instruction to authorize the repair of the vehicle.

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>PARTS REPLACEMENT – LIST ITEMS</u>			
1	1pc	Front door LH	Dented/Buckled	1,592.00	1,592.00
2	1pc	Front door glass outer moulding LH	Serviceable	162.00	-
3	1pc	Front door glass run channel LH	Necessary	195.00	195.00
4	1pc	Front door glass regulator LH	Serviceable	486.00	-
5	1pc	Front door weatherstrip LH	Necessary	189.00	189.00
6	1pc	Front fender LH	Dented/Buckled	685.00	685.00
7	1pc	Front fender inner shield LH	Deformed	197.00	197.00
8	1pc	Front fender enclosure LH	Serviceable	89.00	-
9	1pc	Rear door LH	Dented/Warped	1,360.00	1,360.00
10	1pc	Rear door glass run channel LH	Necessary	195.00	195.00
11	1pc	Rear door weatherstrip LH	Necessary	189.00	189.00
12	1pc	Side sill panel LH	Dented/Warped	806.00	806.00
13	1pc	Side sill panel skirt LH	Grazed/Broken	586.00	586.00
14	1pc	Rear fender LH	Repair	1,133.50	-
15	1pc	Rear fender quarter glass moulding LH	Not Necessary	98.20	-
16	1pc	Rear windscreen glass moulding	Not Necessary	171.45	-
				8,134.15	5,994.00
		Less 10%		(813.41)	(599.40)
			Sub total	7,320.74	5,394.60
		<u>PARTS REPLACEMENT – SPECIAL NETT ITEMS</u>			
1	1set	Front fender inner shield clip LH	Necessary	60.00	60.00
2	1set	Front door board clip LH	Necessary	45.00	45.00
3	1set	Rear door board clip LH	Necessary	45.00	45.00
4	1set	Front door black tape LH	Necessary	120.00	120.00
5	1set	Rear door black tape LH	Necessary	120.00	120.00
			Part total	7,710.74	5,784.60
		<u>LABOUR & MISC. CHARGES</u>			
1		To check electrical wiring & etc		50.00	20.00
2		To respray undercoating		150.00	90.00
3		Remove, transfer both door mechanism & electrical install to new door		180.00	140.00

Constant Appraiser Services

Vehicle No : SLZ 4929R

Our ref : CAS/22-03/026

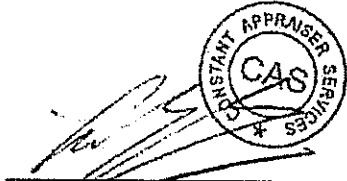
S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>LABOUR & MISC. CHARGES (CONT'D)</u>			
4		To repair & polish both sport wheel		200.00	120.00
5		To respray painting & etc		1,500.00	1,200.00
6		Panel beating, cut, weld, remove & replacing above parts		1,500.00	1,000.00
			Grand total	11,290.74	8,354.60
Recommended cost of lump sum repair (To its pre-accident condition)					6,700.00

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$6,700.00** on a contractual basis. Under normal circumstances, the repair period would be about **6 (Six)** working days.

Yours faithfully,

Constant Appraiser Services

Lim Yong Tian (Sebastian)
Licensed Appraiser
Adv. Dip. In Mechanical Engineering (AUS)
MSAAA