

---

---

**Vehicle Inspection Report**

To: Muhammad Saifullah Bin Shahul Hamid Date of report: 30.01.2021  
C/o: 160 Sin Ming Drive #05-16 Date of request: 29.12.2020  
Sin Ming AutoCity (S) 575722 Date of inspection: 29.12.2020  
Date of accident: 23.11.2020  
Report No: AAS/2020/287 Claim type: Third Party Claim

**Particulars of affected vehicle:**

Registration no:	FU8075A	Odometer:	99126 km
Make/Model:	Yamaha RXZ (Motorcycle)	Engine Capacity:	133 cc
Year of registration:	2002	Engine no:	3BS264234
Colour:	Red	Chassis no:	ZMC264234

**Condition of tires:**

Front: 6mm  
Make: Dunlop  
Rear: 6mm  
Make: Dunlop

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

**Pre-accident condition (Static tests only)**

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

**The Assignment**

The inspection was conducted at M/s. Toh Motor Enterprise  
160 Sin Ming Drive #05-16  
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

**Assessment**

Repairer's estimate:	\$ 6,153.40
Revised estimate:	\$ 5,173.00
Recommended reserve:	\$ 4,150.00 (Lump sum)

Estimated normal duration of repairs : 5 Working days



Vehicle No: FU8075A

Report No: AAS/2020/287

W/O PREJUDICE

Point of impact

At the RHS portion.

General description of damages

The front mudguard, front rim, front forks, headlight, headlight cowling, meter assy, fuel tank, footrests, exhaust pipe, RH cowling, body frame, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Toh Motor Enterprise as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$5,173.00

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$4,150.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 5 working days.

have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 135 photographs.

Your Faithfully  
Absolute Appraisal Services Pte Ltd



Nicky Seah  
Automobile Appraiser  
MSAAA / MSMCTA



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: FU8075A

Report No: AAS/2020/287


**Appraisal Schedule**

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Wheel rim front ✓	1	Dented/Grazed		\$ 335.00 <b>280</b>	\$ 335.00
2	Wheel bearing front ✓	2	Warped	\$ 40.00	\$ 80.00 <b>40</b>	\$ 80.00
3	Wheel shaft ✓	1	Bent		\$ 39.00 <b>25</b>	\$ 39.00
4	Nut wheel shaft ✓	1	Dented/Grazed		\$ 6.00 ✓	\$ 6.00
5	Disc brake front <b>SVC</b>	1	Refit		\$ 88.00	-
6	Mudguard front ✓	1	Broken		\$ 84.00 <b>68</b>	\$ 84.00
7	Brake caliper front ✓	1	Dented/Grazed		\$ 295.00 <b>212</b>	\$ 295.00
8	Lever brake ✓	1	Broken		\$ 32.00 <b>18</b>	\$ 32.00
9	Brake cylinder front <b>X SVC</b>	1	Grazed		\$ 220.00	\$ 220.00
10	Fork front LH/RH ✓	1	Grazed/Bent/Jammed	\$ 293.00	\$ 293.00 ✓	\$ 293.00
11	Under bracket comp	1	Distorted/Repair		\$ 253.00	-
12	Cone bearing ✓	1	Warped		\$ 130.00 <b>65</b>	\$ 130.00
13	Cowling front ✓	1	Grazed/Cut		\$ 78.00 ✓	\$ 78.00
14	Headlight <b>X SVC</b>	1	Grazed		\$ 164.00	\$ 164.00
15	Meter assy ✓	1	Grazed/Cut		\$ 511.00 <b>390</b>	\$ 511.00
16	Handlebar LH/RH ✓	2	RH Broken	\$ 97.00	\$ 194.00 <b>85</b>	\$ 97.00
17	Barend weight ✓	<del>1</del> <b>2</b>	Dented	\$ 33.00	\$ 66.00 <b>25</b>	\$ 66.00
18	Switch RH ✓	1	Button Cracked		\$ 189.00 ✓	\$ 189.00
19	Fuel tank ✓	1	Dented		\$ 590.00 <b>390</b>	\$ 590.00
20	Lever clutch ✓	1	Broken		\$ 32.00 <b>18</b>	\$ 32.00
21	Mirror RH ✓	1	Grazed		\$ 26.00 ✓	\$ 26.00
22	Pedal kick ✓	1	Dented/Grazed		\$ 72.00 ✓	\$ 72.00
23	Footrest front RH ✓	1	Dented		\$ 39.00 ✓	\$ 39.00
24	Footrest rear RH ✓	1	Dented		\$ 32.00 ✓	\$ 32.00
25	Footrest support RH ✓	1	Broken		\$ 255.00 <b>85</b>	\$ 255.00
26	Pedal brake ✓	1	Dented		\$ 43.00 ✓	\$ 43.00
27	Exhaust pipe ✓	1	Dented		\$ 670.00 <b>325</b>	\$ 670.00
28	Under cowling <b>SVC</b>	1	Refit		\$ 70.00	-
29	Cowling rear RH ✓	1	Broken		\$ 121.00 ✓	\$ 121.00
30	Rear shock RH <b>SVC</b>	1	Refit		\$ 198.00	-
31	Footrest front LH <b>X SVC</b>	1	Dented		\$ 39.00	\$ 39.00
32	Footrest rear LH <b>X SVC</b>	1	Dented		\$ 32.00	\$ 32.00

Total:	\$ 5,276.00 <b>2925</b>	\$ 4,570.00
-10%	\$ 527.60	\$ 457.00
List total:	\$ 4,748.40 <b>2632.5</b>	\$ 4,113.00

1	Front tyre <b>X SVC</b>	1	Affected	90%	\$ 150.00	\$ 135.00
2	Handle grip <b>SVC</b>	1set	Refit		\$ 40.00	-
3	Brake fluid <b>X SVC</b>	1	Necessary		\$ 20.00	\$ 20.00
4	Front number plate ✓	1	Grazed		\$ 20.00	\$ 20.00 <b>10</b>

Special nett total:	\$ 230.00	\$ 175.00
---------------------	-----------	-----------

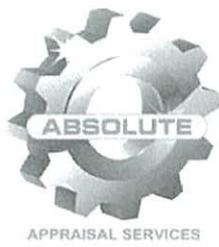

Vehicle No: FU8075A

Report No: AAS/2020/287

	Parts Total:	\$ 4,978.40	\$ 4,288.00
S/N	Labour Description	Repairer's Est	Revised Est
1	Check lightings & wirings.	\$ 30.00	\$ 20.00 <del>X</del>
2	Renew & conduct fork alignment.	\$ 180.00	\$ 150.00 <del>X</del>
3	Repair, straighten & refurbish body frame.	\$ 400.00	\$ 250.00 <del>X</del>
4	Renew damaged parts, re-align affected area.	\$ 500.00	\$ 400.00 <sup>250</sup>
5	Towing fee.	\$ 65.00	\$ 65.00 <sup>50</sup>
	Labour Total:	<u>\$ 1,175.00</u>	<u>\$ 885.00</u>
	Grand Total:	\$ 6,153.40	\$ 5,173.00

The final adjusted lump sum amount is \$4,150.00

Under normal circumstances, the repair should be completed within a reasonable period of 5 working days.

**2942.5**  
**-20%: 2350**  
**3 Days**

135 Photographs were taken at the time of inspection.