



6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Claim Reference : -
Insured Vehicle No. : -
Thirty Party Veh No. : -
Officer-In-Charge : -

Our Reference : KAAS/TA/6035/8480/TP/07.20
Invoice No. : 6035
Date : 08 August 2020

To: Asia Express Car Rental Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

INVOICE

PARTICULARS	AMOUNT
Vehicle No. : SMH 8480Z Make/Model : Honda Freed Hybrid 1.5G (A) <input checked="" type="checkbox"/> Inspection of Vehicle <input checked="" type="checkbox"/> Appraisal Report <input checked="" type="checkbox"/> 130 Colored Photographs <input checked="" type="checkbox"/> Transport charges <input checked="" type="checkbox"/> Re-inspection <input type="checkbox"/> Others (Specify)	SGD 925.00
Total	SGD 925.00

Dollars: Nine Hundred and Twenty-Five Only

(Cheque should be crossed and make payable to " Kelvin Automotive Appraising Services ")



Kelvin Automotive Appraising Services



6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Claim Reference : -
Insured Vehicle No. : -
Thirty Party Veh No. : -
Officer-In-Charge : -

Our Reference : KAAS/TA/6035/8480/TP/07.20
Date : 08 August 2020

To: Asia Express Car Rental Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE APPRAISAL REPORT

Name of Workshop : Apex Motoring
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800
Date of Assignment : 30 July 2020
Date of Accident : 27 July 2020
Date of Inspection : 30 July 2020

PARTICULARS OF INSPECTED VEHICLE

Registration No.	: SMH 8480Z	Chassis Frame No.	: GB7-1086395
Make / Model	: Honda Freed Hybrid 1.5G (A)	Engine No. (Logcard)	: LEB5624179
Year of Manufacture/Reg	: 2019	Odometer Reading	: 138,026 KM
Colour	: Silver		
Class / Type	: MPV		

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition : Excellent
Paintwork : Excellent
Market Value : -
Scrap Value : -

CONDITION OF TYRES ON VEHICLE

	<u>Make/Size</u>	<u>Thread Balance</u>
Front L	DUNLOP 185 / 65 R15	8 mm
Front R	DUNLOP 185 / 65 R15	8 mm
Rear L	DUNLOP 185 / 65 R15	8 mm
Rear R	DUNLOP 185 / 65 R15	8 mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount	
		LIST ITEMS:-				
1	1 pc	rear bumper	broken	\$ 1,064.20	\$ 828 ✓ 1,064.20	
2	1 pc	rear bumper l/h side retainer	necessary	\$ 47.00	\$ 47.00	✓
3	1 pc	rear bumper r/h side retainer	necessary	\$ 47.00	\$ 47.00	✓
4	1 pc	rear bumper l/h side support	necessary	\$ 79.00	\$ 79.00	✓
5	1 pc	rear bumper r/h side support	necessary	\$ 79.00	\$ 79.00	✓
6	1 pc	rear bumper r/h exhaust support	broken	\$ 69.00	\$ NN 69.00	×
7	1 pc	rear bumper tow hook cover	deformed	\$ 46.00	\$ 46.00	✓
8	1 set	rear bumper clips	necessary	\$ 35.00	\$ 30 ✓ 35.00	
9	1 pc	rear end panel	buckled	\$ 717.25	\$ 503 ✓ 717.25	
10	1 pc	rear end panel top garnish	deformed	\$ 178.95	\$ 178.95	✓
11	1 pc	tailgate	buckled	\$ 1,265.50	\$ 1,265.50	✓
12	1 pc	tailgate inner lock	jammed	\$ 181.00	\$ 181.00	✓
13	1 pc	tailgate logo emblem	necessary	\$ 77.00	\$ 77.00	✓
14	1 pc	tailgate "freed" emblem	necessary	\$ 64.20	\$ 64.20	✓
15	1 pc	tailgate "hybrid" emblem	necessary	\$ 62.10	\$ 62.10	✓
16	1 pc	tailgate chrome garnish	unconfirmed	\$ 368.70	\$ NN not affected	×
17	1 set	tailgate chrome garnish clips	necessary	\$ 16.00	\$ NN 16.00	×
18	1 pc	tailgate inner trim board	deformed	\$ 331.90	\$ 331.90	✓
19	1 set	tailgate inner trim board clips	necessary	\$ 35.00	\$ ✓ 35.00	
20	1 pc	tailgate inner handle	broken	\$ 33.95	\$ 33.95	✓
21	1 pc	tailgate weatherstrip	deformed	\$ 194.00	\$ 194.00	✓
22	1 pc	tailgate r/h lamp	scratched	\$ 380.20	\$ NN 380.20	×
23	1 pc	tailgate l/h hydraulic stay	bent	\$ 163.30	\$ NN 163.30	×
24	1 pc	tailgate r/h hydraulic stay	bent	\$ 163.30	\$ NN 163.30	×
25	1 pc	rear windscreen moulding	necessary	\$ 91.10	\$ 91.10	✓
26	1 pc	r/h taillamp	scratched	\$ 667.70	\$ NN 667.70	×
27	1 pc	r/h rear fender	buckled	repair	repair	×
28	1 pc	front bumper	broken	\$ 1,207.70	\$ 1050 ✓ 1,207.70	
29	1 pc	front bumper lower grille	deformed	\$ 207.50	\$ 207.50	✓
30	1 pc	front bumper reinforcement	buckled	\$ 339.70	\$ 339.70	✓
31	1 pc	front bumper tow hook cover	deformed	\$ 46.00	\$ 46.00	✓
32	1 pc	front bumper l/h side retainer	necessary	\$ 47.00	\$ 47.00	✓
33	1 pc	front bumper r/h side retainer	necessary	\$ 47.00	\$ 47.00	✓
34	1 set	front bumper clips	necessary	\$ 35.00	\$ 30 ✓ 35.00	
35	1 pc	front grille assy (complete)	broken	\$ 740.00	\$ 740.00	✓
36	1 pc	bonnet	buckled	\$ 720.00	\$ R 720.00	×
37	1 pc	bonnet inner lock	shifted	\$ 118.90	\$ realign NN	×
38	1 pc	front support panel	buckled	\$ 752.60	\$ repair NN	×
39	1 pc	a/c condenser	buckled	\$ 985.00	\$ NN 985.00	×
40	1 pc	r/h headlamp	broken	\$ 1,667.95	\$ 1,667.95	✓
				\$ 13,371.70	\$ 12,131.50	
		Less 20%			\$ 2,426.30	
				\$ 13,371.70	\$ 9,705.20	
Sub - Total				\$ 13,371.70	\$ 9,705.20	

6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount	
		B/F		\$ 13,371.70	\$ 9,705.20	
		LIST ITEMS:-				
41	1 pc	l/h front fender	damaged	\$ 506.20	NN repair	×
42	1 pc	l/h front fender " hybrid " emblem	necessary	\$ 86.70	\$ NN 86.70	×
43	1 pc	r/h front fender	buckled	\$ 506.20	\$ R 506.20	×
44	1 pc	r/h front fender " hybrid " emblem	necessary	\$ 86.70	\$ 86.70	✓
		Less 20%		\$ 1,185.80	\$ 679.60	
					\$ 135.92	
				\$ 1,185.80	\$ 543.68	
		SPECIAL NETT ITEMS:-				
45	1 set	reverse sensor	broken	\$ 300.00	\$ 200 250.00	✓
46	1 roll	rear windscreen sealant	necessary	\$ 60.00	\$ 40.00	×
47	1 pc	front no. plate	buckled	\$ 60.00	\$ NN 50.00	×
48	1 pc	front no. plate frame	deformed	\$ 35.00	\$ NN 35.00	×
				\$ 455.00	\$ 375.00	
Sub - Total				\$ 15,012.50	\$ 10,623.88	

APPRAISEMENT SCHEDULE


S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 15,012.50	\$ 10,623.88
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 2,000.00	\$ 1200 1,800.00
2		To check front wiring and rewire		\$ 60.00	\$ 30 50.00
3		To realign headlamp focus		\$ 35.00	\$ 20.00 ✓
4		To remove and reinstall radiator and a/c condenser		\$ 160.00	\$ 120.00 ✗
5		To vacuum and refill a/c refrigerant		\$ 120.00	\$ 100.00 ✗
6		To check rear wiring and rewire		\$ 60.00	\$ 50.00 ✗
7		To remove and reinstall tailgate components		\$ 80.00	\$ 60.00 ✓
8		To remove and reinstall rear windscreen		\$ 150.00	\$ 120.00 ✓
9		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 50 100.00
10		To remove and reinstall reverse sensor		\$ 140.00	\$ 30 100.00
11		To remove and reinstall reverse camera		\$ 150.00	\$ 50 120.00
12		To remove and reinstall rear exhaust muffler		\$ 120.00	\$ 100.00 ✗
13		To apply anti-rust		\$ 160.00	\$ 30 140.00
14		To putty and spray-paint of affected areas		\$ 1,800.00	\$ 1400 1,600.00
				\$ 5,155.00	\$ 4,480.00
					9 days
Sub - Total				\$ 20,167.50	\$ 15,103.88

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered

Squarely to the Rear

portion of the vehicle.

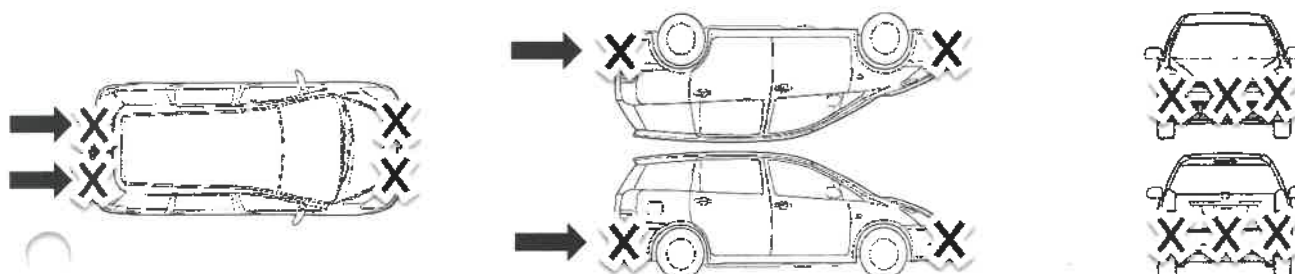

The general area of damages is at the **Front and Rear portion**
(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Apex Motoring** is \$ 20,167.50 .
We have adjusted the cost to \$ 15,103.88 and the repairer has agreed to undertake the repairs at a
Contract Lump Sum of \$ 12,050.00 to a acceptable quality and standards.
However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **12** working days.

130 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6035** for our services rendered and
we thank you for engaging our services.

Conducted By :

Approved By :

TERRENCE HONG
Dip Engineering / DECC (SP)
Certs Automotive Technology (NP)
Cert. Crash Investigation & Reconstruction
Cert SCI (General Insurance)
AMSAAA, AM SAE-A

KELVIN TEO
Licensed Automotive Appraiser
Nitec in Automotive Technology
Cert. Crash Investigation & Reconstruction
Dip MS
MSAAA, AM SAE-A

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.





