



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI22005945/Kpa3q2 Date: 23/08/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SNC 1466B	Veh. Inspected	SHD 5377P	
Policy No.	DMPCSNW00229892100	Coverage (\$)	0.00	
Claim No.	SNM22D204330/C02/SNC1466 B/LEEPG	Excess (\$)	0.00	
Assign From		Assign Date	22/06/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS (A)	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	JTDKB3FU503078562	Colour	M.P.WHITE/RED	
Odometer	261827 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	9 mm	
L/H Front Tyre	195/65 R15	SAILUN	9 mm	
R/H Rear Tyre	195/65 R15	SAILUN	6 mm	
L/H Rear Tyre	195/65 R15	SAILUN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/06/2022	Inspection Date	21/06/2022	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 5377P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	COVER , REAR BUMPER	BUCKLED	442.60	442.60
1	REINFORCEMENT SUB-ASSY ,REAR BUMPER	BENT	332.70	332.70
1	COVER ,REAR BUMPER ,LOWER	MISSING	15.40	15.40
1	GUARD ,REAR BUMPER ,CENTER	DENTED	576.30	576.30
1	RETAINER REAR BUMPER SIDE ,LH	SERVICEABLE	116.50	-
1	RETAINER REAR BUMPER SIDE ,RH	SERVICEABLE	117.70	-
1	PANEL SUB-ASSY ,BACK DOOR	TO REPAIR SEE LABOUR	1,147.80	-
1	GARNISH SUB-ASSY ,BACK DOOR ,OUTSIDE	TO REPAIR SEE LABOUR	925.60	-
1	COVER FLOOR UNDER NO.2 RH	SERVICEABLE	241.90	-
1	COVER ,REAR FLOOR CTR	SERVICEABLE	229.90	-
1	COVER ,DECK TRIM ,REAR	SERVICEABLE	126.70	-
1	PANEL SUB-ASSY ,BODY LOWER BACK	TO REPAIR SEE LABOUR	650.30	-
1	SEAL ,REAR BUMPER SIDE ,RH	SERVICEABLE	88.50	-
1	STAY ASSY ,BACK DOOR ,LH	SERVICEABLE	242.50	-
1	STAY ASSY ,BACK DOOR ,RH	SERVICEABLE	242.50	-
1	HINGE ASSY ,BACK DOOR ,LH	TO REPAIR SEE LABOUR	61.00	-
1	HINGE ASSY ,BACK DOOR ,RH	TO REPAIR SEE LABOUR	61.00	-
1	REAR TAILGATE TOYOTA LOGO	NECESSARY	47.90	47.90
1	REAR TAILGATE WORDING 'PRIUS'	NECESSARY	54.60	54.60
1	REAR TAILGATE WORDING 'HYBRID'	NECESSARY	54.60	54.60
	LESS 25% DISCOUNT		-1,444.00	-381.03
			4,332.00	1,143.07
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	DENTED	700.00	220.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	95.00	60.00
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
1	WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
1	REAR TAILGATE STICKER 'TRANS-CAB' (SN)	NECESSARY	80.00	30.00
1	REAR TAILGATE STICKER '6555-3333' (SN)	NECESSARY	80.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER PROTECTOR (SN)	NO SUCH PARTS	180.00	-
1	SET REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	85.00	-
			1,700.00	340.00
	LABOUR			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	300.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY ,BACK DOOR,GARNISH SUB-ASSY ,BACK DOOR ,OUTSIDE ,PANEL SUB-ASSY ,BODY LOWER BACK ,HINGE ASSY ,BACK DOOR ,LH AND HINGE ASSY ,BACK DOOR ,RH.		2,200.00	200.00
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TAILGATE FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	180.00	-
	TO REMOVE AND REFIT ELECTRICAL WIRING ,BATTERY AND OTHER NECESSARY ITEMS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	480.00	-
	TO TRANSFER OF FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	480.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH ,TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS .	NOT NECESSARY	250.00	-
	TOWING FEES.	NOT NECESSARY	150.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		2,200.00	440.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	15.00
	TO TRANSFER OF LUGGAGE FLOOR PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	220.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CONDUCT AND PERFORM A COMPREHENSIVE VEHICLE DIAGNOSTIC CHECK AND RESET VEHICLE WARNING INDICATORS.	NOT NECESSARY	380.00	-
			8,920.00	705.00
GRAND TOTAL			14,952.00	2,188.07
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,750.00

Report Ref No. CC3/CTI22005945/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5377P

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

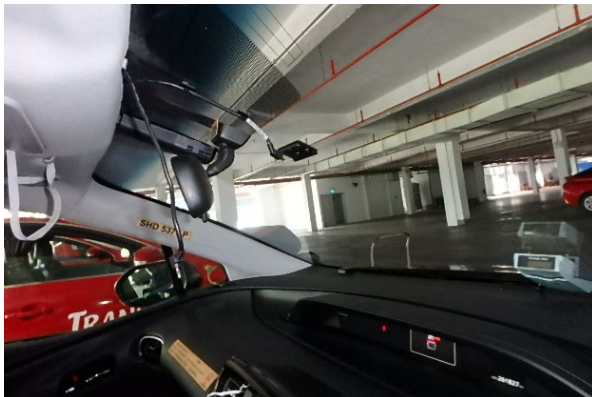

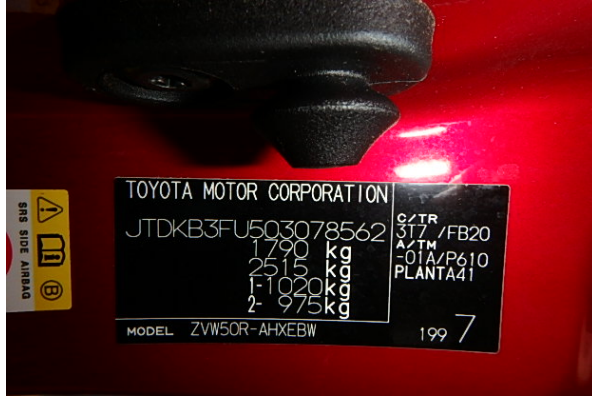



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5377P

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 5377P

RE-INSPECTION

