



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2207361

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 29/11/2022
Reference CC4/LPC22006217/Rpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 4527H
Insured Veh. GBE 3889H
Claim No. 21/22/22/VC05/025976
Policy No. Z21VC05008636
Accident Date 25/06/2022
Inspection Date 29/06/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22006217/Rpa3q2 Date: 29/11/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM (FOR MANDATE ONLY)				
Insured Veh.	GBE 3889H	Veh. Inspected	SMP 4527H	
Policy No.	Z21VC05008636	Coverage (\$)	0.00	
Claim No.	21/22/22/VC05/025976	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	29/06/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA NOAH HYBRID 1.8X	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	ZWR800382075	Colour	WHITE	
Odometer	237412 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FIRENZA	6 mm	
L/H Front Tyre	195/65 R15	FIRENZA	6 mm	
R/H Rear Tyre	195/65 R15	FIRENZA	6 mm	
L/H Rear Tyre	195/65 R15	FIRENZA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/06/2022	Inspection Date	29/06/2022	
Survey held at	MY CAR CONSULTANT PTE LTD 60 JALAN LAM HUAT #05-21 CARROS CENTRE SINGAPORE 737869			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 4527H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DEFORMED	1,985.00	1,288.20
1	FRONT BUMPER LOWER GARNISH	CRACKED	412.00	192.50
1	FRONT BUMPER SPONGE	NOT NECESSARY	298.00	-
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	240.00	-
2	FRONT BUMPER SIDE RETAINER @\$112.00	NOT NECESSARY	224.00	-
1	FRONT GRILLE	CRACKED	788.00	571.75
1	FRONT GRILLE LOGO	NECESSARY	159.00	89.50
1	HEADLAMP RH	CRACKED	4,125.00	3,665.10
1	HEADLAMP TOP SUPPORT PANEL RH	NOT NECESSARY	212.00	-
1	HEADLAMP GARNISH RH	NOT NECESSARY	112.00	-
1	FRONT HEADLAMP LOWER BRACKET RH	NOT NECESSARY	122.00	-
1	REAR BUMPER	DEFORMED	798.20	798.20
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	83.20	-
2	REAR BUMPER SIDE RETAINER @\$171.45	NOT NECESSARY	324.40	-
1	REAR BUMPER TOWING COVER	NOT NECESSARY	45.00	-
1	REAR BUMPER SENSOR WIRE HARNESS	NOT NECESSARY	387.00	-
1	TAILGATE	BUCKLED	2,110.25	1,561.90
1	TAILGATE INNER TRIM	DEFORMED	589.00	570.30
1	TAILGATE 'HYBRID SYNERGY DRIVE LOGO'	NECESSARY	141.10	88.00
1	TAILGATE OUTER CHROME MOULDING C/W SENSOR	NOT NECESSARY	741.00	-
1	TAILGATE WEATHERSTRIPE	NECESSARY	391.05	277.00
1	TAILGATE LOCK	SCRATCHED	512.00	455.10
1	TAILGATE LOCK CATCH	NOT NECESSARY	42.30	-
2	TAILGATE INNER SIDE GARNISH @\$159.00	NOT NECESSARY	318.00	-
1	SET TAILGATE WINDSCREEN MOULDING	NECESSARY	387.00	350.90
1	TAILGATE DETECTOR	NOT NECESSARY	287.00	-
1	TAILGATE BUZZER	NOT NECESSARY	198.00	-
2	TAILAMP@\$1015.00	NOT NECESSARY	2,030.00	-
2	TAILAMP LOWER PANEL (OUTER) @\$458.00	NOT NECESSARY	916.00	-
2	TAILAMP LOWER PANEL (INNER) @\$312.00	NOT NECESSARY	624.00	-
2	TAILAMP LOWER GARNISH @\$398.00	NOT NECESSARY	796.00	-

Report Ref No. CC4/LPC22006217/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR FENDER INNER TRIM @\$1124.00	DEFORMED	2,248.00	1,540.00
2	REAR FENDER INNER TRIM TOP @\$298.00	NOT NECESSARY	596.00	-
2	REAR FENDER COWLING @\$214.00	NOT NECESSARY	428.00	-
1	REAR FENDER AIR VENT RH	NOT NECESSARY	68.00	-
1	REAR END PANEL (OUTER)	BENT	689.20	689.20
1	REAR END PANEL (INNER)	BENT	685.00	562.40
1	REAR END PANEL TOP GARNISH	DEFORMED	391.45	204.50
1	REAR FLOOR PANEL	NOT NECESSARY	2,489.00	-
1	SET REAR FLOOR PANEL TOP BOARD	CRACKED	1,241.00	710.70
1	REAR FLOOR PANEL TOP TOOLS GARNISH	NOT NECESSARY	412.00	-
1	REAR EXHAUST PIPE	NOT NECESSARY	1,359.00	-
1	REAR EXHAUST PIPE HEAT SHIELD	NOT NECESSARY	321.00	-
2	REAR EXHAUST MOUNTING @\$32.20	NOT NECESSARY	64.40	-
1	REAR SPARE TYRE BOLT	NOT NECESSARY	32.00	-
1	REAR BATTERY TRAY	NOT NECESSARY	214.00	-
1	REAR BATTERY	NOT NECESSARY	450.00	-
1	REAR SEAT ASSY RH	NOT NECESSARY	4,857.00	-
	LESS 25% DISCOUNT		-9,235.64	-3,403.81
			27,706.91	10,211.44
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	FRONT NUMBER PLATE WITH CASING (SN)	CUT	100.00	35.00
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	SET TAILAMP CLIP (SN)	NOT NECESSARY	30.00	-
1	REAR BUMPER REVERSE SENSOR (SN)	NOT WORKING	220.00	200.00
1	REVERSE CAMERA (SN)	NOT NECESSARY	350.00	-
1	REAR BUMPER CLIP (SN)	NECESSARY	50.00	30.00
1	TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	TAILGATE WINDSCREEN INNER SEAL (SN)	NECESSARY	80.00	40.00
1	REAR WINDSCREEN TINTED (SN)	NOT NECESSARY	200.00	-
1	SET TAILGATE OUTER MOULDING CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	30.00

Report Ref No. CC4/LPC22006217/Rpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	SET REAR FENDER INNER TRIM BOARD CLIP @\$50.00 (SN)	NECESSARY	100.00	40.00
2	SET REAR FENDER INNER COWLING CLIPS @\$50.00 (SN)	NOT NECESSARY	100.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	120.00	40.00
1	REAR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	30.00	30.00
1	REAR FLOOR PANEL SEALANT (SN)	NOT NECESSARY	150.00	-
1	REAR FENDER GLASS SEALANT (SN)	NOT NECESSARY	80.00	-
1	REAR BATTERY (SN)	NOT NECESSARY	200.00	-
1	SET TOOLS (SN)	NOT NECESSARY	200.00	-
1	REAR TOP MAT (SN)	NOT NECESSARY	300.00	-
			2,600.00	515.00
	<u>LABOUR</u>			
	REMOVE & REFIX REAR WINDSCREEN GLASS .		300.00	120.00
	CHECK AND RESET FAULT CODE LIGHT ON HYBRID BATTER .	NOT NECESSARY	500.00	-
	REMOVE AND REFIT REAR WINDSCREEN GLASS .	NOT NECESSARY	150.00	-
	REMOVE AND REFIX REAR SEAT ,UPHOLSTERY .	NOT NECESSARY	300.00	-
	REMOVE AND REFIT REAR AIRCON BLOWER .	NOT NECESSARY	150.00	-
	REMOVE AND REFIT REAR REVERSE SENSOR .		120.00	40.00
	REMOVE AND REFIT REAR FENDER GLASS .	NOT NECESSARY	160.00	-
	REMOVE AND REFIT REAR EXHAUST SYSTEM.	NOT NECESSARY	150.00	-
	REMOVE AND REFIT TAILGATE MECHANISM .		150.00	60.00
	TO CHECK ELECTRICAL WIRING.	NOT NECESSARY	200.00	-
	TO COATING EFFECTED BODY AREAS .		300.00	60.00
	REAR CHASSIS REALIGNMENT .	NOT NECESSARY	200.00	-
	PANEL BEATING ON AFFECTED AREA.		2,800.00	900.00
	SPRAY ON AFFECTED AREA.		2,800.00	900.00
	TOWING SEVICE.	NOT NECESSARY	100.00	-
			8,380.00	2,080.00
GRAND TOTAL			38,686.91	12,806.44

Report Ref No. CC4/LPC22006217/Rpa3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			10,250.00
---	--	--	------------------

Report Ref No. CC4/LPC22006217/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4527H

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

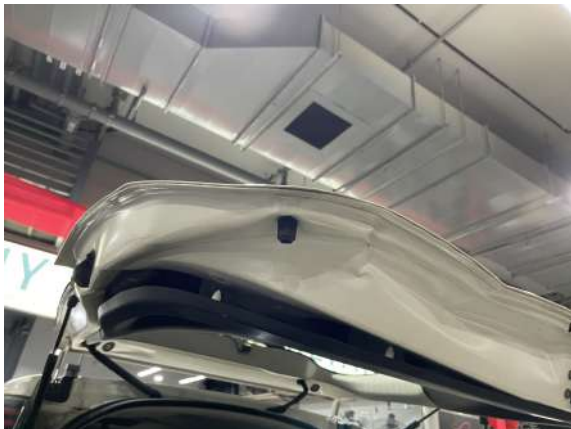



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

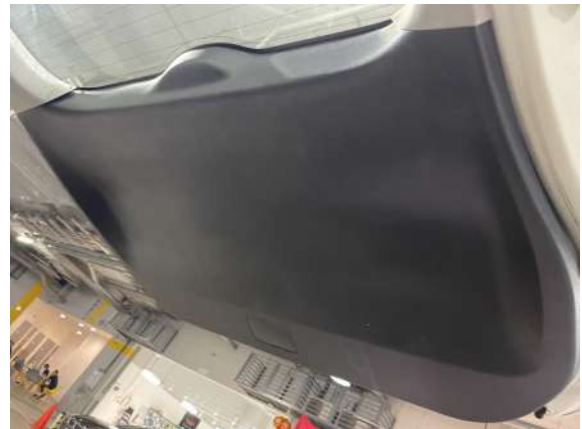



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

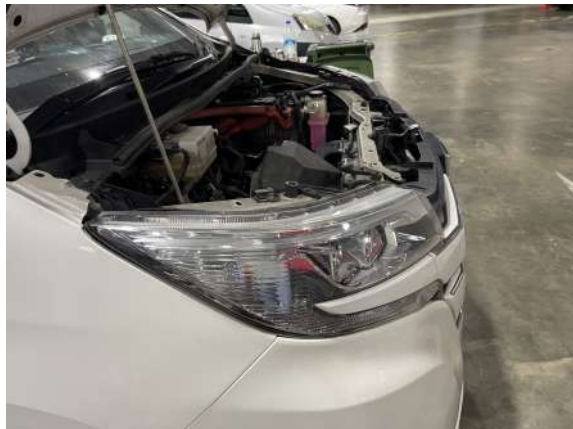



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4527H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4527H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

