

**SINCERE**  
APPRAISAL SERVICES PTE LTD

## VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 48/TP/2022

Date: 1/3/2022

### REFERENCE

Date of loss: 19/2/2022

Claimant: Xie Ying

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJM3663E	Make &	Nissan
Reg date:	21/2/2017	Model	Qashqai
Colour:	White	Engine No:	HRA2352545A
Type:	Motor Car	Chassis No:	SJNFEAJ11U1819828
Type of Claims:	Third Party	Odometer No:	NA
		Engine Cap:	1197cc

### CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition: Good	Steering: Good	Engine Modification: Nil
Paint work: Good	Handbrake: Good	Pre-accident
	Footbrake: Good	Damage: Nil

### CONDITION OF TYRES

Front Left Size:	Arivo 215/65R16 70%	Front Right Size:	Arivo 215/65R16 70%
Rear Left Size:	Arivo 215/65R16 70%	Rear Right Size:	Arivo 215/65R16 70%

*The above percentages represent the remaining life of the tyre threads*

### COST OF REPAIRS

	Repairer S\$	Adjuster S\$
Parts	\$ 5,184.20	\$ 4,386.40
Labour	\$ 1,790.00	\$ 1,350.00
Calculated Cost (S\$) :	<u>\$ 6,974.20</u>	<u>\$ 5,736.40</u>

**Recommended Lump Sum Repair Cost (S\$) : \$ 4,600.00**

Date of Assignment: 23/2/2022

Date Inspected: 23/2/2022

Est. repair Period: 06 days

Inspected At: One Zone Automotive

5 Yishun Industrial Street 1

#01-20 North Spring Bizhub


Singapore 768161

**SINCERE APPRAISAL SERVICES PTE LTD** Co.Reg no: 201800639R

420 North Bridge Road, #02-05 North Bridge Centre, Singapore 188727

Tel : 6636 4628 E-mail : office@sincereappraisal.com.sg

### POINT OF IMPACT

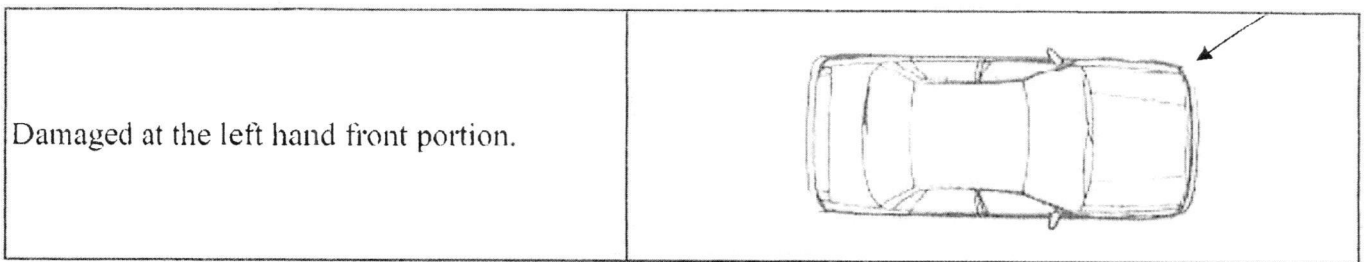

### BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle along South Bridge Road.

### GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the left hand front portion.

### SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$6,974.20. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$4,600.00.

We have not authorised the repair. Under normal circumstances, estimated **06** working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



**Dave Chang**  
Automotive Appraiser  
AUTO. ENG, CAE, CGI  
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

*Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.*

## ANNEX A

## REPAIR DETAILS

## Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount	
1	1	Front bumper assy	grazed/dented	\$ 1,693.00	\$ 1,693.00	751
2	1	Front bumper reinforcement	repair	\$ 380.00	\$ -	
3	1	Front bumper left retainer	necessary	\$ 88.00	\$ 88.00	25
4	1	Front bumper left bracket	necessary	\$ 83.00	\$ 83.00	X SVC
5	1	Front bumper inner sponge	cracked	\$ 275.00	\$ 275.00	219
6	1	Front grille assy	grazed/bent	\$ 395.00	\$ 395.00	X NN
7	1	Front grille emblem	necessary	\$ 88.00	\$ 88.00	X NN
8	1	Front left headlamp	cracked	\$ 1,830.00	\$ 1,830.00	1225
9	1	Front left headlamp support panel	repair	\$ 273.00	\$ -	
10	1	Front left fog lamp	reuse	\$ 189.00	\$ -	
11	1	Front left fog lamp chrome cover	warped/grazed	\$ 105.00	\$ 105.00	89
12	1	Front left fog lamp garnish	bent/necessary	\$ 139.00	\$ 139.00	X NN
				\$ 5,538.00	\$ 4,696.00	
Less 10%				\$ 553.80	\$ 469.60	
				\$ 4,984.20	\$ 4,226.40	
<u>Special Nett Items</u>						
1	10	Front bumper clips	necessary	\$ 60.00	\$ 50.00	30
2	1	Front no plate with garnish	necessary	\$ 100.00	\$ 80.00	40
3	6	Front grille clips	necessary	\$ 40.00	\$ 30.00	X NN
				\$ 200.00	\$ 160.00	
Total parts				\$ 5,184.20	\$ 4,386.40	

## ANNEX B

**REPAIR DETAILS**

## Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount
1	Labour for panel beating, cut, weld, straighten front left affected area and replace front left damaged parts.	\$ 800.00	\$ 600.00 400
2	To putty and spray painting front left portion.	\$ 800.00	\$ 600.00 400
3	To check wiring and focus front headlamp.	\$ 50.00	\$ 30.00
4	To apply anti rust proofing to front left affected area.	\$ 140.00	\$ 120.00 X
Total labour :		\$ 1,790.00	\$ 1,350.00

4 days

## ANNEX C

**REPAIR DETAILS**

## Adjusted Repair Cost

	Repairer's Amount	Adjuster's Amount
Total parts :	\$ 5,184.20	\$ 4,386.40
Total labour :	\$ 1,790.00	\$ 1,350.00
Total repair cost :	\$ 6,974.20	\$ 5,736.40

Adjusted Repair Cost (Lump Sum Repair)

\$ 4,600.00