



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10107/1984/TP/05.22

Date : 25 May 2022

Vehicle no : SMZ 1984M

To: Skyway Motor Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

INVOICE

PARTICULARS

AMOUNT

Registration No. : SMZ 1984M
Date of accident : 30 April 2022
Make / Model : Toyota C-HR Hybrid 1.8S CVT
Invoice No. : 10107

Being work done and services rendered as follows:

- ✓ Inspection of Vehicle
- ✓ Re-Inspection
- ✓ Appraisal Report
- ✓ 38 Colored Photographs
- ✓ Transport Charges

SGD 478.00

TOTAL SGD 478.00

Dollars: Four Hundred and Seventy-Eight Only

(Cheque should be crossed and make payable to " TY5 CONSULTANCY ")

TY5 CONSULTANCY



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10107/1984/TP/05.22

Date : 25 May 2022

Vehicle no : SMZ 1984M

To: Skyway Motor Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE INSPECTION REPORT

Name of Workshop : Apex Motoring
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800
Date of Accident : 30 April 2022
Date of Inspection : 12 May 2022

VEHICLE PARTICULAR

Registration No.	: SMZ 1984M	Chassis Frame No.	: ZYX10-2177713
Make / Model	: Toyota C-HR Hybrid 1.8S CVT	Engine No.	: 2ZR2D67969
Year of Registration	: 2021	Odometer Reading	: 102,815 KM
Class / Type	: SUV	Colour	: Green

VEHICLE CONDITION

General Condition	: Excellent	Steering	: Serviceable
Paintwork	: Excellent	Foot/ Parking Brake	: Serviceable

TYRE CONDITION

	<u>Size</u>	<u>Thread Balance</u>
Front L/H :	DAVANTI 215 / 60 R17	7mm
Front R/H :	DAVANTI 215 / 60 R17	7mm
Rear L/H :	DAVANTI 215 / 60 R17	7mm
Rear R/H :	DAVANTI 215 / 60 R17	7mm

* The above is an estimate of the remaining life of the tyre thread in percentages

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 3,231.55	\$ 2,016.34
Labour	\$ 2,120.00	\$ 1,630.00
	<u>\$ 5,351.55</u>	<u>\$ 3,646.34</u>

TY5 Recommendation

Lump Sum Repair :
\$ 2,900.00

Estimated Repair Duration :

4

working days (excluding Sat, Sun & Public Holidays)

NOTE : The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10107/1984/TP/05.22
Date : 25 May 2022
Vehicle no : SMZ 1984M

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
<u>LIST ITEMS:-</u>					
1	1 pc	rear upper bumper	deformed	\$ 808.45	\$ 808.45
2	1 pc	rear lower bumper	broken	\$ 406.10	\$ 406.10
3	1 pc	rear bumper reinforcement	buckled	\$ 509.10	\$ 509.10
4	1 pc	rear bumper tow hook cover	missing	\$ 69.00	\$ 69.00
5	1 pc	rear bumper l/h side retainer	necessary	\$ 65.30	\$ 65.30
6	1 pc	rear bumper r/h side retainer	necessary	\$ 65.30	\$ 65.30
7	1 set	rear bumper clips	necessary	\$ 35.00	\$ 35.00
8	2 pcs	reverse sensor @\$365.10	not working	\$ 730.20	\$ 730.20
9	1 pc	rear end (outer) panel	dented	\$ 543.10	repair
				\$ 3,231.55	\$ 2,688.45
Less 25%					\$ 672.11
				\$ 3,231.55	\$ 2,016.34

Total	\$ 3,231.55	\$ 2,016.34
-------	-------------	-------------



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10107/1984/TP/05.22
Date : 25 May 2022
Vehicle no : SMZ 1984M

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
		B/F		\$ 3,231.55	\$ 2,016.34
10		To panel beat and renewal of all necessary damaged body parts		\$ 1,000.00	\$ 800.00
11		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 100.00
12		To remove and reinstall reverse sensor		\$ 140.00	\$ 100.00
13		To apply anti-rust		\$ 60.00	\$ 30.00
14		To putty and spray-paint of affected areas		\$ 800.00	\$ 600.00
				\$ 2,120.00	\$ 1,630.00

Total	\$ 5,351.55	\$ 3,646.34
-------	-------------	-------------



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*


Reference : TY5/TA/10107/1984/TP/05.22

Date : 25 May 2022

Vehicle no : SMZ 1984M

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Squarely to the Rear portion of the vehicle.

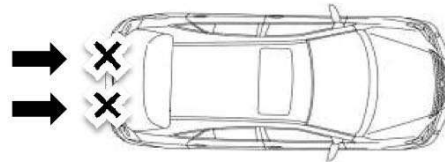

(Please refer to the list and survey photographs as attached for more information)

ASSESSMENT RECOMMENDATIONS

COST OF REPAIR

	Repairster S\$	Adjuster S\$
Parts	\$ 3,231.55	\$ 2,016.34
Labour	\$ 2,120.00	\$ 1,630.00
	<u>\$ 5,351.55</u>	<u>\$ 3,646.34</u>

TY5 Recommendation

Contract Lump Sum of \$ 2,900.00

Estimated Repair Duration : 4 working days
(excluding Sat, Sun & Public Holidays)

Enclosed No. Of Photograph : 38
(at the time of static inspection)

Our attached assessment schedule has been checked throughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a **Without Prejudice Basis** and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10107

TY5 CONSULTANCY

TERRENCE HONG

AUTOMOTIVE SURVEYOR

NOTE : *This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.*





