



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2300644

INV Date 02/02/2023

Reference CC4/LPC22006529/Epa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SCY 8866Z
Insured Veh. YP 6899D
Claim No. 21/22/22/VC00/026007
Policy No. Z/21/VC00/111333
Accident Date 07/07/2022
Inspection Date 08/07/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22006529/Epa3q2 Date: 02/02/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YP 6899D	Veh. Inspected	SCY 8866Z
	Policy No.	Z/21/VC00/111333	Coverage (\$)	0.00
	Claim No.	21/22/22/VC00/026007	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	08/07/2022
2. Vehicle Particulars & Condition				
	Make & Model	HONDA HRV	c.c	1497
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	MRHRU1830FP000083	Colour	SILVER
	Odometer	89414 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	MICHELIN	4 mm
	L/H Front Tyre	215/60 R16	MICHELIN	4 mm
	R/H Rear Tyre	215/60 R16	MICHELIN	4 mm
	L/H Rear Tyre	215/60 R16	MICHELIN	4 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	07/07/2022	Inspection Date	08/07/2022
	Survey held at	KAH MOTOR CO SDN BERHAD NO. 255 ALEXANDRA ROAD SINGAPORE 159937		
5a. Remarks				
	A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		12 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SCY 8866Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SUNDRIES (SN)	NECESSARY	110.00	50.00
1	NUMBER PLATE WITH CASING -L (SN)	NOT NECESSARY	45.00	-
1	SENSOR UNITPARKING (SN)	NOT NECESSARY	218.47	-
1	BRACKET PARKING SENSOR UNIT (SN)	NOT NECESSARY	3.52	-
1	SENSOR ASSY PARKING T99 (SN)	NOT NECESSARY	53.17	-
1	SENSOR ASSYPARKING (SN)	NOT NECESSARY	70.27	-
1	SENSOR ASSY PARKING T99 (SN)	NOT NECESSARY	53.17	-
1	SENSOR ASSY PARKING T99 (SN)	NOT NECESSARY	53.17	-
2	RETAINERPARKING SENSOR (SN)	NOT NECESSARY	106.35	-
2	RETAINERPARKING SENSOR (SN)	NOT NECESSARY	37.80	-
1	BUZZER ASSYSMART (SN)	NOT NECESSARY	48.07	-
1	LAMP UNITR (SN)	BROKEN	377.92	327.53
1	LAMP UNITL (SN)	CUT	377.92	327.53
1	LIGHT ASSY ,R.LID (SN)	BROKEN	215.85	187.07
1	LIGHT ASSYL.LID (SN)	BROKEN	215.85	187.07
1	MOTOR ASSYRR.WINDSHIELD WIPER (SN)	NOT NECESSARY	90.97	-
1	ARM ,RR WIPER (SN)	CUT	34.05	29.51
1	BLADEWINDSHIELD WIPER (SN)	CUT	29.77	25.80
1	CAMERA ASSYRR,VIEW (SN)	NOT NECESSARY	832.72	-
1	TAILGATE COMP (SN)	DENTED	682.87	591.82
2	HINGE COMP ,TAILGATE (SN)	NOT NECESSARY	49.20	-
1	WEATHERSTRIPTAILGATE (SN)	CRUSHED	78.90	68.38
1	LOCK ASSYTAILGATE (SN)	NOT NECESSARY	67.57	-
1	SWITCH ASSYTAILGATE OPENER (SN)	NOT NECESSARY	84.22	-
1	STAY ASSYR,TAILGATE OPEN (SN)	NOT NECESSARY	86.62	-
1	STAY ASSYL,TAILGATE OPEN (SN)	NOT NECESSARY	86.62	-
1	DAMPERTAILGATE DYNAMIC (SN)	NOT NECESSARY	52.05	-
1	GARNISH ASSYTAILGATE SPOILER (SN)	NOT NECESSARY	103.80	-
1	LINING ASSYTAILGATE LOWER (SN)	NOT NECESSARY	76.50	-
1	LINING ASSYTAILGATE UPPER (SN)	NOT NECESSARY	20.17	-
1	POCKET TAILGATE PULL (SN)	NOT NECESSARY	12.15	-

Report Ref No. CC4/LPC22006529/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LINING ASSYL, TAILGATE SIDE (SN)	NOT NECESSARY	12.22	-
1	EMBLEMRR (SN)	NECESSARY	11.40	9.88
1	EMBLEM ,RR.I-VTEO (SN)	NECESSARY	12.45	10.79
1	GLASS SET ,RR.WINDSHIELD (SN)	BROKEN	554.85	480.87
1	RUBBER CR.WINDSHIELD DAMPER (SN)	NECESSARY	14.47	12.54
1	DAMPERSTD 5X5 (SN)	NECESSARY	6.82	5.91
1	RUBBER CL.WINDSHIELD DAMPER (SN)	NECESSARY	14.47	12.54
1	CAPPVOT (SN)	NECESSARY	3.90	3.38
4	FASTENER BW/SHIELD (SN)	NECESSARY	15.90	13.78
2	FASTENER B (SN)	NECESSARY	8.25	7.15
2	FASTENER AW/SHIELD (SN)	NECESSARY	5.70	4.94
2	WINDSCREEN SEALANT (SN)	NOT NECESSARY	120.00	-
2	LIGHT ASSYLICENSE (SN)	NOT NECESSARY	50.85	-
1	GARNISH ASSYRR LICENSE (SN)	BROKEN	142.35	123.37
1	REFLECTOR ASSYR.RR (SN)	NOT NECESSARY	133.87	-
1	REFLECTOR ASSYL.RR (SN)	NOT NECESSARY	133.87	-
1	FACERR.BUMPER (SN)	CRUSHED	347.77	301.40
1	FACER.RR.BUMPER CORNER (SN)	CRUSHED	71.47	61.94
1	FACEL.RR.BUMPER CORNER (SN)	CRUSHED	71.47	61.94
1	SPACER,R.RR.BUMPER SIDE (SN)	BROKEN	13.50	11.70
1	SPACER,L.RR.BUMPER SIDE (SN)	BROKEN	13.50	11.70
2	BOLTRR.BUMPER STOPPER (SN)	NOT NECESSARY	7.05	-
8	CLIP ,BUMPER (SN)	NECESSARY	13.80	11.96
1	GUTTER COMPR.RR (SN)	NOT NECESSARY	122.92	-
1	GUTTER COMPL.RR (SN)	NOT NECESSARY	122.92	-
1	PANEL COMPRR (SN)	DENTED	352.65	305.63
1	COVER COMPTONNEAU (SN)	NOT NECESSARY	105.22	-
1	BASE COMPR TRUNK SIDE LINING (SN)	NOT NECESSARY	112.27	-
1	LINING ASSYRR,PANEL (SN)	CRUSHED	49.95	43.29
1	BASE COMPL ,TRUNK SIDE LINING (SN)	NOT NECESSARY	112.27	-
1	PANEL SET RR .FLOOR (SN)	DENTED	433.27	375.50
1	STIFFENERRR,JACK UP (SN)	NECESSARY	33.37	28.92
1	CROSSMEMBER COMPRR.FLOOR (SN)	NOT NECESSARY	71.62	-

Report Ref No. CC4/LPC22006529/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	CROSSMEMBER COMP,RR.FLOOR RR (SN)	NECESSARY	96.22	83.39
3	OILSHEET (SN)	NECESSARY	97.65	28.21
1	BOARD ASSYTRUNK FLOOR (SN)	NOT NECESSARY	79.50	-
1	BOX COMPTRUNK FLOOR (SN)	NOT NECESSARY	101.02	-
1	PROTECTORR.RR.WHEEL ARCH (SN)	NOT NECESSARY	129.07	-
1	PROTECTORL.RR.WHEEL ARCH (SN)	BROKEN	129.07	111.86
1	FENDERR ,RR.INNER (SN)	NOT NECESSARY	64.95	-
1	FENDERL ,RR.INNER (SN)	NOT NECESSARY	64.95	-
6	CLIPINNER FENDER (SN)	NOT NECESSARY	1.80	-
8	CLIP,INNER FENDER (SN)	NOT NECESSARY	16.80	-
1	SOLAR FILM ON REAR WINDSCREEN (SN)	NECESSARY	300.00	200.00
1	SENSOR ASSYPARKING (SN) (ADDITIONAL)	BROKEN	60.90	60.90
2	RETAINER PARKING SENSOR (SN) (ADDITIONAL)	NECESSARY	92.17	92.17
1	BUZZER ASSYSMART (SN) (ADDITIONAL)	BROKEN	41.66	41.66
1	ANTENNA ASSYL,F.BR (SN) (ADDITIONAL)	BROKEN	47.40	47.40
			8,994.26	4,359.43
	LABOUR			
	REMOVE & RENEW REVERSE SENSOR.		250.00	200.00
	SEALANT FOR REAR END PANEL .		120.00	120.00
	SEALANT FOR REAR FLOOR PANEL .		120.00	120.00
	SEALANT FOR LHR FENDER .	NOT NECESSARY	120.00	-
	SEALANT FOR TAILGATE.		120.00	120.00
	INSPECT RR LIGHTING MECHANISMS PERFORM WATER.		250.00	200.00
	STRAIGHTEN ALIGN OR RENEW EXHAUST SYSTEM.	NOT NECESSARY	650.00	-
	REMOVE & INSTALL FUEL TANK FUEL PIPES.	NOT NECESSARY	650.00	-
	REMOE & INSTALL SPEAKER BOARD RR SEATS TRUNK .		650.00	621.89
	REMOVE & TRANSFER ITEMS TO NEW TAILGATE.ADJUST &.		650.00	650.00
	REMOVE & INSTALL REAR COMPARTMENT LININGS .		650.00	550.00
	REMOVE & INSTALL RR WINDSCREEN.		650.00	650.00
	WINDSCREEN DAM KIT.		120.00	120.00
	CUT OFF & RENEW RR PANEL.		6,000.00	3,850.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS .		3,500.00	2,120.00

Report Ref No. CC4/LPC22006529/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & RENEW RR FLOOR INSULATOR.		580.00	450.00
	REMOVE REFIX AND ALIGN REAR VIEW CAMERA.		650.00	450.00
	APPLY BODY UNDERSIDE COATING.		520.00	520.00
	TOWING SERVICES (MBBS).		130.00	130.00
	REMOVE AND VACUUM SHATTERED GLASSES.		650.00	325.00
	RESET VEHICLE SMART ENTRY SYSTEM.		650.00	450.00
			17,680.00	11,646.89
GRAND TOTAL			26,674.26	16,006.32
RECOMMENDED COST OF REPAIR SUM				16,000.00

Report Ref No. CC4/LPC22006529/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SCY 8866Z

INSPECTION



HONDA AUTOMOBILE(THAILAND)CO.,LTD.
CHASSIS NO. MRHRU1830FP000083
ENGINE NO. L15Z7-1000087
T8P F ZB7 NH-700M A



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

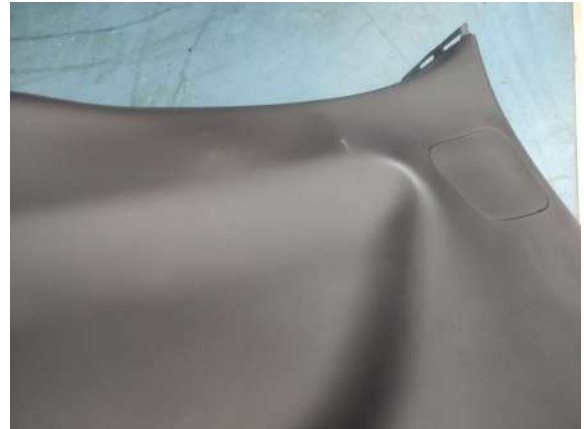



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SCY 8866Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

