



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2303833

INV Date 16/06/2023

Reference CC4/LPC22006572/Upa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. PC 9489J
Insured Veh. GBK 201E
Claim No. 21/22/22/VC05026018
Policy No. Z21VC05009084
Accident Date 09/07/2022
Inspection Date 12/07/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22006572/Upa3q2 Date: 16/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBK 201E	Veh. Inspected	PC 9489J
	Policy No.	Z21VC05009084	Coverage (\$)	0.00
	Claim No.	21/22/22/VC05026018	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	12/07/2022
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA HIACE COMMUTER GL (A)	c.c	2754
	Engine No.	HIDDEN	Year of Reg.	2021
	Chassis No.	GDH2232002963	Colour	WHITE
	Odometer	102826 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195 R15	BRIDGESTONE	6 mm
	L/H Front Tyre	195 R15	BRIDGESTONE	6 mm
	R/H Rear Tyre	195 R15	BRIDGESTONE	6 mm
	L/H Rear Tyre	195 R15	BRIDGESTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION & REAR WINDSCREEN SHATTERED. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	09/07/2022	Inspection Date	12/07/2022
	Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PC 9489J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN	SHATTERED	1,499.80	1,021.30
1	REAR WIPER ARM	NOT NECESSARY	245.50	-
1	REAR WIPER ARM MOTOR	NOT NECESSARY	655.10	-
1	REAR WIPER BLADE	NOT NECESSARY	108.00	-
1	TAILGATE	BADLY DENTED	2,159.10	2,159.10
1	TAILGATE OUTER HANDLE	BENT / CRACKED	455.80	399.80
1	TAILGATE INNER LOCK	SHORTED	425.80	425.80
1	TAILGATE INNER LOCK ACTUATOR	NOT NECESSARY	455.20	-
1	TAILGATE LOCK STRIKER	NOT NECESSARY	45.00	-
1	TAILGATE WEATHERSTRIP	TWISTED	399.80	399.80
2	TAILGATE DAMPERS @\$366.10	NOT NECESSARY	732.20	-
1	TAILGATE INNER TRIM BOARD	DEFORMED / TORN	455.10	455.10
1	TAILGATE REAR LOGO	NECESSARY	85.00	85.00
1	TAILGATE 'GL' STICKER	NECESSARY	60.00	60.00
1	TAILGATE 'HIACE' EMBLEM	NECESSARY	62.00	62.00
1	REAR BUMPER	DISTORTED	681.10	681.10
4	REAR BUMPER LOWER BRACKETS @\$35.00	NOT NECESSARY	140.00	-
2	REAR BUMPER SIDE RETAINERS @\$105.00	N/S CRACKED	210.00	105.00
1	REAR END PANEL OUTER	BADLY DENTED	981.10	845.10
1	REAR END PANEL INNER	TO REPAIR SEE LABOUR	988.50	-
1	REAR END PANEL TOP GARNISH	TWISTED	366.80	182.60
2	TAILLAMPS @\$455.10	N/S CRACKED	910.20	390.80
2	TAILLAMP LOWER GARNISHS @\$165.00	N/S DISTORTED	330.00	165.00
2	TAILLAMP HOUSING PANELS @\$488.50	N/S BENT	977.00	455.10
1	REAR SPARE TYRE BRACKET	NOT NECESSARY	455.10	-
1	REAR SPARE TYRE BRACKET HOLDER	NOT NECESSARY	165.30	-
1	REAR FENDER N/S	BADLY DENTED / BUCKLED	1,971.10	1,665.10
1	REAR AIR VENT N/S	DISTORTED	85.10	85.10

Report Ref No. CC4/LPC22006572/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-	-2,410.70
			16,104.70	7,232.10
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR WINDSCREEN INNER SEAL (SN)	NECESSARY	50.00	40.00
1	REAR LICENCE PLATE (SN)	NOT NECESSARY	50.00	-
1	SET REAR VIDEO CAM ASSY (SN)	DAMAGED	500.00	280.00
1	SET TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	50.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	NOT FITTED	280.00	-
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR FENDER GLASS SEALANT N/S (SN)	NECESSARY	80.00	40.00
1	TAILGATE 70KM/H STICKER (SN)	NECESSARY	10.00	10.00
			1,170.00	560.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REPLACED REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REPLACED REAR WINDSCREEN .		150.00	120.00
	TO TRANSFER TAILGATE MECHANISM.		100.00	60.00
	TO DISMANTLE & REFIX REAR EXHAUST .	NOT NECESSARY	100.00	-
	TO DISMANTLE & REFIX CUSHION ,SEAT, UPHOLSTERY .		180.00	100.00
	TO SPRAY RUST PROOFING.		120.00	80.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER .		2,800.00	1,400.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	900.00
			5,080.00	2,730.00
GRAND TOTAL			22,354.70	10,522.10

Report Ref No. CC4/LPC22006572/Upa3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,400.00
---	--	--	-----------------

Report Ref No. CC4/LPC22006572/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 9489J

INSPECTION

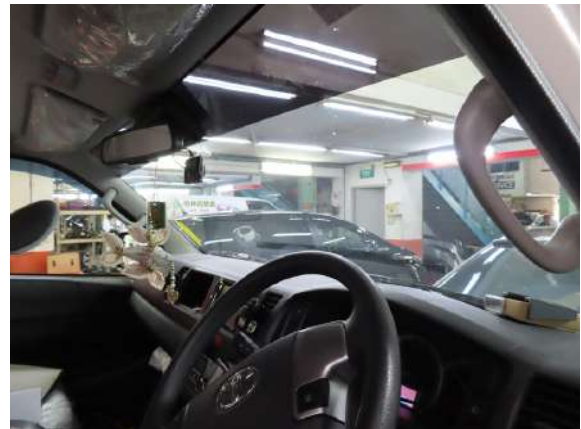




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

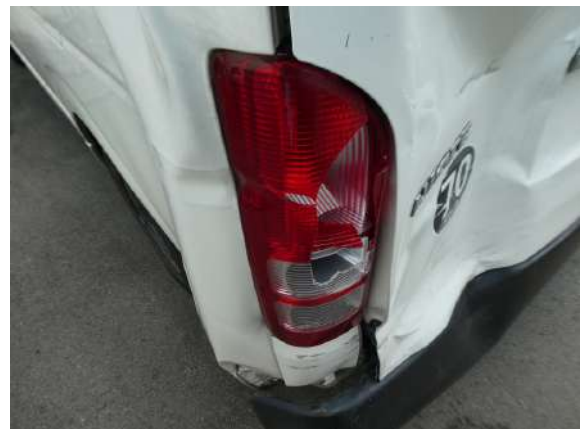




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

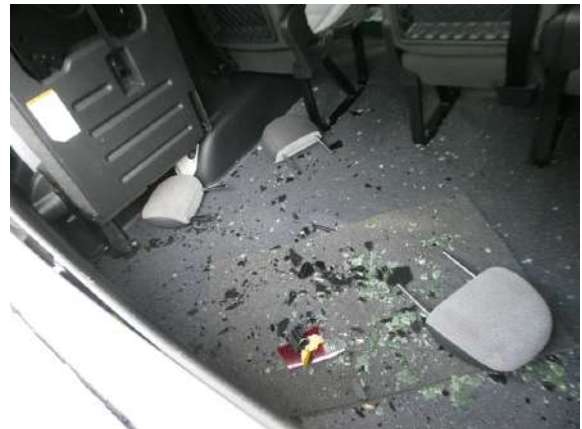



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

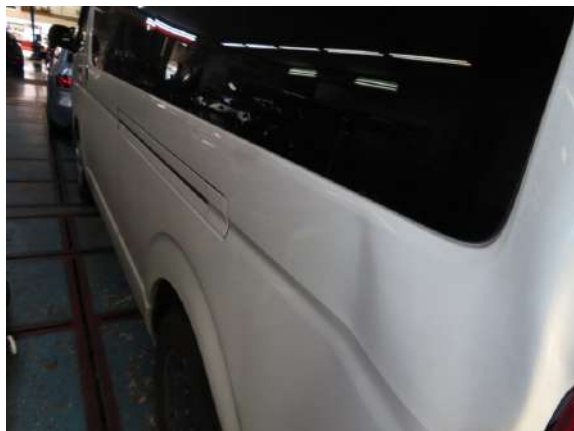



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 9489J

RE-INSPECTION

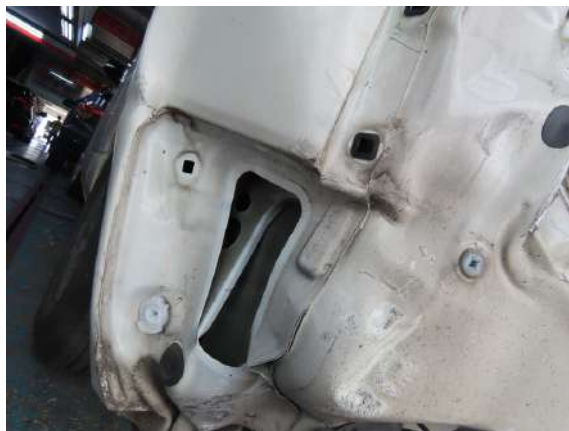



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PC 9489J

RE-INSPECTION

