

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 401M22.EAS  
Vehicle no : SKT7985B

### 1 REFERENCE

Date of inspection : 1 April 2022  
Requested by : Low Sock Hoon  
21 Pillai Road  
Singapore 535916  
Type of survey : Independent  
Repairer : Evergum Auto Services  
Blk 3022A Ubi Road 1, #01-51, Singapore 408716  
Date of accident : 30 March 2022

### 2 VEHICLE DATA

Make/Model : **VOLVO S60 D2**  
Chassis no : YV1FS84ABF2365887  
Engine no : D4162T3267133  
Date of registration : 23 June 2015 COE Expiry Date: 22 June 2025  
Engine capacity : 1560 cc  
Speedometer Reading : 77501 km  
Colour : Silver

### 3 STATIC CONDITION CHECK

Steering : Serviceable  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

4 <u>TIRE CONDITION CHECK</u>	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 6 mm/Michelin	6 mm/Michelin	215/55R16
Rear tread	: 6 mm/Michelin	6 mm/Michelin	215/55R16

### 5 BRIEF DESCRIPTION OF DAMAGE

Rear bumper dented/deformed, rear bumper reinforcement dented/bent, rear end panel bent, rear boot lid dented/grazed/bent, rear LH fender bent, LH rear wheelhouse panel bent, etc. Please see para. 8 of this report for more details.

### 6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### 7 RECOMMENDATION

Cost of repairs : **\$9,600.00** (lump sum)  
Estimated no of days : **Eight (8)**

## **8 ASSESSMENT OF DAMAGE AND COSTS**

Report no: 401M22.EAS

Vehicle no: SKT7985B

### **A SPARE PARTS**

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's</u>	<u>Revised</u>	
			<u>Amount</u>	<u>Amount</u>	
Rear bumper	1	dented/deformed	1,680.00	1,680.00	
Rear bumper reinforcement	1	dented/bent	1,330.00	1,330.00	
Rear bumper side retainer	2	necessary	188.00	188.00	
Rear bumper retaining clip	10	necessary	45.00	45.00	
Rear bumper lower centre cover	1	squashed/torn	660.00	660.00	
Rear bumper spoiler (black)	1	grazed/warped/distorted	850.00	850.00	
Reverse sensor	2	shorted	440.00	440.00	
Tow hook cover	1	to reuse	62.00	0.00	
Rear boot lid	1	dented/grazed/bent	2,610.00	2,610.00	
Rear boot lid VOLVO emblem	1	necessary	110.00	110.00	
Rear boot lid D2 emblem	1	necessary	75.00	75.00	
Rear boot lid S60 embelm	1	necessary	110.00	110.00	
Rear boot lid side reflector lamp assyLH	1	broken	330.00	330.00	
Rear boot lid upper lock assy	1	bent/distorted	380.00	380.00	
Rear boot lid hinge LH/RH	2	bent	440.00	440.00	
Rear boot lid hinge cover LH/RH	2	bent/grip tabs broken	310.00	310.00	
LH taillamp assy	1	to reuse	360.00	0.00	
Rear end panel	1	to repair	1,084.00	0.00	
Rear end panel garnish centre flap	1	broken	22.00	22.00	
Rear end panel garnish centre flap spring	1	missing	28.00	28.00	
Rear end panel garnish	1	flap bracket broken	440.00	440.00	
LH rear fender	1	to repair	1,140.00	0.00	
LH rear wheelhouse panel	1	to repair	950.00	0.00	
LH rear door sill cover	1	cracked	380.00	380.00	
Subtotal of the above			14,024.00	10,428.00	
Discount			10% / 10%	1,402.40	1,042.80
Total cost of parts:			12,621.60	9,385.20	

### **B LABOUR**

Labour charges to remove and replace damaged parts, to cut and weld damaged body panels, to knock and reshape affected areas, to adjust and align misaligned parts.	1,000.00	750.00
Spray painting charges to putty and spray paint the rear LH fender, rear boot lid, rear boot lid hinges, rear end panel, rear LH door sill panel, rear bumper, rear bumper centre cover and necessary areas.	2,000.00	1,500.00
To check wiring and repair where needed.	60.00	45.00
To apply anti-rust undercoat for the affected areas.	200.00	90.00
To transfer rear boot lid inner fittings and electrical parts to new tailgate.	90.00	60.00
To install reverse sensors and to check and tune sensing distance.	120.00	90.00
Total cost of labour:	3,470.00	2,535.00
Total cost of repair:	16,091.60	11,920.20

Report no: 401M22.EAS  
Vehicle no: SKT7985B

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is

\$11,920.20

(a) The recommended cost of repair based on lump sum repairs would be

**\$9,600.00**

(b) Estimated number of days taken by the repairs would be

**Eight (8)**

(1<sup>st</sup> Re-inspection conducted on 2 April 2022)


(Post Repair Inspection conducted on 8 April 2022)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

**Note: Lump Sum Repair Basis**

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Prepared by:

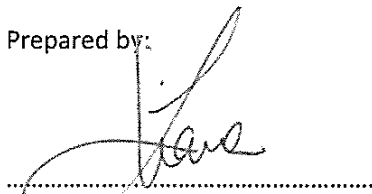

Liaw Leong San

Licensed Automotive Appraiser

Dated: 18 May 2022

## Enquire Vehicle Transfer Fee

### Vehicle Details

Vehicle No.

SKT7985B

Make / Model

VOLVO / S60 D2

Vehicle Type :

P10 - Passenger Motor Car

Vehicle Attachment 1 :

No Attachment

Vehicle Scheme :

Normal

Chassis No. :

YV1FS84ABF2365887

Propellant :

Diesel

Engine No. :

D4162T3267133

Motor No. :

-

Engine Capacity :

1560 cc

Power Rating :

-

Maximum Power Output :

84.0 kW (112 bhp)

Maximum Laden Weight :

2050 kg

Unladen Weight :

1549 kg

Year Of Manufacture :

2015

Original Registration Date :

23 Jun 2015

Lifespan Expiry Date :

-

COE Category :

A - Car up to 1600cc & 97kW (130bhp)

Quota Premium :

\$68,589.00

COE Expiry Date :

22 Jun 2025

Road Tax Expiry Date :

22 Jun 2022

PARF Eligibility Expiry Date :

22 Jun 2025

Inspection Due Date :

22 Jun 2022

Intended Transfer Date :

18 May 2022





















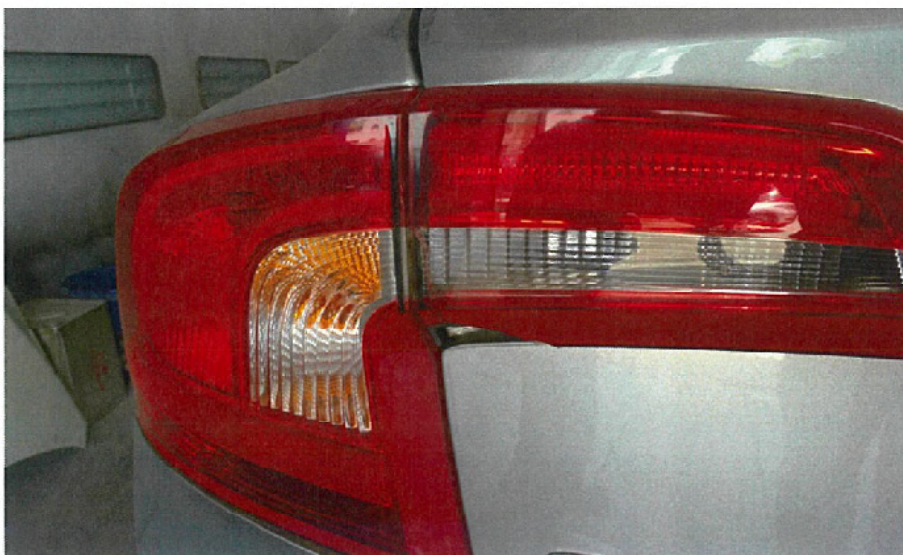








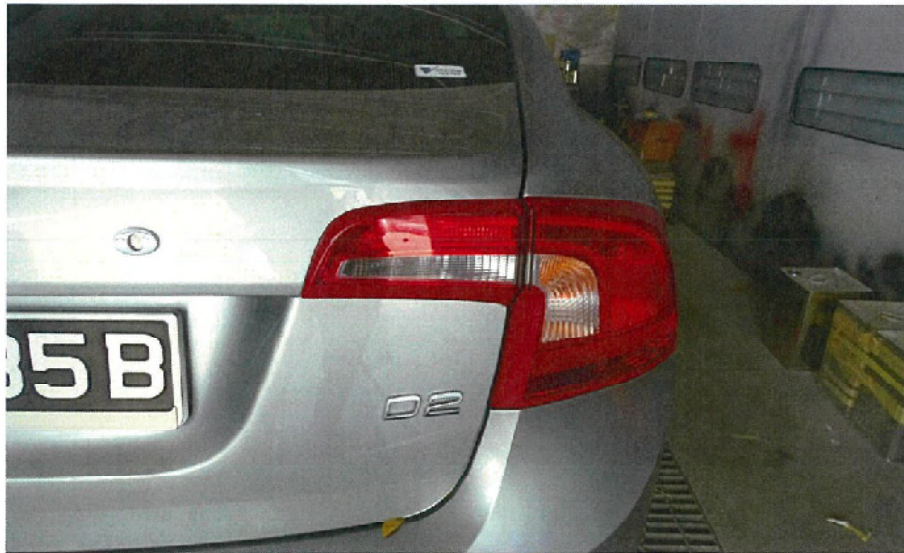










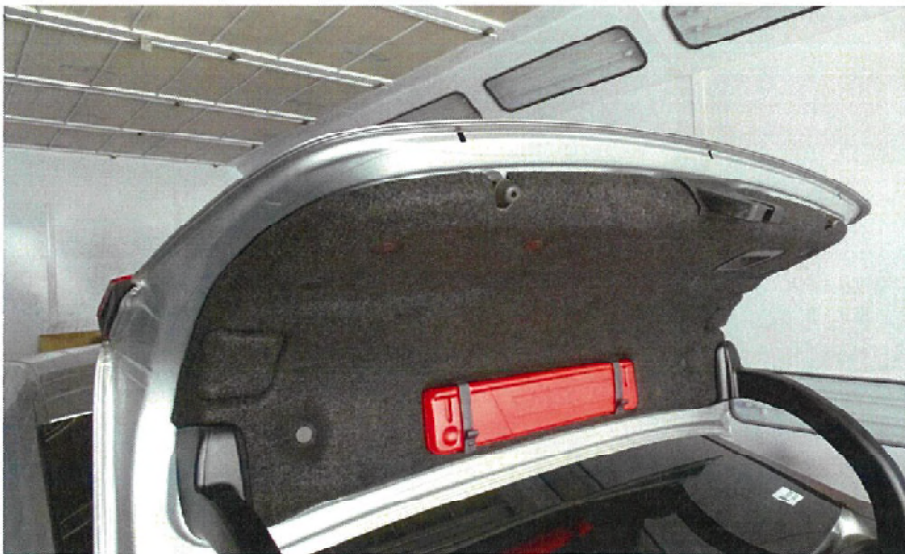






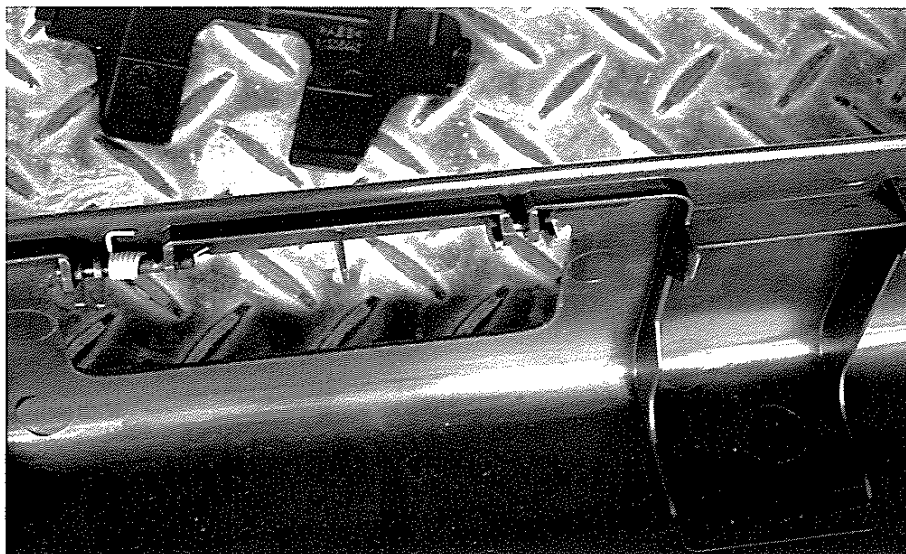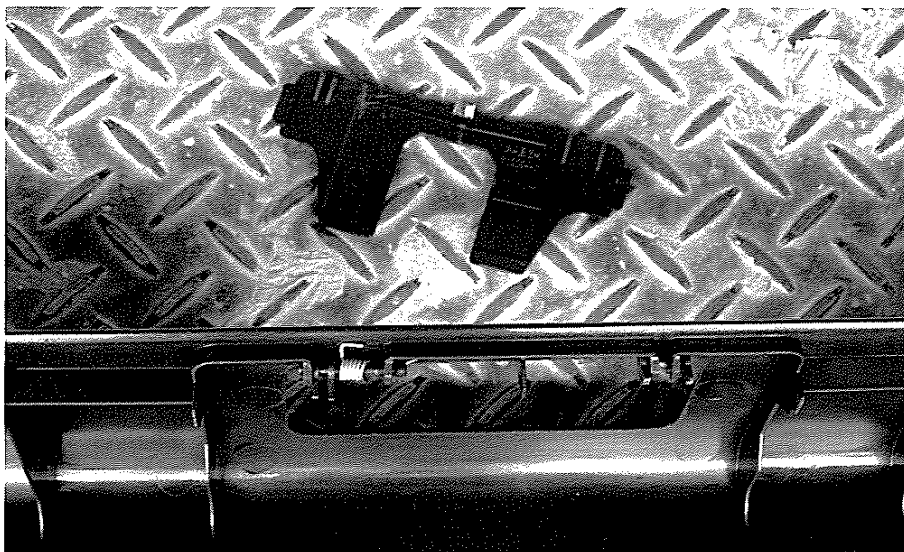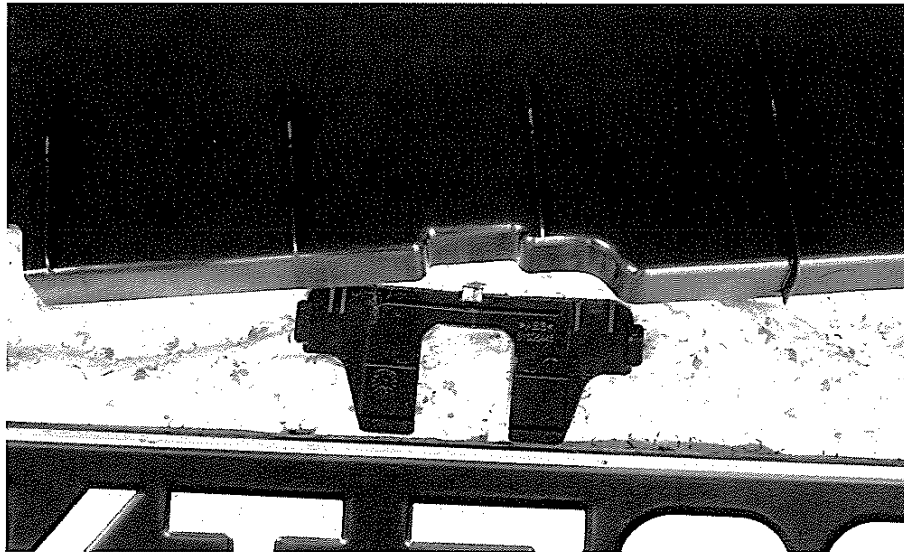







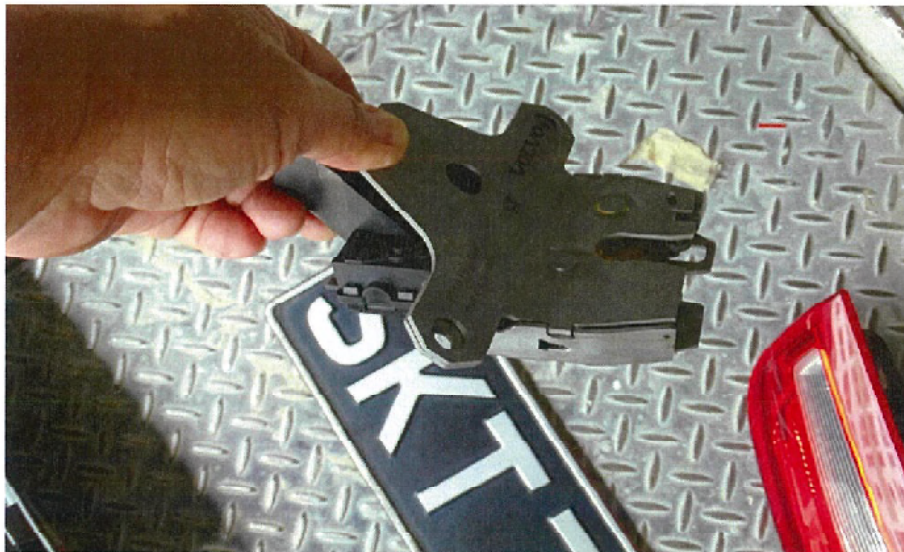











Report no: 401M22.EAS

Vehicle no: SKT7985B







Report no: 401M22.EAS

Vehicle no: SKT7985B











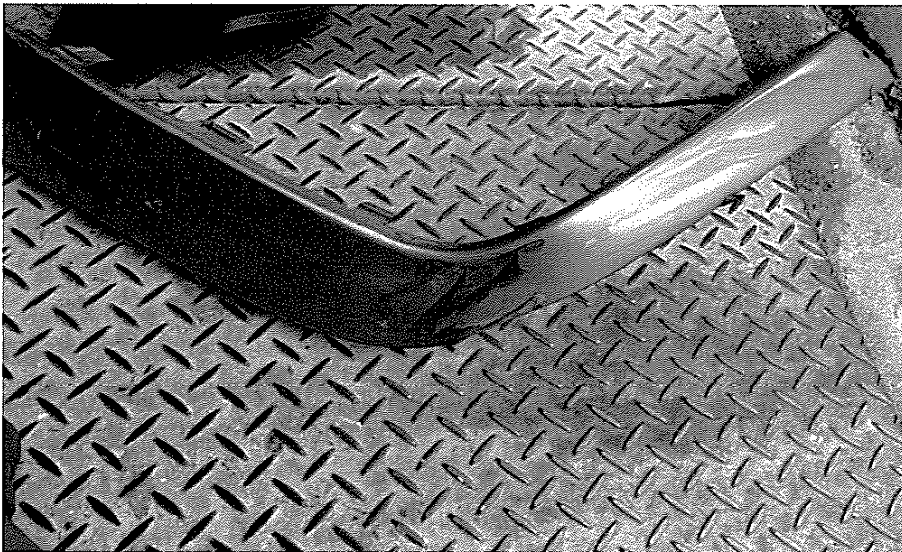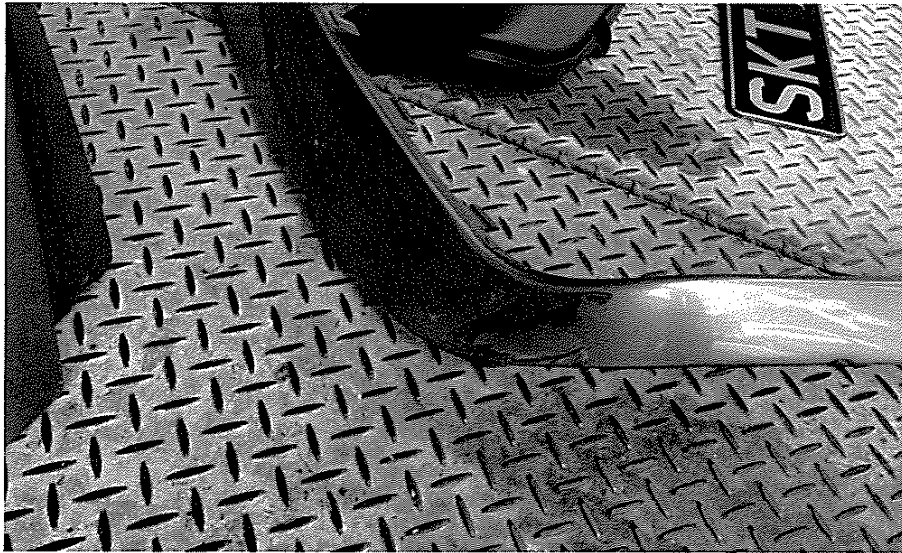






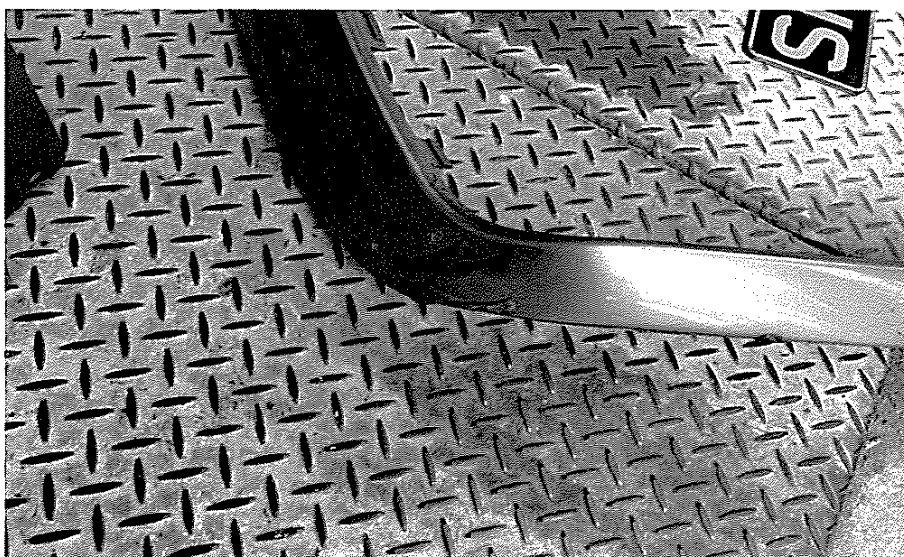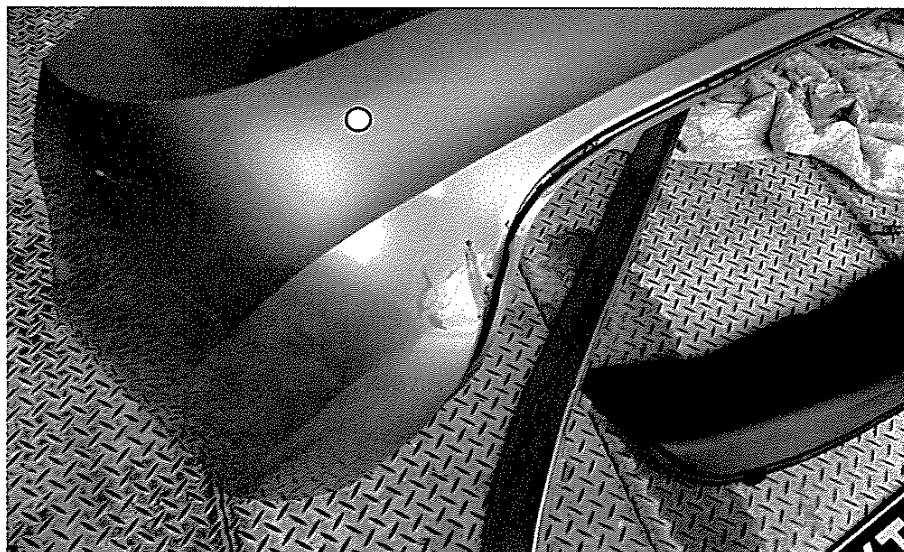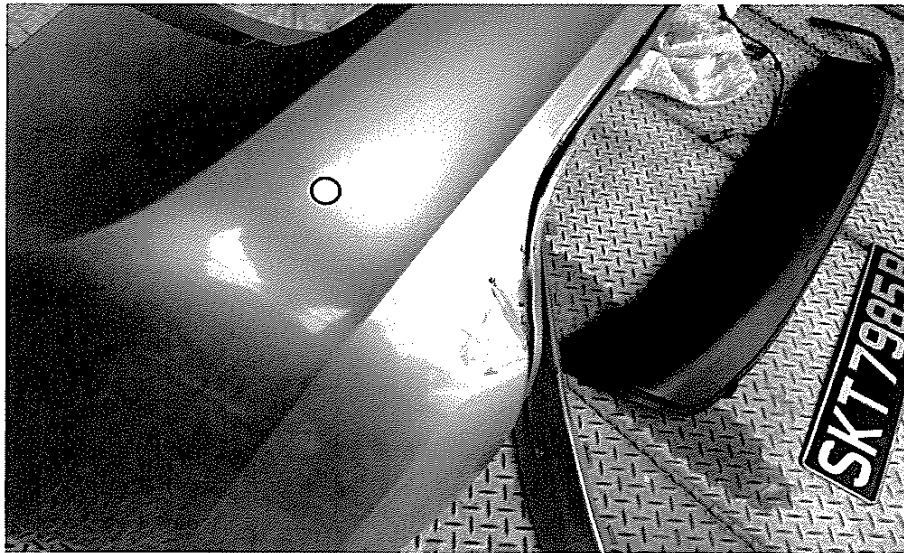

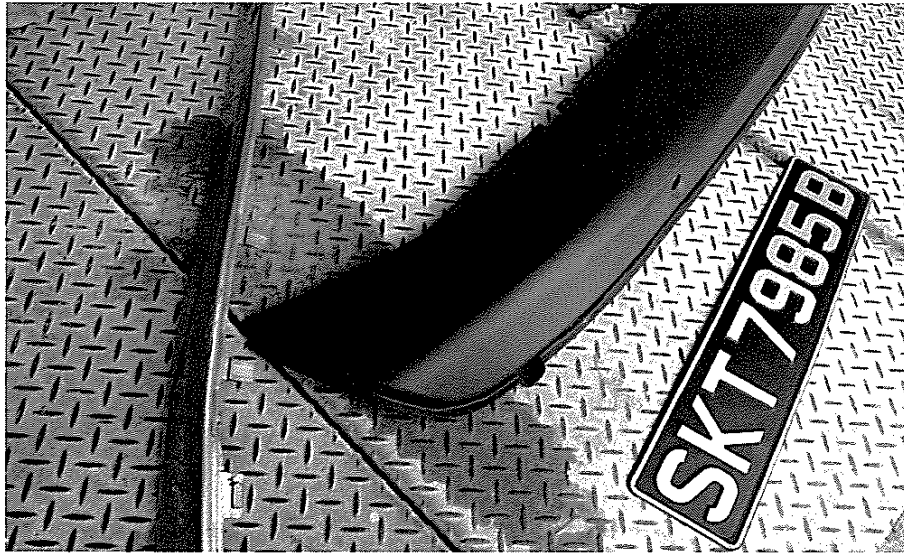




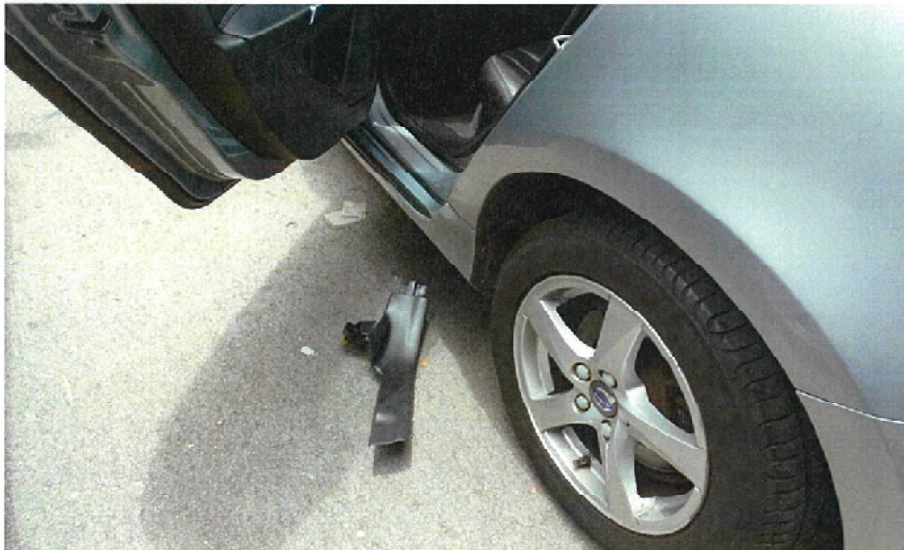


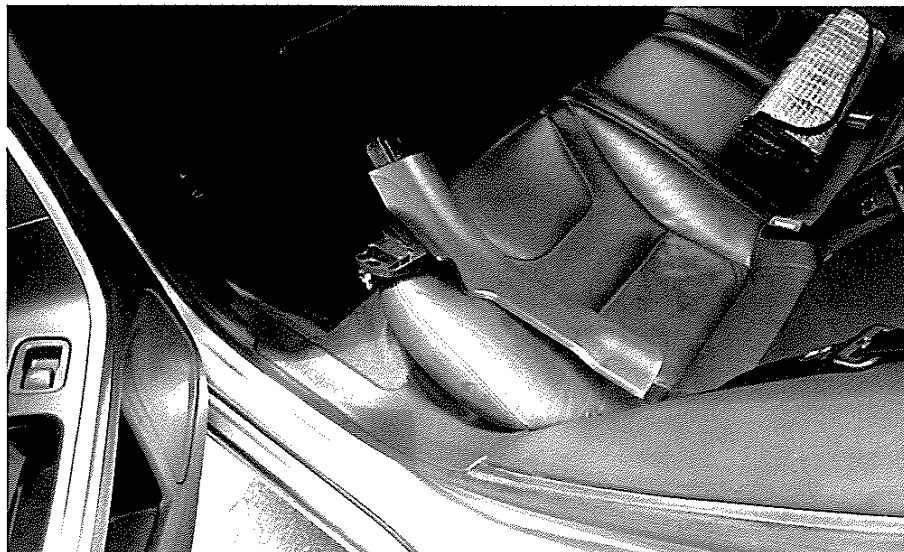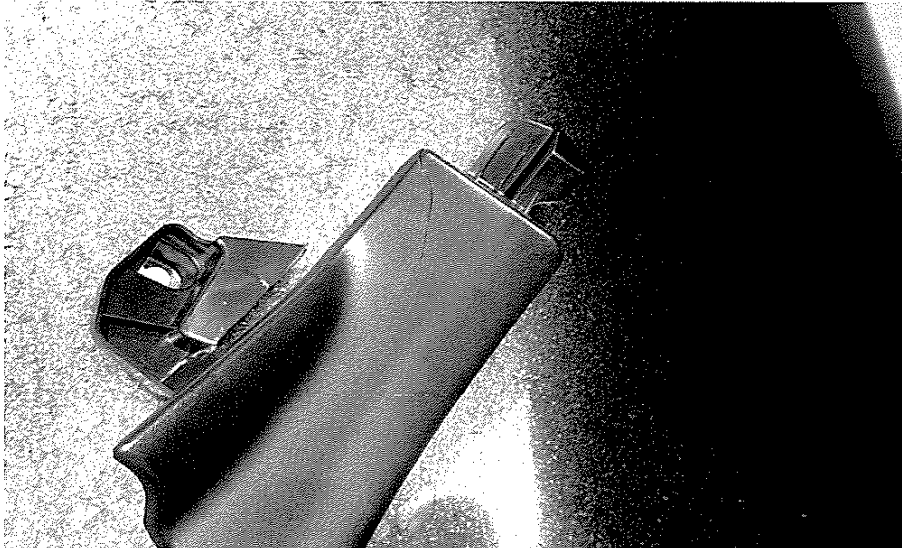








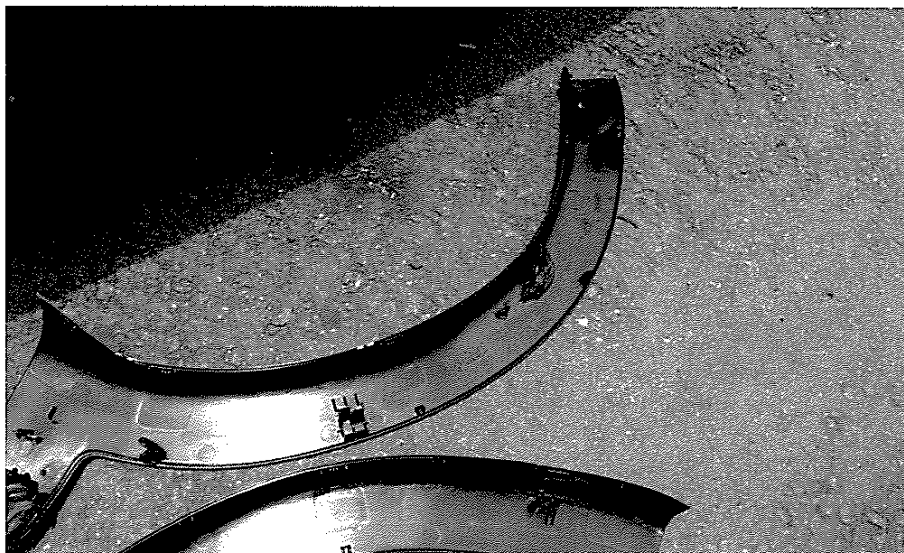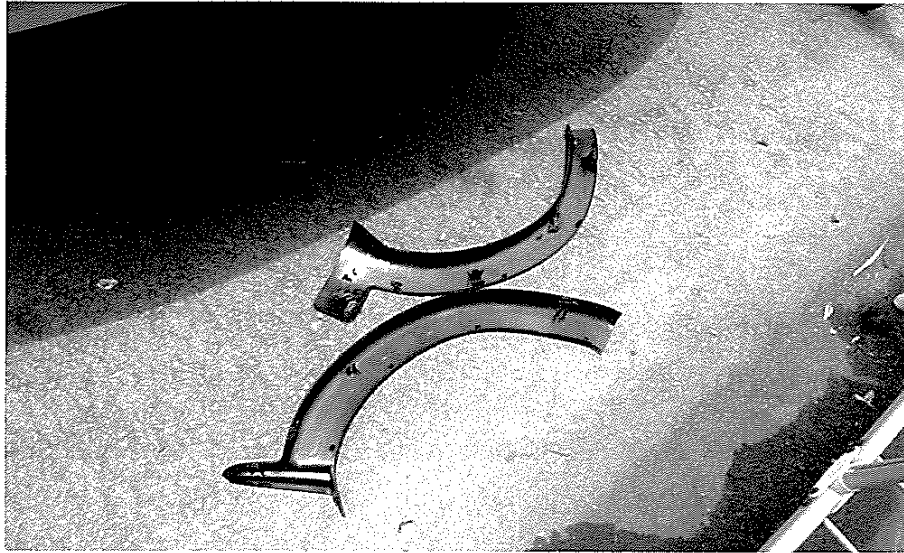

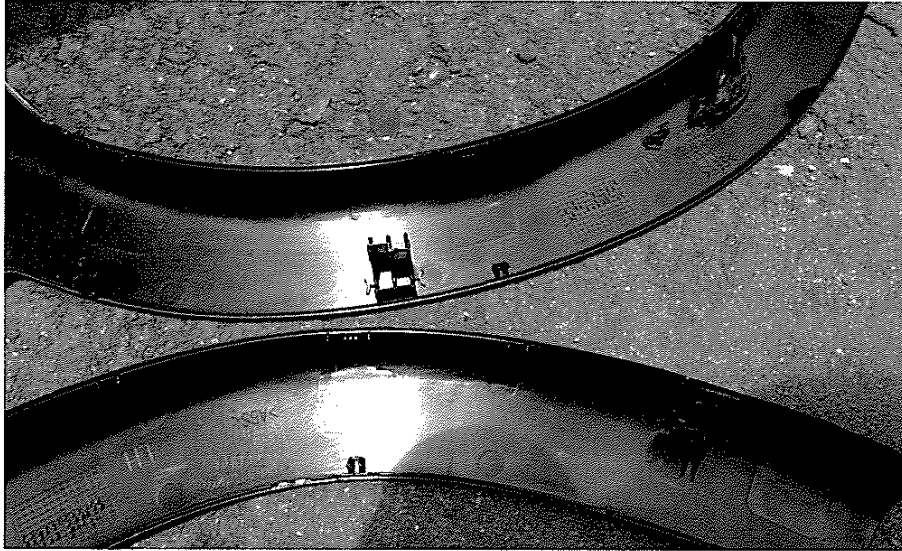












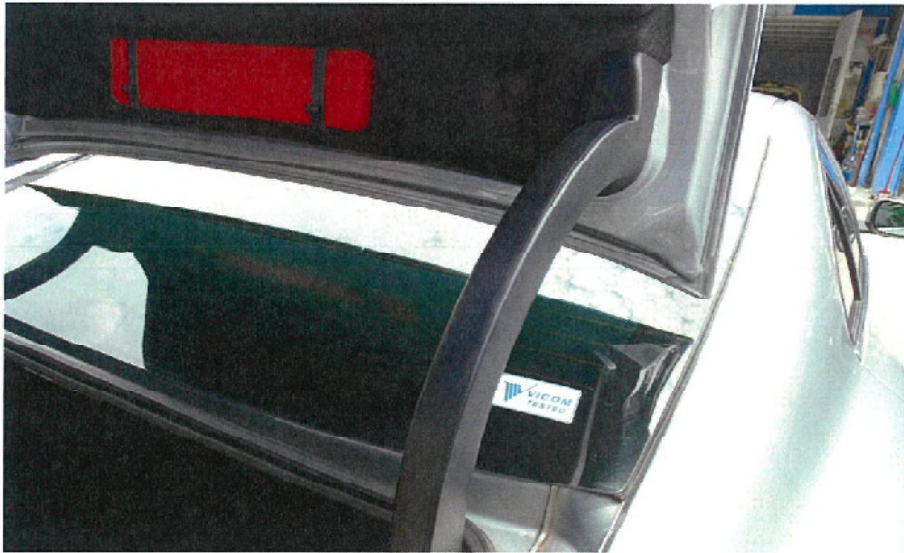

















Report no: 401M22.EAS

Vehicle no: SKT7985B

