

NEW AUTO SPEC APPRAISAL

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Vehicle Survey Report

Reg No	: <u>NAS1219</u>	Date	: <u>12-12-2019</u>
Our Reference No.	: <u>WC7966D21102019</u>	Date Of Survey	: <u>21-10-2019</u>
Claim Type	: <u>Third Party</u>	Date Of Accident	: <u>14-10-2019</u>
Assignment Given By	: <u>GR Engineering Services Pte Ltd</u>	Survey Conduct At	: <u>Multilateral Services</u>
		Address	: <u>160 Sin Ming Drive</u>
			: <u>Sin Ming Auto City</u>
			: <u>#06-01 Singapore 575722</u>

Particulars of vehicle

Vehicle Reg. No.	: <u>WC7966D</u>	Engine Number	: <u>Hidden</u>
Date Of Registration	: <u>15-10-2014</u>	Chassis Number	: <u>JALCYH52SE7000029</u>
Make	: <u>Isuzu</u>	Transmission Type	: <u>Manual</u>
Model	: <u>CHY52S</u>	Vehicle Colour	: <u>Blue/white</u>
		Mileage Reading	: <u>195842</u>

Visual and static test on vehicle during survey

Hand brake condition	: <u>Serviceable</u>	Body Condition	: <u>Fair</u>
Foot brake condition	: <u>Serviceable</u>	Paint Work condition	: <u>Fair</u>
Steering condition	: <u>Serviceable</u>	Remarks	: <u>None</u>
Modification	: <u>None</u>		

Condition of vehicle tyre

	Size	Make / Right Tread	Make / Left Tread
Front Tyre	: 295/80R22.5	Yokohama / 6MM	Yokohama / 6MM
Rear Tyre	: 295/80R22.5	Yokohama / 6MM	Yokohama / 6MM


Description on vehicle's point of impact and

Front portion of the vehicle
(For more detail of the damages, please refer photographs attached)

Remarks

In accordance to your instruction, we have **NOT** authorised any repairs.
Estimated duration of repairs 20 days.
This survey was conducted entirely on a **"WITHOUT PREJUDICE"** basis.

Point Of Impact

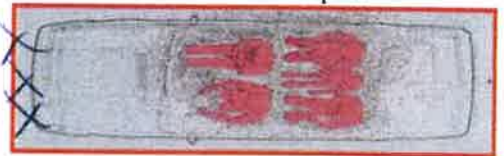

NEW AUTO SPEC APPRAISAL

WC7966

25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Adjustment on Spare Parts & Repair Cost

S/No	Qty	Vehicle Parts Description	Condition	Original Quotation (\$\$)	Recommendation (\$\$)
1	1	Cabin roof panel	Repair	4800.00	0.00
2	1	Roof lining	Serviceable	2858.00	0.00
3	1	Front windscreen glass	Crack	3200.00	3200.00
4	1	Front windscreen glass rubber	Cut	580.00	580.00
5	1	Front windscreen pillar LH	Dent	2280.00	2280.00
6	1	Front windscreen pillar side garnish LH	Cut	480.00	480.00
7	1	Front windscreen lower garnish	Crack	669.00	669.00
8	1	Front windscreen handle LH	Dent	385.00	385.00
9	1	Front side mirror stand LH	Dent	1158.00	1158.00
10	1	Front side mirror motor LH	Dent	680.00	680.00
11	1	Front side mirror centre LH	Crack	442.00	442.00
12	1	Front side mirror lower LH	Crack	480.00	480.00
12	1	Front side mirror top LH	Crack	520.00	520.00
13	1	Front firewall panel	Repair	0.00	0.00
14	1	Bonnet	Crack	3280.00	3280.00
15	1	Bonnet grille	Cut	620.00	620.00
16	1	Bonnet isuzu emblem	Necessary	180.00	180.00
17	1	Bonnet lock	Dent	225.00	225.00
18	1	Bonnet hinge LH	Dent	285.00	285.00
19	1	Bonnet damper	Dent	255.00	255.00
20	1	Front corner panel LH	Crack	1385.00	1385.00
21	1	Front corner panel LH rubber strip	Cut	180.00	180.00
22	1	Front corner panel bracket LH	Dent	130.00	130.00
23	1	Front bumper	Dent	3200.00	3200.00
24	1	Front bumper top garnish LH	Dent	385.00	385.00
25	1	Front bumper centre top garnish	Cut	558.00	558.00
26	1	Front bumper lower bracket LH	Dent	285.00	285.00
27	1	Front bumper side bracket LH	Dent	198.50	198.50
28	1	Headlamp LH	Crack	2188.00	2188.00
29	1	Headlamp housing LH	Serviceable	1128.00	0.00
30	1	Headlamp lower bracket LH	Dent	228.00	228.00
31	1	Front signal lamp LH	Crack	480.00	480.00
32	1	Front bumper lamp LH	Crack	520.00	520.00
33	1	Front step top housing LH	Dent	1128.60	1128.60
34	1	Front top step panel LH	Dent	480.00	480.00
35	1	Front housing centre rubber LH	Cut	383.00	383.00
36	1	Front step lower housing LH	Dent	980.00	980.00
37	1	Front lower step panel LH	Dent	445.00	445.00
38	1	Front lower step panel bracket LH	Dent	1485.00	1485.00
39	1	Front door LH	Bent	3850.00	3850.00
40	1	Front door lock LH	Jam	580.00	580.00
41	1	Front door hinge LH	Dent	896.00	896.00
42	1	Front door window regulator LH	Bent	788.50	788.50
43	1	Front door window regulator motor LH	Dent	685.00	685.00
44	1	Front door trim LH	Crack	1288.00	1288.00
45	1	Front door lower inner garnish LH	Cut	580.00	580.00
46	1	Front door lower outer garnish LH	Missing	840.00	840.00
47	1	Front door window moulding LH	Bent	320.00	320.00
48	1	Front door channel LH	Bent	280.00	280.00
49	1	Front door weathstrip LH	Cut	325.00	325.00
50	1	Front door pillar LH	Bent	1580.00	1580.00

NEW AUTO SPEC APPRAISAL

WC7966


25 Moonstone Lane Moonstone Residence

#10-02 Singapore 328465

Adjustment on Spare Parts & Repair Cost

S/No	Qty	Vehicle Parts Description	Condition	Original Quotation (\$)	Recommendation (\$)
51	1	Front door pillar rubber	Cut	285.00	285.00
52	1	Front door side panel LH	Bent	2280.00	2280.00
53	1	Front door side panel inner garnish LH	Deform	980.00	980.00
54	1	Front door side pillar lower garnish LH	Deform	480.00	480.00
55	1	Front door pillar lower garnish LH	Cut	380.00	380.00
56	1	Front door frame LH	Repair	3850.00	0.00
57	1	Front door inner handle LH	Cut	288.00	288.00
58	1	Front dashboard	Serviceable	3850.00	0.00
				63549.60	47063.60
Less Market Discount 15%				0.00	7,059.54
TOTAL :				63,549.60	40,004.06
1	1	Front door sticker 1071	Necessary	200.00	100.00
2	1	Front door side panel sticker LH	Necessary	400.00	100.00
3	1	Front windscreen sealant	Necessary	150.00	120.00
TOTAL :				750.00	320.00
1		Check electrical wiring system.		300.00	250.00
2		Remove and refit dashboard.		500.00	350.00
3		Remove and refit carpet and upholstery.		500.00	250.00
4		Towing.		450.00	450.00
5		Anti rust.		200.00	150.00
6		Remove and refit front windscreen glass.		500.00	360.00
7		Transfer door fitting.		200.00	150.00
8		To putty and spray paint charges		2500.00	1400.00
9		Remove and refit damaged parts, cut,weld, panel beat, straighten and realign etc.		3000.00	2600.00
TOTAL :				8150.00	5960.00
TOTAL PARTS AND LABOUR				72,449.60	46,284.06
RECOMMENDED COST OF LUMP SUM REPAIR					37,000.00

Vehicle Surveyed By:

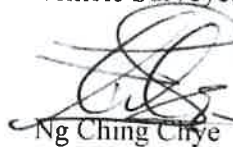
Ng Ching Chye

For New Auto Spec Appraisal

NEW AUTO SPEC APPRAISAL

25 Moonstone Lane, Moonstone Residence, #10-02 Singapore 328465

INVOICE

Invoice No.

NAS1219

Customer

GR Engineering Services Pte Ltd

c/o Multilateral Services

160 Sin Ming Drive

Sin Ming Auto City

#06-01 Singapore 575722

Date of Invoice: 12/12/2019
Our Job Ref: WC7966D21102019
Your Ref No. : Not Advised
Vehicle No. : WC7966D
Reg Form No. : NASAE12192019
Date of Survey: 21/10/2019
Date of Accident: 14/10/2019
Survey Conduct at: Multilateral Services

S/N	DESCRIPTION	
1	Survey Fee (including photographs and transport charges)	\$ 918.00
Grand Total \$		\$ 918.00

NEW AUTO SPEC APPRAISAL


Signature















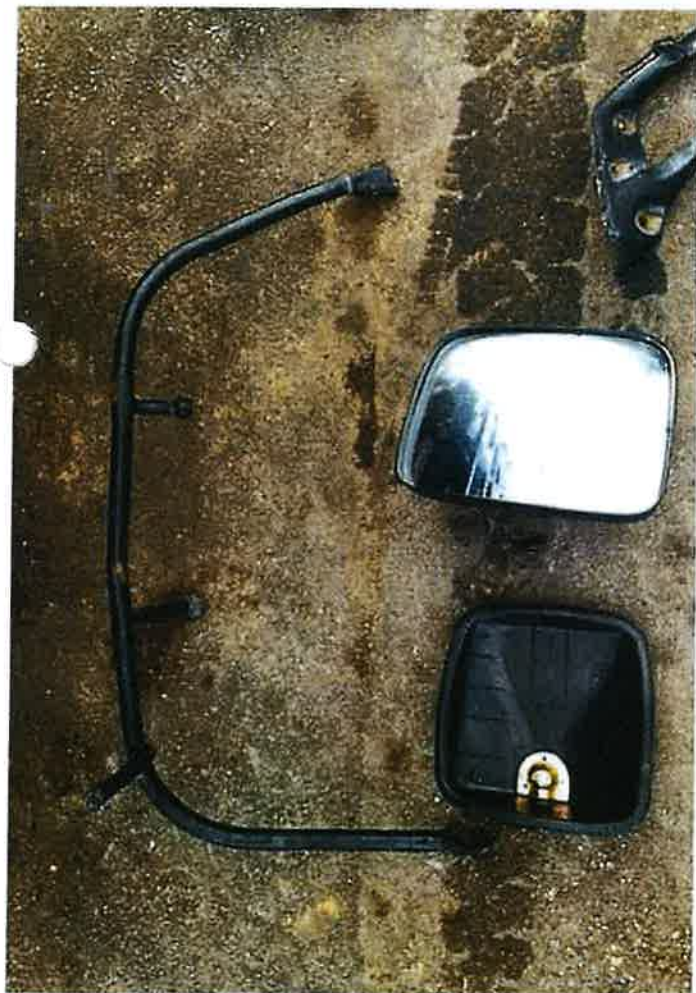



AUTO
SPEC
APPRAISAL
NEW

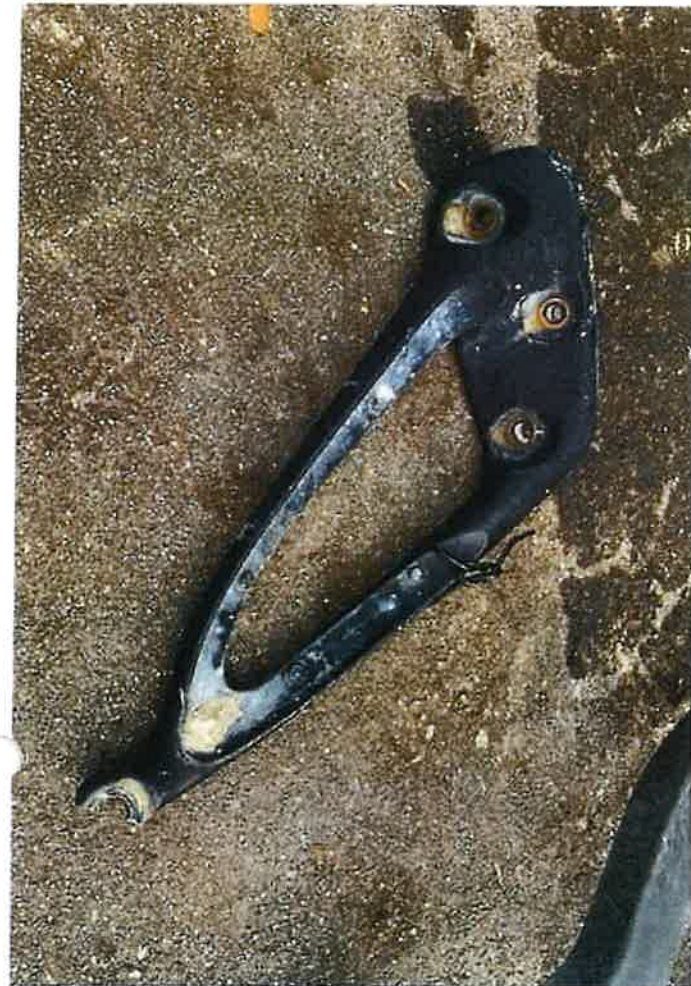











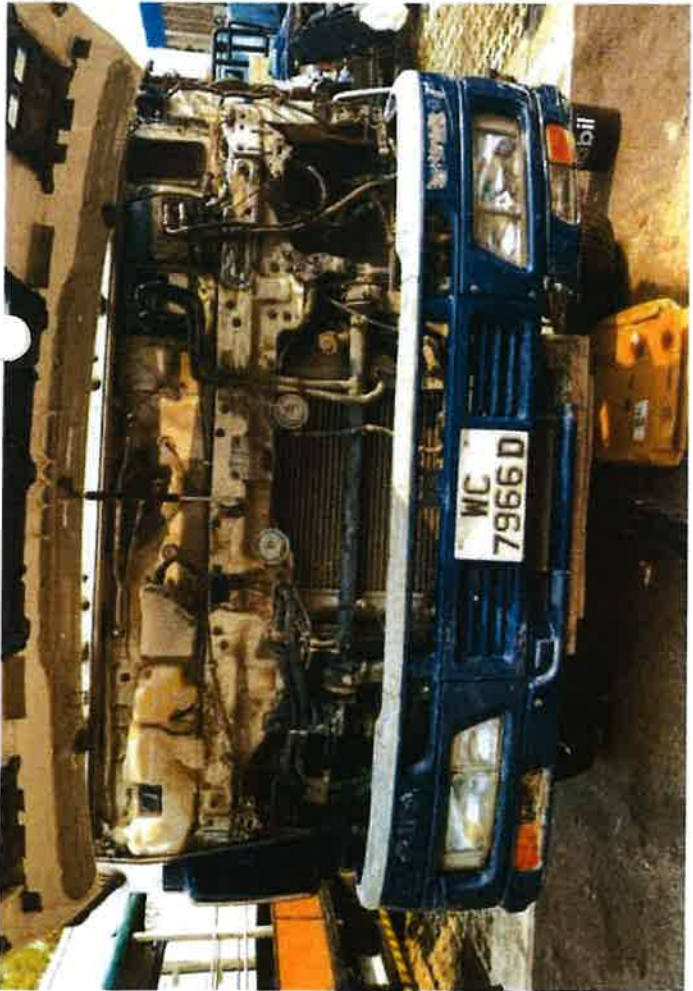





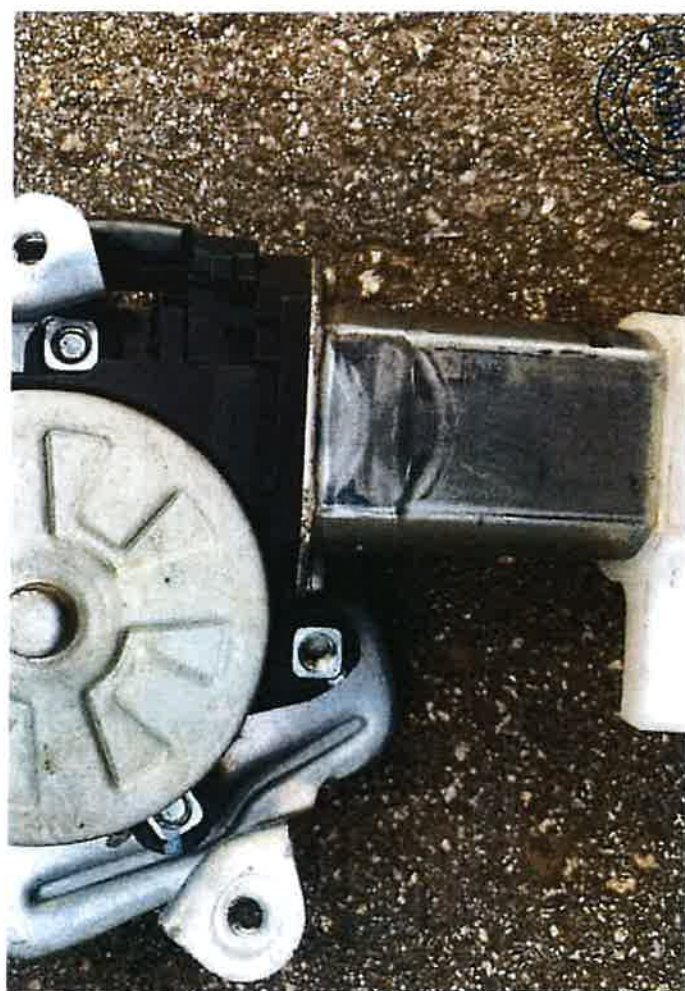



MULTILATERAL SERVICES

PRO - FORM A

160, Sin Ming Drive, Sin Ming Auto City,
#06-01 Singapore 575722
Tel: 6453 5654, 6459 1630 Fax: 6459 1698
Reg. No. 46956800/C

DATE : **26/12/2019**

INVOICE NO : TP **2674**

TO : **GR ENGINEERING PTE LTD
160, SIN MING DRIVE
SIN MING AUTO CITY # 06-01
SINGAPORE 575722**

VEH NO : **WC 7966 D**
MODEL : **ISUZU
CYH52S**

PAYMENT TERM :

S/N	DESCRIPTION	AMOUNT S\$
	Accident Date : 14/10/2019	
	Lump Sum Repair, Supply Parts Labour , Spray Painting , etc Survey By NEW AUTO SPEC APPRAISAL Ref : WC7966D21102019	\$ 37,000.00
	Sub - Total: \$ 37,000.00	
	NOTE : All cheques must be crossed and make payable to MULTILATERAL SERVICES	
	TOTAL	\$ 37,000.00

RECEIVED VEHICLE IN GOOD ORDER

for MULTILATERAL SERVICES

