

# Precise Appraiser Pte Ltd

VEHICLE DAMAGE ASSESSMENT REPORT

Reg no. 201924041Z

To: Ravi Shanker S/o A Manivasagam

CC: Team Work Garage Pte Ltd  
53 Ubi Ave. 1 #01-24  
Paya Ubi Industrial Park  
Singapore 408934

## REFERENCES

Ref No	: 2022/02001	Date of Report	: 10/2/2022
Claim Type	: Third Party	Date of Request	: 5/2/2022
Third party vehicle	: SMX3854C	Date of Accident	: 22/1/2022
Insured Vehicle	:	Date of Inspection	: 5/2/2022
Your Reference No	:		

## DAMAGED VEHICAL PARTICULARS

Registration Plate No	: SMX3854C	Engine Modification	: NIL
Model / Make	: Hyundai Avante	Pre-accident damage	: NIL
Colour	: Blue	General Condition	: Good
Manufacturing Year	: 2009	General Paint Work	: Good
Engine No	: G4FC9U661064	Steering	: Serviceable
Engine Capacity	: 1600 cc	Handbrake	: Serviceable
Chassis No	: KMH DU41BR9U770108	Footbrake	: Serviceable
Odometer No	: 189882		
Transmission	: Auto		

## TYRES CONDITION

Front Right		Rear Left	
Make	: Bridgestone	Make	: Bridgestone
Size	: 215/45 r17 5	Size	: 215/45 r17 5
Front Left		Rear Right	
Make	: Bridgestone	Make	: Bridgestone
Size	: 215/45 r17 5	Size	: 215/45 r17 5

The above millimetres represent the remaining life of tyre treads

## VEHICAL REPAIR COST

Descriptions	Repairer (\$\$)	Difference (\$\$)	Adjuster (\$\$)
Parts	7,190.32		6,936.56
Labour	3,310.00		2,640.00
Calculated Cost (\$\$) :	10,500.32	923.76	9,576.56

Recommended Lump Sum Repair Cost (\$\$)	: 7,650.00
Estimate Repair Duration	: 5
Survey Inspection At	: Team Work Garage Pte Ltd
Survey Inspection Address	: 53 Ubi Ave. 1 #01-24 Paya Ubi Industrial Park Singapore 408934


F: 2400  
ND: 5

## DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the Front Lh Portion.

Front lh fender, front lh door dented, lh rocker panel scratch, front lh sport rim grazed, front lh undercarriage push in etc.

Please see attached scheduled details.

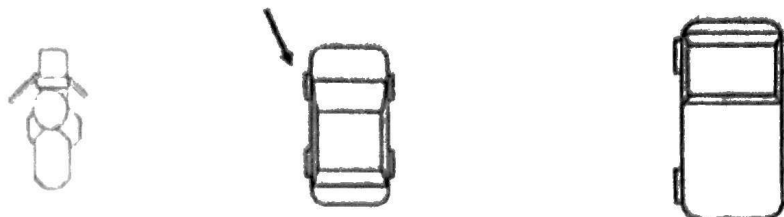

## SPECIAL REMARKS

We have not authorised repair. Under normal circumstances, estimated 5 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.

Handwritten signature of Anthony and a circular stamp.

Anthony  
Automotive Appraiser  
MARA

## Disclaimer:

This survey was conducted by Precise Appraiser Pte Ltd without prejudice basis and we do not authorized repair. Report by Precise Appraiser Pte Ltd is deemed as confidential and provided for the use of clients and appointed agent. We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle. All findings and recommendations are listed accordingly and final decision of settlement to your good selves parts thereof accordingly and final. No liability shall be attached to Precise Appraiser Pte Ltd therefore.

Our Reference : 2022/02001

Your Reference:

Vehicle Number : SMX3854C

S/N	Qty	Description	Condition	Repairer Estimate (\$\$)	Our Assessment (\$\$)
<u>Parts</u>					
1	1pcs	Front lh fender	Dented	521.20	521.20
2	1pcs	Front lh fender inner shield	Torn	48.00	48.00
3	2pcs	Front lh door	Dented	1,440.90	1,440.90
4	1pcs	Front lh door frame sticker	Necessary	13.00	13.00
5	1pcs	Front lh door inner rubber	Necessary	106.10	106.10
6	1pcs	Front lh door inner lock	Serviceable	267.20	-
7	1pcs	Front lh lower arm	Bent	310.60	310.60
8	1pcs	Front lh knuckle arm	Bent	309.00	309.00
9	2pcs	Front lh knuckle arm bearing	Necessary	135.90	135.90
10	1pcs	Steering rack	Bent	960.10	960.10
11	1pcs	Lh tie rod	Bent	95.90	95.90
12	1pcs	Lh tie rod end	Bent	55.00	55.00
<b>Total</b>				<b>4,262.90</b>	<b>3,995.70</b>
<b>Less 20%</b>				<b>852.58</b>	<b>799.14</b>
<b>Parts Sub Total</b>				<b>3,410.32</b>	<b>3,196.56</b>

Special Nett

13	1set	Front bumper clips	Necessary	50.00	30.00
14	1set	Front lh fender inner shield clip	Necessary	50.00	30.00
15	1pcs	Front lh sport rim (volks racing)	Grazed	950.00	950.00
16	1set	Front lh shock absorber	Bent	2,500.00	2,500.00
17	1set	Lh anti roll bar link	Necessary	150.00	150.00
18	1btl	Brake fluid	Necessary	80.00	80.00
<b>Total</b>				<b>3,780.00</b>	<b>3,740.00</b>

<u>Labour</u>					
1		To check wiring system.	80.00	50.00	30
2		To reset and reprogramme after repair.	150.00	120.00	XNN
3		To r&r front lh undercarriage.	300.00	250.00	XNN
4		To r&r steering rack.	250.00	200.00	XNN
5		To conduct wheel alignment.	150.00	120.00	XNN 60
6		To transfer front lh sport rim and balance.	80.00	50.00	
7		To transfer front lh door attachments.	100.00	100.00	50
8		To panel beat and straighten on front lh pillar. To r&r front lh fender, front lh door and other attachments.	1,000.00	800.00	460
9		To putty and respray on front lh fender, front lh door, lh rocker panel and accident affected areas.	1,000.00	800.00	460

10	Rustproofing	200.00	150.00	50
	<b>Labour Total</b>	<b>3,310.00</b>	<b>2,640.00</b>	
	<b>Sub Total (labour and parts)</b>	<b>10,500.32</b>	<b>9,576.56</b>	

#### Adjustment / Recommendations

Note: For Lump Sum Repair

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or use of ex-stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements).

The final adjusted Lump Sum contract amount is S\$7,650.

Under normal circumstances, the repair period would be about 5 working days.