

AUTO PERFORMANCE APPRAISAL

APA

TAX INVOICE

Tay Aik Beng
C/O King's Auto Repair & Service Pte Ltd
176 Sin Ming Drive
Sin Ming AutoCare #02-10
Singapore 575721

INVOICE NO : APA22002373

DATE : 06/05/2022

VEHICLE NO : SNA7584P

JOB REFERENCE NO : 22/002485

ACCIDENT DATE : 18/04/2022

SURVEY DATE : 22/04/2022

DESCRIPTION

AMOUNT

Survey Fees Inclusive Of \$500.00

Transportation

Photographs (\$1) Per Copies : 76 \$76.00

TOTAL AMOUNT : \$576.00

Notes :

All cheque payment should be "Crossed" and made payable to "Auto Performance Appraisal"

Auto Performance Appraisal



AUTO PERFORMANCE APPRAISAL

APA

VEHICLE SURVEY REPORTS																																				
Tay Aik Beng C/O King's Auto Repair & Service Pte Ltd 176 Sin Ming Drive Sin Ming AutoCare #02-10 Singapore 575721																																				
1	Reference Job Reference No : 22/002485 Claim No : - Claim Type : Third Party Accident Date : 18/04/2022 Survey Date : 22/04/2022 Survey Report Date : 06/05/2022																																			
2	Particulars Of Vehicle Vehicle Registration No : SNA7584P Make & Model : Toyota Corolla Altis Vehicle Registration Date : 23/02/2016 Chassis No : MR053REH104540578 Engine No : Blocked Colour : Grey																																			
3	Condition Of Vehicle And Tyres <table border="1"><thead><tr><th><u>Mileage (KM)</u></th><th><u>Brakes</u></th><th><u>Steering</u></th><th><u>Modification</u></th></tr></thead><tbody><tr><td>111640</td><td>Serviceable</td><td>Serviceable</td><td>None</td></tr><tr><td colspan="4"> </td></tr><tr><th><u>Tryes</u></th><th><u>Make</u></th><th><u>Size</u></th><th><u>Balance (MM)</u></th></tr><tr><td>Front RHS</td><td>Bridgestone</td><td>215/45R17</td><td>5</td></tr><tr><td>Front LHS</td><td>Bridgestone</td><td>215/45R17</td><td>5</td></tr><tr><td>Rear RHS</td><td>Bridgestone</td><td>215/45R17</td><td>6</td></tr><tr><td>Rear LHS</td><td>Bridgestone</td><td>215/45R17</td><td>6</td></tr></tbody></table>				<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>	111640	Serviceable	Serviceable	None	 				<u>Tryes</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>	Front RHS	Bridgestone	215/45R17	5	Front LHS	Bridgestone	215/45R17	5	Rear RHS	Bridgestone	215/45R17	6	Rear LHS	Bridgestone	215/45R17	6
<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>																																	
111640	Serviceable	Serviceable	None																																	
<u>Tryes</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>																																	
Front RHS	Bridgestone	215/45R17	5																																	
Front LHS	Bridgestone	215/45R17	5																																	
Rear RHS	Bridgestone	215/45R17	6																																	
Rear LHS	Bridgestone	215/45R17	6																																	
4	Description Of Damages The vehicle sustained damages at rear right hand portion. (For information of damages please refer to Parts/Labour/Photographs attached)																																			
5	Instruction This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.																																			

AUTO PERFORMANCE APPRAISAL

Annex A1

Vehicle Assessment Reports

Ref No : 22/002485

Damage And Repair Cost Adjustment

<u>S/No</u>	<u>Qty</u>	<u>Parts Description</u>	<u>Comments/condition</u>	<u>Workshop Estimate (\$)</u>	<u>Our Assessment (\$)</u>
			<u>List Items</u>		
1	1	Rear bumper	Deformed/torn	534.90	534.90
2	1	Rear bumper RH reflector	Broken/smashed	48.70	48.70
3	2	Rear bumper reverse sensor	Broken/malfunction	360.00	360.00
4	2	Rear bumper side retainer	RH broken/LH reuse	208.80	104.40
5	2	Rear bumper corner retainer	RH broken/LH reuse	115.20	57.60
6	1 set	Rear bumper clips	Broken/necessary	40.00	40.00
7	1	Rear bumper inner RH side bracket	Buckled	68.70	68.70
8	1	Rear bumper inner reinforcement	Dented/bent	373.20	373.20
9	1	Rear bumper RH side splash shield	Deformed/broken	58.20	58.20
10	1 set	Rear bumper side splash shield clips	Broken/necessary	30.00	30.00
11	1	RH taillamp	Broken/cracked	367.80	367.80
12	1	RH taillamp panel	Buckled	112.00	112.00
13	1	Rear boot lid	Badly dented/bent	655.50	655.50
14	1	Rear boot centre "TOYOTA" logo	Bent/necessary	52.15	52.15
15	1	Rear boot RH "COROLLA" emblem	Cut/necessary	46.60	46.60
16	1	Rear boot RH "ALTIS" emblem	Cut/necessary	42.70	42.70
17	1	Rear boot RH side lamp	Broken/cut	308.90	308.90
18	1	Rear boot outer chrome handle	Serviceable/reuse	332.98	-
19	1 set	Rear boot inner trim clips	Necessary	60.00	60.00
20	1	Rear boot weatherstrip	Deformed/cut	166.40	166.40
21	1	Rear boot top lock	Bent	382.00	382.00
22	1	Rear boot lower lock catch	Serviceable/reuse	20.40	-
23	1	Rear end panel	Buckled	638.20	638.20
24	1	Rear end panel top garnish	Serviceable/reuse	229.40	-
25	1	Rear spare tyre top board	Broken/deformed	254.30	254.30
26	1	Rear RH fender	Buckled/dented	1,084.90	1,084.90
27	1	Rear RH fender inner side trim	Serviceable/reuse	334.20	-
28	1 set	Rear fender inner side trim clips	Necessary	60.00	60.00
29	1 set	Rear windscreen moulding	Necessary	45.20	45.20
30	1	Rear RH lower exhaust silencer	Dented/bent	820.00	820.00
				7,851.33	6,772.35
Less discount 25%				1,962.83	1,693.09
Total :				5,888.50	5,079.26
			<u>Special Nett Items</u>		
31	1 set	Rear windscreen sealant	Necessary	50.00	50.00
32	1	Rear number plate	Serviceable/reuse	45.00	-

AUTO PERFORMANCE APPRAISAL

Annex A2

Vehicle Assessment Reports

33 1 set Rear end panel sealant

Necessary

50.00

50.00

Total :

145.00

100.00

Total Spare Parts :

6,033.50

5,179.26

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex B

Ref No : 22/002485

Damage And Repair Cost Adjustment

<u>Items</u>	<u>Job Description</u>	<u>Workshop Estimate (\$)</u>	<u>Adjusted Costs (\$)</u>
1	To tow vehicle to workshop.	60.00	60.00
2	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts.	1,500.00	1,100.00
3	To putty and respray painting on affected areas.	1,400.00	1,200.00
4	To check wirings & lightings.	50.00	30.00
5	To remove, refix rear windscreen glass.	150.00	120.00
6	To remove, refix boot lid fittings.	80.00	50.00
7	To remove, refix reverse sensors & reverse camera.	140.00	100.00
8	To remove, refix roof linings, rear seats, carpet and trims.	200.00	150.00
9	To remove, refix rear lower exhaust silencer.	80.00	50.00
10	To supplied and applied anti rust treatments.	120.00	80.00
Total Labour :		3,780.00	2,940.00
Total Spare Parts :		6,033.50	5,179.26
Total Labour :		3,780.00	2,940.00
Total Repair Costs :		9,813.50	8,119.26

Assessor's Recommendation

Repairer Estimate : **9,813.50**
Our Adjustment : **8,119.26**

Remarks

The repairer has agreed to undertake the repair on a lump sum basis of \$6,500.00, with a repair period of 10 working days.



Surveyed By:



Lek Boon Hwee
Automobile Appraiser

APA

Job Reference No : 22/002485

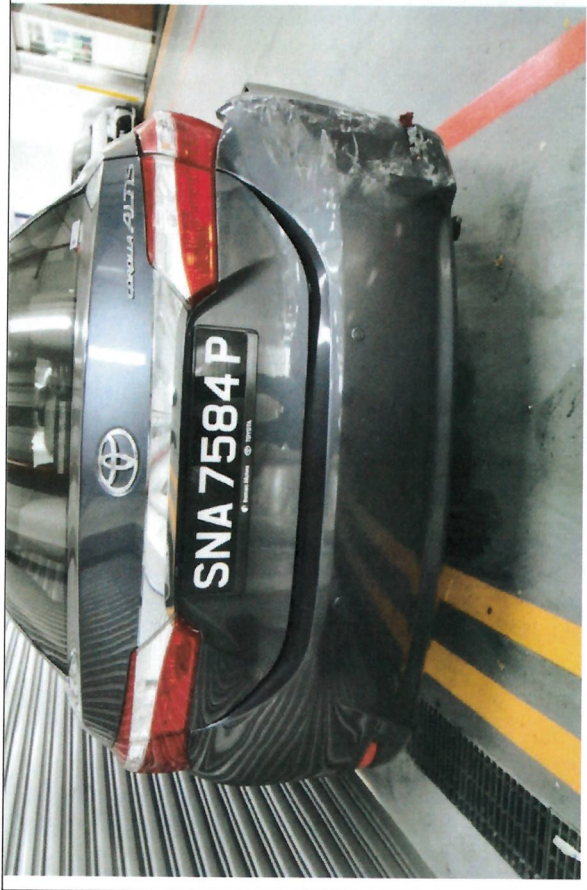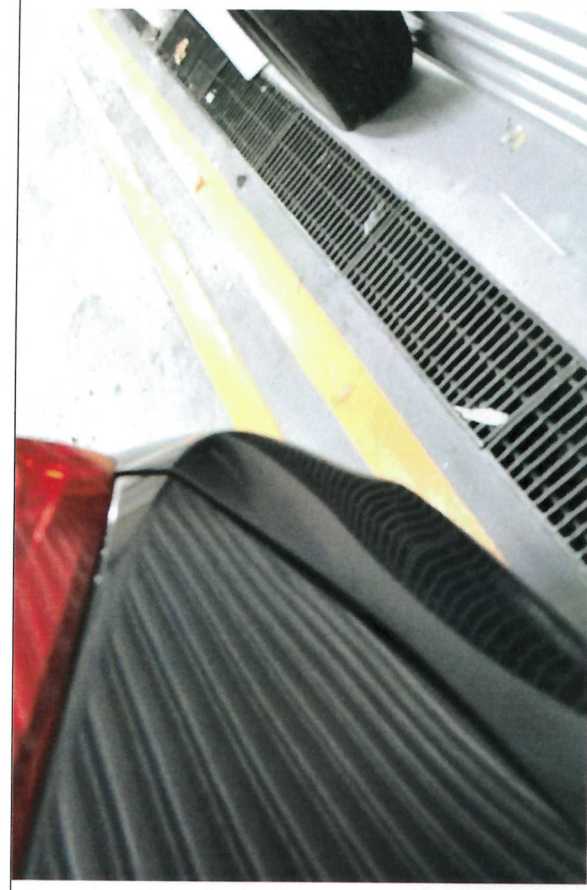

APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485




APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

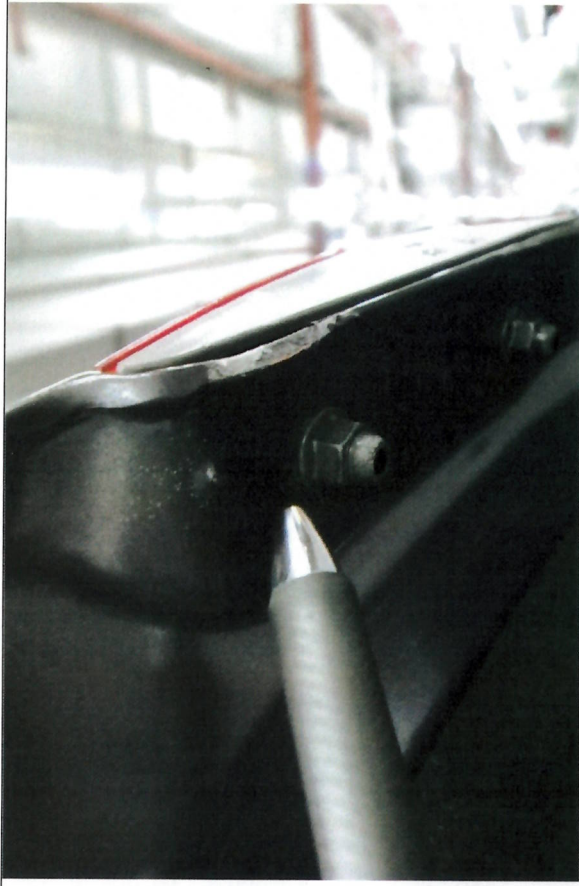


APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

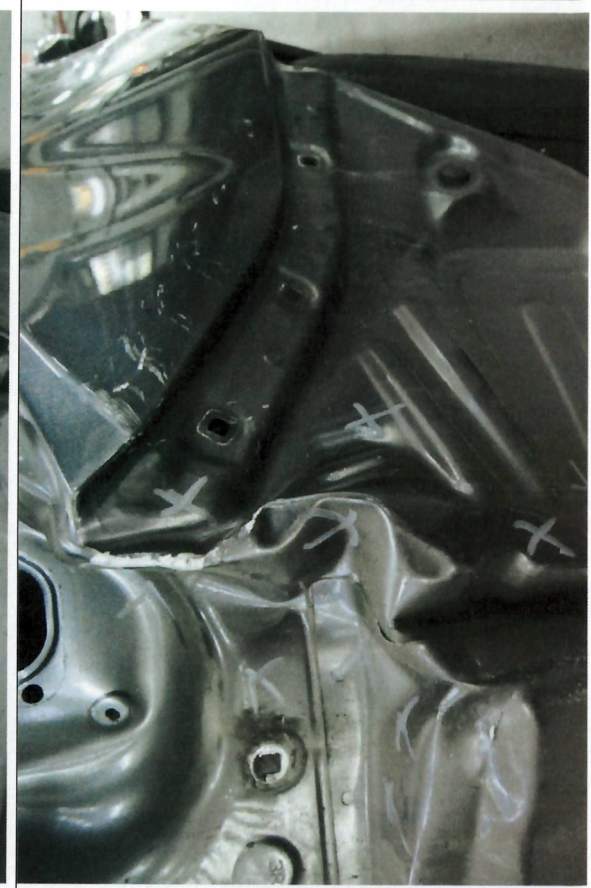

APA

Job Reference No : 22/002485




APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

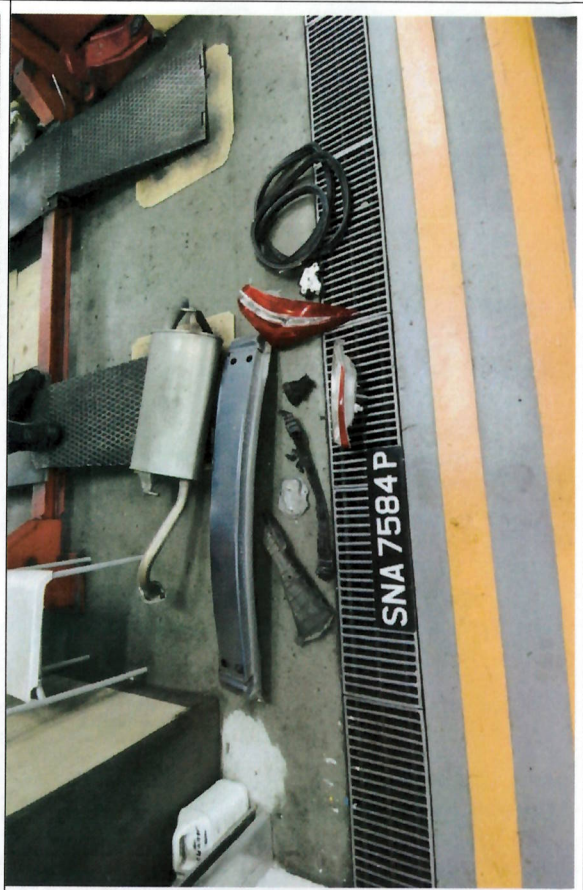


APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

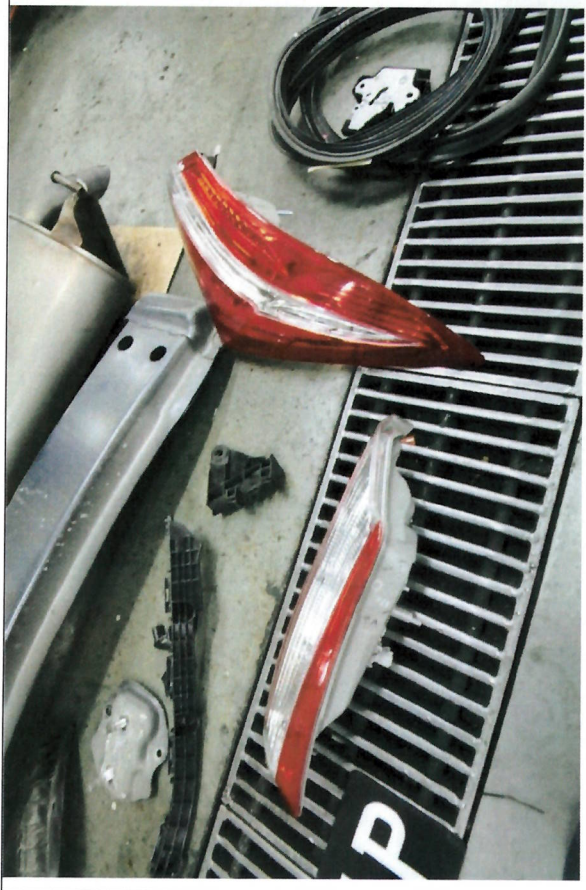

APA

Job Reference No : 22/002485




APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

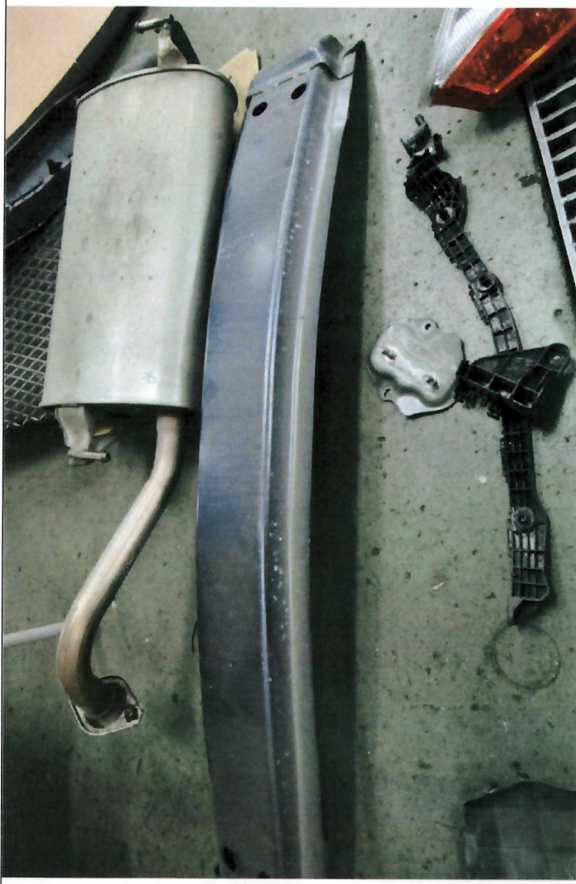

APA

Job Reference No : 22/002485



APA

Job Reference No : 22/002485

