

Appraisal Services

Insurance Loss Adjusters & Licensed Appraisers

Insurance Claim Investigator

Business Address: 60 Arab Street Singapore 199757

Mobile: 98586761 / 96786893 Fax: 62970270

Mailing Address : 161 Alexandra Post Office Singapore 911506

Email: ttajan.stappraisal@gmail.com

Date : 17th May 2022

Our Ref : TP / ATP SFB9892B/ 03.17/22

Your Ref :

Ms Nyo Sock Hiang Jenn
10 Hua Guan Avenue
Hong Kong Park
Singapore 589101

DAMAGED VEHICLE (SFB 9892 B) INSPECTION REPORT (WITHOUT PREJUDICE)

Detailed accounts of our inspection are as follows:

(A) Reference

Name of Claimant	: Ms Nyo Sock Hiang Jenn	Date of Request	: 22 nd Mar 2022
		Referred By	: Insured
Policy No.	: Please Advice	Date of Inspection	: 22 nd Mar 2022
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 17 th Mar 2022	Sum Insured	: NA
Repairer	: M/s AT Performance	Excess Amount	: NA
	160 Sin Ming Drive #07-19	3 rd Party Vehicle	: Please Advice
	Sin Ming Autocity, Singapore 575722	3 rd Party Insurer	: Please Advice

(B) Particulars of Vehicle

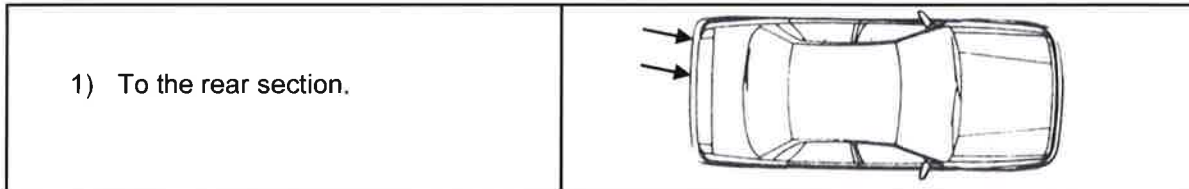
Registration No	: SFB 9892 B	Mileage	: 92811 Km
Make & Model	: MERCEDES BENZ E200	Engine No	: 27492031251474
Date of Registration	: 15 th Jan 2018	Chassis No.	: WDD2130422A344760
Colour	: Silver	Engine Capacity.	: 1,991 cc

(C) Pre-Accident Condition (Static Test Only)

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

(D) Tyre Condition

	Tread Depth	Make	Size
Front Left	60 %	PIRELLI	245/45 R18
Front Right	60 %	PIRELLI	245/45 R18
Rear Left	60 %	PIRELLI	245/45 R18
Rear Right	60 %	PIRELLI	245/45 R18

(E) Point of Impact**(F) General Description of Damages**

The impact of the collision has damaged/affected the boot lid, boot lid lock, rear bumper, rear bumper reinforcement, tail lamp and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken

(G) Recommendation

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$9,750.00** and an estimated **7** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

(H) Remarks

We have not authorised the repairs. However for information, under normal circumstances, the repairs should not exceed **7** days.

This inspection was conducted on a **“without prejudice”** basis.

We are pleased to advice that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services



T T RAJAN
MVI, ITC (Mechanical), NTC (Motor Vehicle)
ASIET, MSAAA, Assessor/Appraiser
AD041-2007532D

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SFB 9892 B

Adjustment of Spare Parts Costs for Repairs

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost
1	1	Boot lid ✓	dented	2421.67	224010	2179.50
2	1	Boot lid logo ✓	necessary	54.00	✓ 10	48.60
3	1	Boot lid badge - E200 ✓	necessary	93.61	✓ 10	84.25
4	1	Boot lid badge - 9G-TRONIC ✓	necessary	97.22	✓ 10	87.50
5	1	Boot lid lock X SVC	malfunction	383.41	10	345.07
6	1	Boot lid outer chrome strip ✓	grazed/cut	253.64	156.710	228.28
7	1	Boot lid rubber seal ✓	cut/damaged	239.45	✓ 10	215.51
8	1	Tail lamp ✓	cracked/split	852.40	78010	767.16
9	1	Tail lamp lower bracket ✓	cracked	45.11	✓ 10	40.60
10	1	Rear bumper ✓	cut/damaged	2011.82	195610	1810.64
11	1	Rear bumper side bracket X SVC	cracked	68.70	10	61.83
12	1	Rear bumper centre support ✓	cracked	131.66	✓ 10	118.49
13	1	Rear bumper lower trim X SVC	torn	372.60	10	335.34
14	1	Rear bumper chrome strip ✓	cracked	323.31	✓ 10	290.98
15	1	Rear bumper reinforcement ✓	dented	841.11	72510	757.00
16	2	Rear bumper sensor ✓	damaged	372.00	✓ 10	334.80
17	6	Rear bumper sensor holder ✓	necessary	25.32	✓ 10	22.79
18	1	Rear bumper reflector ✓	cracked	38.62	✓ 10	34.76
19	1	Rear bumper exhaust tip ✓	dented	422.52	28010	380.27
20	1	Rear end panel X Repair	dented	1604.88	10	1444.39
21	1	Rear end panel garnish ✓	cracked	166.05	✓ 10	149.45
				7724.05		6951.64
Special nett items						
1	1	Rear panel sealant X Repair	necessary	50.00		40.00
2	1	C & C label ✓	necessary	20.00		16.00 ✓
				10889.10		9793.19

Adjustment of Labour Costs for Repairs

To remove and replaced damaged parts including straightening and repositioning replacement parts.	1250.00	1100.00 600
Supply paint material and necessary items. To respray replaced and other affected panels.	1000.00	850.00 600
To remove and refit rear interior fittings/attachments to facilitate repair.	180.00	150.00 60
To check wiring system for proper functions.	120.00	100.00 30
To carry out diagnostic test and reset settings where necessary.	250.00	200.00 X
Total labour	2800.00	2400.00

Adjustment Parts and Labour Costs of Repairs

	Estimated by workshop	Adjusted cost
TOTAL PARTS COSTS	10889.10	9793.19
TOTAL LABOUR COSTS	2800.00	2400.00
TOTAL REPAIR COSTS	13689.10	12193.19
ADJUSTED REPAIR COST		9750.00

8257.6

-20%: 6600

5 Days