

REG BY: Thuan

REF: CS3/LPC210095826/utf3 ✓


ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

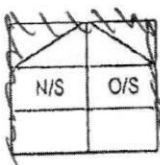

Bal. or Market Value: 4k
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 4 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: FBH2962u Yr Rogn: 7/5/13
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Sym GTS200 c.c. 200
 Colour: black A/C: Insured / Std / NI / NA
 Sp. Reading: not avail T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: RFGLM18WXDS002249
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 110/90 R13
 R: 130/70 R13
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front Rear
 R/Bal. 4 mm R/Bal. 4 mm
 L/Bal. _____ mm L/Bal. _____ mm
 D.O.A. 6/4/21 D.O.I. 10/9/21
 Survey held at equator brotherhood
 Des. of Damages: Fr / Rear / O/S / N/S / UIC / Roof/top or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MV: <u>4k</u>
	rebate: <u>294</u>
	NV: <u>3706</u>
	Err: <u>3k-3.5k</u> SUBMIT PRS REPORT

22/08/2022 Submit L/S \$3,600 ; 4 days (Red \$2,800 / 44%)

Date/Time. File Pass to? ☐ : Prel. Report
☐ : Final Report

Date/Time. File Return to? _____

Request Form: _____

Letter: _____

Days Of Repair: 4
 Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Wash and _____

Survey Fee:

Transportation:

\$ + P.S. \$ _____

Prints

Notes

**Advanced Automotive Consultancy Pte Ltd**

Business Regn No: 201416413W

ACCIDENT VEHICLE INSPECTION / ASSESSMENT REPORT

1 REFERENCE			
Our reference no	:	TP/FBH2962U/EB/0921/14	
Date of request	:	13-Sep-2021	
Date of survey	:	13-Sep-2021	
Date of accident	:	6-Sep-2021	
Requested by	:	TOH JIA JUN	
	:	C/o , Blk 25 Kaki Bukit Rd 4 Synergy@KB, #03-79.Singapore 417800	
Type of claim	:	Third party	
Workshop	:	EQUATOR BROTHERHOOD	
	:	Blk 25, Kaki Bukit Rd 4 Synergy@KB, #03-79	
	:	Singapore 417800	
2 DETAILS OF VEHICLE			
Registration No.	:	FBH2962U	
Make & Model	:	SYM GTS200	
Date of registration	:	7-May-2013	
Engine No.	:	KB613302	
Engine Capacity	:	172CC	
Chassis No.	:	RFGLM18WXDS002249	
Speedometer reading	:	-	
Colour	:	BLACK	
3 STATIC CHECK			
Steering	:	Affected	Paintwork : Good
Footbrake	:	In order	Modification : Nil
Handbrake	:	In order	General condition : Good
4 TYRE CONDITION			
		<u>Nearside/Make</u>	<u>Size</u>
Front tyre	:	3mm/METZELER	110/90-13
Rear tyre	:	3mm/MICHELIN	130/70-12
5 POINT OF IMPACT			
The said vehicle has sustained an impact damages on the front, rear, left and right portion. Kindly refer to the attached photographs for more detail of the damages.			
6 REMARK			
This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis and we have not authorised any repair.			

Advanced Automotive Consultancy Pte Ltd

Annex A : Assesement / Adjustment on Spare Parts

TP/FBH2962U/EB/0921/14

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)
List Items						
1	SYM front suspension (left)	distorted/shifted/grazed	1	\$400.00	10%	\$360.00 ✓
2	SYM front suspension (right)	distorted/shifted	1	\$400.00	10%	\$360.00 ✓
3	SYM triple clamp (bottom)	distorted	1	\$350.00	10%	\$315.00 X SVC
4	SYM handle bar	distorted	1	\$150.00	10%	\$135.00
5	SYM steering cone bearing	necessary	1	\$120.00	10%	\$108.00
6	SYM front headlight	broken/mising	1	\$380.00	10%	\$342.00
7	SYM front headlight bracket	distorted	1	\$80.00	10%	\$72.00 X SVC
8	SYM front headlight wiring harness	repair	1	\$110.00	100%	\$0.00
9	SYM front wheel rim	warped/repair	1	\$380.00	100%	\$0.00
10	SYM front wheel seal	necessary	2	\$30.00	10%	\$27.00 X NN
11	SYM front wheel bearing	rattle	2	\$70.00	10%	\$63.00 X NN
12	SYM front wheel shaft	repair	1	\$50.00	100%	\$0.00
13	SYM front signal light (left)	cracked	1	\$100.00	10%	\$90.00 X NN
14	SYM front signal light (right)	cracked	1	\$100.00	10%	\$90.00
15	SYM mirror (left)	cracked/grazed	1	\$140.00 10%		\$126.00
16	SYM mirror (right)	grazed	1	\$140.00	10%	\$126.00 X NN
17	SYM front head cowl fairing (upper)	distorted/scratched	1	\$120.00	10%	\$108.00
18	SYM front head cowl fairing (lower)	broken	1	\$380.00	10%	\$342.00
19	SYM front mudguard fairing	grazed	1	\$180.00	10%	\$162.00
20	SYM front brake disc	warped/repair	1	\$140.00	100%	\$0.00
21	SYM front brake hose	cut	1	\$35.00	10%	\$31.50
22	SYM front brake master cylinder (left)	grazed	1	\$220.00	10%	\$198.00 X SVC
23	SYM front windshield	broken	1	\$220.00	10%	\$198.00
24	SYM side fairing belly pen (left)	cracked/dislodged	1	\$110.00	10%	\$99.00 X SVC
25	SYM side fairing belly pen (right)	grazed/cracked	1	\$110.00	10%	\$99.00 X SVC
26	SYM floorboard (left)	cracked	1	\$110.00	10%	\$99.00
27	SYM floorboard (right)	grazed/deformed	1	\$110.00	10%	\$99.00 X SVC
28	SYM floorboard step rubbers set (small)	missing(left)	1	\$40.00	10%	\$36.00
29	SYM floorboard step rubbers set (big)	missing (left)	1	\$60.00	10%	\$54.00
30	SYM legshield (center - compartment panel)	grazed/cracked	1	\$250.00	10%	\$225.00 X NN
31	SYM legshield (center - compartment panel cover)	grazed	1	\$45.00	10%	\$40.50
32	SYM left side middle fairing- (silver)	missing	1	\$80.00	10%	\$72.00
33	SYM rear side fairing (left)	cracked/grazed	1	\$280.00	10%	\$252.00
34	SYM rear side fairing (right)	repair/scratched/spray	1	\$280.00	100%	\$0.00
35	SYM rear side fairing protectors	grazed	2	\$70.00	10%	\$63.00 ✓
36	SYM rear tail light	broken	1	\$295.00 10%		\$265.50
37	SYM rear number plate holder	broken	1	\$95.00	10%	\$85.50
38	SYM rear number plate light assembly	cracked	1	\$80.00	10%	\$72.00

TP/FBH2962U/EB/0921/14

Item	Vehicle Parts Description	Condition	Qty	W/shop Est. (\$)	Disc (%)	Adjusted Cost (\$)
39	SYM rear number plate reflector	scratched	1	\$25.00	10%	\$22.50
40	SYM rear box rack	broken	1	\$280.00	10%	\$252.00
41	SYM rear box rack bracket	bent	1	\$60.00	10%	\$54.00
42	SYM bar end set	grazed/missing	1	\$90.00	10%	\$81.00
43	SYM pillion footrests	grazed	2	\$110.00	10%	\$99.00
44	SYM pillion footrest pins	necessary	2	\$20.00	10%	\$18.00
45	SYM pillion footrest bearings	necessary	2	\$20.00	10%	\$18.00
46	SYM exhaust muffle	dented	1	\$750.00	10%	\$675.00
47	SYM exhaust cover (big)	grazed	1	\$75.00	10%	\$67.50
48	SYM exhaust cover (small)	grazed	1	\$50.00	10%	\$45.00
49	SYM exhaust gasket	necessary	1	\$15.00	10%	\$13.50
50	SYM brake lever-(right)	grazed	1	\$45.00	10%	\$40.50
51	SYM air box cover (upper)	grazed	1	\$85.00	10%	\$76.50
52	SYM belly pen (under cover)	broken	1	\$125.00	10%	\$112.50
				\$8,060.00		\$6,390.00

S/Nett Items

1	LiquiMoly front brake fluid	necessary	1	\$15.00		\$15.00
2	Front number plate	necessary	1	\$15.00		\$15.00
3	Rear number plate	bent	1	\$20.00		\$20.00
4	Handphone holder-(left)	broken	1	\$50.00		\$0.00
				\$100.00		\$50.00

Total for Spare Parts : \$8,160.00 \$6,440.00

Advanced Automotive Consultancy Pte Ltd

Annex B : Adjustment on Labour and Spray Painting

TP/FBH2962U/EB/0921/14

Item	Job Description	Workshop Est. (\$)	Adjusted Cost (\$)	
1	To remove & replace front rim, front wheel bearing, axle shaft, tripple clamps, front fork, steering cone, front brake disc.	\$300.00	\$200.00	} 450
2	To remove & replace above body damaged parts, check wiring & lighting system	\$650.00	\$550.00	
3	To respray paint on the affected area.	\$400.00	\$300.00	200
4	To conduct chassis alignment	\$550.00	\$450.00	150
5	Towing -workshop to accident reporting center	\$60.00	\$60.00	} 60 (2x)
6	Towing -accident reporting center to workshop	\$60.00	\$60.00	
		\$2,020.00	\$1,620.00	
TOTAL FOR LABOUR & SPRAY PAINTING :		\$2,020.00	\$1,620.00	

Summary

	Workshop Est. (\$)	Adjusted Cost (\$)	
TOTAL FOR SPARE PARTS :	\$8,160.00	\$6,440.00	
TOTAL FOR LABOUR & SPRAY PAINTING :	\$2,020.00	\$1,620.00	
TOTAL REPAIR COSTS :	\$10,180.00	\$8,060.00	5 days

* Repair limit \$3,700.

Advanced Automotive Consultancy Pte Ltd

TP/FBH2962U/EB/0921/14

Annex C: Recommendation

We have inspected thoroughly the actual damages found on the vehicle and our assessment is appended in the Annex(es) attached. The condition and age of the vehicle was considered before we reached our recommendation as to whether the parts need replacement or repair.

M/S Equator Brotherhood estimated repair cost is **S\$10,180.00** and we have adjusted it to **S\$8,060.00** on a part by part basis. However, taking into consideration the age of the vehicle and the availability of used/recondition components. We, therefore recommend a contract lump sum repair cost.


The repairer have agreed to undertake the repairs on a contract lump sum of **S\$6,400.00**, according to acceptable quality and standard. (Repairer discretion to repair parts, to replace with old parts, or to replace with OEM or genuine parts).

The entire repair of the damaged vehicle should be completed within a reasonable period of 7 working days.

We have advised the repairer that the inspection was conducted strictly on a WITHOUT PREJUDICE basis and we have not given any instruction and authorisation to proceed with the repair of the vehicle.

We are reverting the matter to you for your discretion and enclosed is our invoice for service rendered.

Yours faithfully,

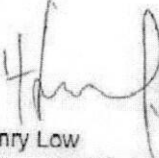
Henry Low
Automotive License Appraiser
CMTM, DMTM, IPTM (UNF)

