



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2208035

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 30/12/2022
Reference CC6/CTI22007842/Kpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 8435H
Insured Veh. GBK 9756L
Claim No. SNM22D205708/C02
Policy No. DMCVSNW00018952200
Accident Date 14/08/2022
Inspection Date 16/08/2022

Description	Total
Survey Inspection	280.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	280.00
GST (7%)	19.60
Grand Total	299.60

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22007842/Kpa3q2 Date: 30/12/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBK 9756L	Veh. Inspected	SMQ 8435H	
Policy No.	DMCVSNW00018952200	Coverage (\$)	0.00	
Claim No.	SNM22D205708/C02	Excess (\$)	0.00	
Assign From		Assign Date	16/08/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA ALPHARD (A)	c.c	2493	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	AYH300089381	Colour	METALLIC BLACK	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 R18	TRIANGLE	8 mm	
L/H Front Tyre	225/45 R18	TRIANGLE	8 mm	
R/H Rear Tyre	225/45 R18	TRIANGLE	8 mm	
L/H Rear Tyre	225/45 R18	TRIANGLE	8 mm	
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION AND REAR WINDSCREEN SHATTERED . DAMAGES SEE DETAILS.			
5. General Information				
Accident Date	14/08/2022	Inspection Date	16/08/2022	
Survey held at	LM AUTO SOLUTION PTE LTD Blk 10 Sin Ming Industrial Estate Sector C #01-12 Singapore 575645			
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 8435H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAIL GATE	BENT	2,264.80	2,040.50
1	TAIL GATE GLASS	SHATTERED	1,455.00	1,301.00
1	TAIL GATE GLASS MOULDING	NECESSARY	223.60	223.60
1	TAIL GATE CHROME	CRACKED	863.90	785.10
2	TAIL GATE LAMP LH +RH	O/S CRACKED	2,256.60	1,051.20
1	TAIL GATE CAMERA	SERVICEABLE	679.20	-
1	TAIL GATE OPENER SENSOR SWITCH	SERVICEABLE	186.50	-
1	TAIL GATE LOCK WITH MOTOR	SERVICEABLE	846.50	-
1	TAIL GATE EMBLEM -ALPHARD	NECESSARY	121.30	121.30
1	TAIL GATE EMBLEM -HYBRID	NECESSARY	92.60	92.60
1	TAIL GATE EMBLEM -E FOUR	NECESSARY	84.10	84.10
1	TAIL GATE INNER TRIM	SERVICEABLE	778.50	-
1	TAIL GATE UPPER TRIM	SERVICEABLE	326.40	-
2	TAIL GATE SIDE TRIM LH+RH	N/S CUT	466.80	233.40
1	REAR BUMPER	BUCKLED / MTG CRACKED	2,288.30	1,605.00
2	REAR BUMPER RETAINER LH +RH	O/S DISTORTED	331.20	165.60
2	REAR BUMPER BRACKET LH+RH	TO REPAIR SEE LABOUR	345.80	-
2	REAR BUMPER REFLECTOR LH+RH	SERVICEABLE	329.60	-
1	REAR BUMPER TOWING CAP	SERVICEABLE	117.40	-
1	SET REAR BUMPER CLIP	NECESSARY	50.00	50.00
4	REAR BUMPER SENSOR	SERVICEABLE	1,963.20	-
1	REAR BUMPER SENSOR WIRE	SERVICEABLE	191.30	-
2	TAIL LAMP LH+RH	O/S CUT / N/S SERVICEABLE	1,865.80	932.90
2	TAIL LAMP LOWER GARNISH LH+RH	SERVICEABLE	615.80	-
4	TAIL LAMP CLIP LH+RH	NOT NECESSARY	40.00	-
1	REAR END PANEL	BENT	827.60	781.70
1	REAR END PANEL SENSOR	SERVICEABLE	165.30	-
1	REAR END PANEL TOP GARNISH	MTG CRACKED	197.50	197.50

Report Ref No. CC6/CTI22007842/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FENDER RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	REAR FENDER INNER TRIM RH	SERVICEABLE	2,144.30	-
	LESS 25% DISCOUNT		-5,529.73	-2,416.38
			16,589.17	7,249.12
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER LOWER SPOILER ASSY (SN)	NOT NECESSARY	2,800.00	-
			2,800.00	-
	<u>LABOUR</u>			
	TO KNOCK ,STRAIGHTEN AND REALIGN ACCIDENT AFFECTED AREA .INCLUSIVE OF THE REPAIR OF REAR BUMPER BRACKET LH+RH AND REAR FENDER RH.		1,400.00	600.00
	TO PUTTY AND RESPRAY ACCIDENT AFFECTED AREA .		1,000.00	800.00
	TO RUST PROOF ACCIDENT AFFECTED AREA .		120.00	60.00
	TO R&R TAIL GATE GLASS .		120.00	120.00
	TO R&R TAIL GATE MECHANISM.		180.00	60.00
	TO R&R REAR LUGGAGE COMPARTMENT UPHOLSTERY .		300.00	60.00
	TO R&R REVERSE SENSOR ,CAMERA AND CHECK FUNCTION .		120.00	70.00
			3,240.00	1,770.00
GRAND TOTAL			22,629.17	9,019.12
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				7,200.00

Report Ref No. CC6/CTI22007842/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 8435H

INSPECTION

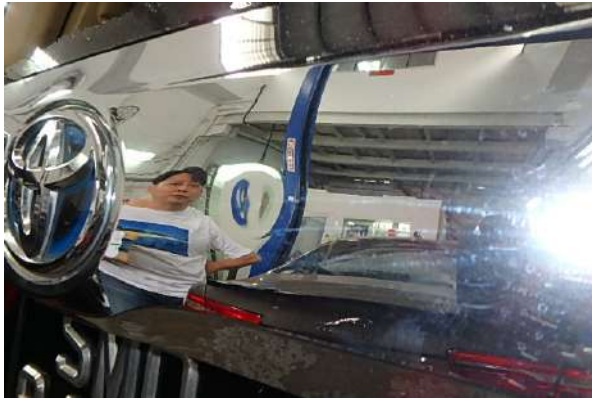



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 8435H

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 8435H

RE-INSPECTION

