



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302267

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 13/04/2023
Reference CC6/CTI22007856/Aya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKX 9729R
Insured Veh. GBH 9370G
Claim No. SNM22D205758/C02
Policy No. DMCVSNW00122042101
Accident Date 11/08/2022
Inspection Date 15/08/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC6/CTI22007856/Aya3q2
3 ANSON ROAD #16-00			Date:	13/04/2023
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBH 9370G	Veh. Inspected	SKX 9729R	
Policy No.	DMCVSNW00122042101	Coverage (\$)	0.00	
Claim No.	SNM22D205758/C02	Excess (\$)	0.00	
Assign From		Assign Date	15/08/2022	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	RU11103966	Colour	SILVER	
Odometer	158136 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	DUNLOP	6 mm	
L/H Front Tyre	215/60 R16	DUNLOP	6 mm	
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	11/08/2022	Inspection Date	15/08/2022	
Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKX 9729R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR TAILGATE	DENTED	956.00	956.00
1	REAR TAILGATE LOCK	DAMAGED	185.00	185.00
1	REAR TAILGATE LOCK DETECTOR	NOT NECESSARY	326.00	-
1	REAR TAILGATE LOCK CATCH	NOT NECESSARY	45.00	-
1	REAR TAILGATE OUTER GARNISH	CRACKED	421.00	325.00
1	REAR TAILGATE EMBLEM LOGO	NECESSARY	58.00	58.00
1	REAR TAILGATE EMBLEM VEZEL	NECESSARY	56.00	56.00
2	REAR TAILGATE SIDE LAMP @\$321.00	N/S CUT	642.00	321.00
2	REAR TAILGATE NUMBER PLATE LAMP @\$38.00	NOT NECESSARY	76.00	-
1	REAR TAILGATE INNER TRIM BOARD	CRACKED	358.00	268.00
1	REAR TAILGATE WINDSCREEN GLASS	NOT NECESSARY	1,125.00	-
1	REAR TAILGATE WINDSCREEN GLASS MOULDING	NECESSARY	168.00	168.00
1	REAR TAILGATE INNER HANDLER	NOT NECESSARY	69.00	-
1	REAR BUMPER	DEFORMED	538.00	538.00
2	REAR BUMPER SIDE @\$228.00	N/S TORN	456.00	195.00
2	REAR BUMPER REFLECTOR @\$141.00	N/S CRACKED	282.00	141.00
2	REAR BUMPER SIDE RETAINER @\$55.00	NECESSARY	110.00	110.00
1	REAR BUMPER UNDER COVER	DEFORMED	236.00	236.00
2	REAR TAILLAMP @\$468.00	N/S CUT	936.00	468.00
2	REAR TAILLAMP LOWER BRACKET @\$35.00	NOT NECESSARY	70.00	-
2	REAR TAILLAMP INNER PANEL @\$215.00	TO REPAIR SEE LABOUR	430.00	-
1	REAR WEATHER STRIPE	CUT	191.00	191.00
1	REAR END PANEL	DENTED	585.00	585.00
1	REAR END PANEL TOP GARNISH	CRACKED	189.00	189.00
1	REAR KEYLESS SENSOR	NOT NECESSARY	285.00	-
1	REAR KEYLESS BUZZER	DAMAGED	212.00	98.00
1	REAR SPARE TYRE COMPARTMENT PANEL	TO REPAIR SEE LABOUR	817.00	-
1	REAR SPARE TYRE COMPARTMENT TOP BOARD	DEFORMED	245.00	245.00
1	REAR TOOLS GARNISH	NOT NECESSARY	165.00	-

Report Ref No. CC6/CTI22007856/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TOOLS SPONGE	NOT NECESSARY	258.00	-
2	REAR FENDER INNER TRIM @\$345.00	N/S DEFORMED	690.00	345.00
	LESS 20% DISCOUNT		-2,236.00	-1,135.60
			8,944.00	4,542.40
	<u>SPECIAL NETT ITEMS</u>			
1	REAR BUMPER CLIPS (SN)	NECESSARY	80.00	30.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	80.00	60.00
1	REAR TAILGATE OUTER GARNISH CLIPS (SN)	NOT NECESSARY	40.00	-
1	REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	30.00
2	REAR FENDER INNER TRIM CLIPS @\$40.00 (SN)	NECESSARY	80.00	30.00
2	REAR FENDER OUTER GARNISH CLIPS @\$30.00 (SN)	NOT NECESSARY	60.00	-
1	REAR TAILGATE WINDSCREEN GLASS SEALANT (SN)	NECESSARY	120.00	60.00
1	REAR REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	REAR REVERSE CAMERA (SN)	DAMAGED	380.00	380.00
1	REAR RUBBER MAT (SN)	NOT NECESSARY	280.00	-
1	REAR SPARE TYRE COMPARTMENT INSULATOR (SN)	NOT NECESSARY	300.00	-
1	REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	60.00	-
			1,810.00	790.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE COMPARTMENT PANEL AND REAR TAILLAMP INNER PANEL .		1,400.00	800.00
	LABOUR FOR SPRAYPAINTING.		1,200.00	800.00
	WIRING CHECK.		80.00	30.00
	TO APPLY RUST PROOF /TUFF COAT ON ACCDIENT AREAS .		300.00	60.00
	LABOUR FOR REMOVE & TRANSFER REAR TAILGATE WINDSCREEN GLASS .		150.00	120.00
	LABOUR FOR REMOVE & TRANSFER ALL REAR TAILGATE FITTING.		300.00	80.00
	TO REMOVE REVERSE SENSOR AND REAR CAMERA.		200.00	100.00
	TO REMOVE UPHOLSTERY .		150.00	80.00
			3,780.00	2,070.00
GRAND TOTAL			14,534.00	7,402.40

Report Ref No. CC6/CTI22007856/Aya3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,900.00
---	--	--	----------

Report Ref No. CC6/CTI22007856/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKX 9729R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKX 9729R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

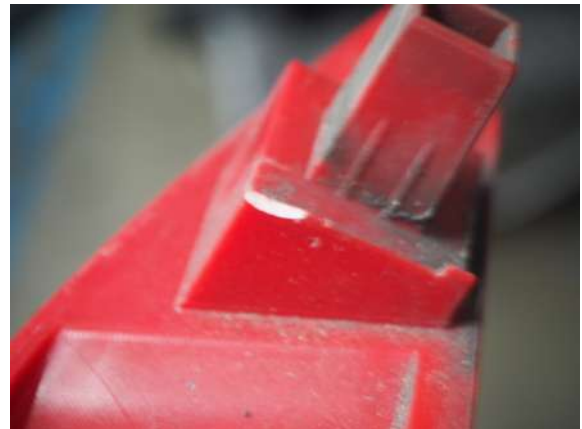




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

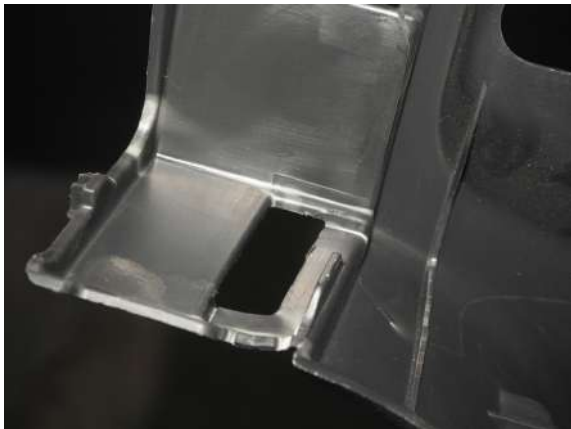



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

