



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MINISTRY OF DEFENCE
HQ TRANSPORT COMMAND
KRANJI CAMP 3
151 CHOA CHU KANG WAYSINGAPORE 688248

Ref: CC2/MIDA22008047/Upq2

Date: 09/09/2022

Code: MIDA

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	MID 21576	Veh. Inspected	SLV 9610Y
Policy No.	OA22019304	Coverage (\$)	0.00
Claim No.	CY22/MID21576/120822/0028	Excess (\$)	0.00
Assign From		Assign Date	23/08/2022

2. Vehicle Particulars & Condition

Make & Model	TOYOTA WISH (A)	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JTDGG20W70J008519	Colour	SILVER
Odometer	116203 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	FALKEN	6 mm
L/H Front Tyre	195/65 R15	FALKEN	6 mm
R/H Rear Tyre	195/65 R15	FALKEN	6 mm
L/H Rear Tyre	195/65 R15	FALKEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	12/08/2022	Inspection Date	19/08/2022
Survey held at	CONVERGENCE AUTOMOTIVE PTE LTD 39 WOODLANDS CLOSE, #01-24, MEGA@WOODLANDS SINGAPORE 737856		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
C)FOR MANDATE ONLY.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLV 9610Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DISTORTED	1,016.40	586.21
1	REAR BUMPER SIDE RETAINER (O/S)	BENT	98.60	98.60
1	REAR BUMPER DAMPER	NOT NECESSARY	87.10	-
1	REAR BUMPER REFLECTOR	NOT NECESSARY	151.50	-
1	REAR REINFORCEMENT	NO SUCH PARTS	550.80	-
1	REAR END PANEL	NOT NECESSARY	519.80	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	369.00	-
1	TAILLAMP (RH)	SCRATCHED	592.00	566.10
1	TAILLAMP LOWER BRACKET (RH)	NOT NECESSARY	93.80	-
1	REAR FENDER (RH)	BADLY DENTED	1,121.35	1,121.35
1	REAR FENDER GLASS RH	NECESSARY	408.10	408.10
1	REAR DOOR (RH) (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 25% DISCOUNT		-1,252.11	-695.09
			3,756.34	2,085.27
<u>SPECIAL NETT ITEMS</u>				
1	SUNDRIES (SN)	NOT NECESSARY	60.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	60.00	50.00
1	REAR FENDER GLASS SEALANT RH (SN)	NECESSARY	100.00	40.00
1	SET TAILLAMP CLIPS (SN)	NOT NECESSARY	60.00	-
1	TAILLAMP SEAL (SN)	NOT NECESSARY	100.00	-
1	REAR ALLOY RIM (RH)(SN)	NOT NECESSARY	800.00	-
1	REAR TIRE (RH) (SN)	NOT NECESSARY	300.00	-
			1,510.00	90.00
<u>LABOUR</u>				
	CHECK WIRING SYSTEM AFTER DISCONNECT AND CONNECT .		100.00	20.00
	TO APPLY UNDERCOATING & RUST PROOFING.		200.00	40.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR DOOR (RH).		1,500.00	800.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	SPRAY PAINTING.		1,200.00	850.00
			3,000.00	1,710.00
	GRAND TOTAL		8,266.34	3,885.27
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (FOR MANDATE ONLY)				3,100.00

Report Ref No. CC2/MIDA22008047/Upq2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 9610Y

INSPECTION

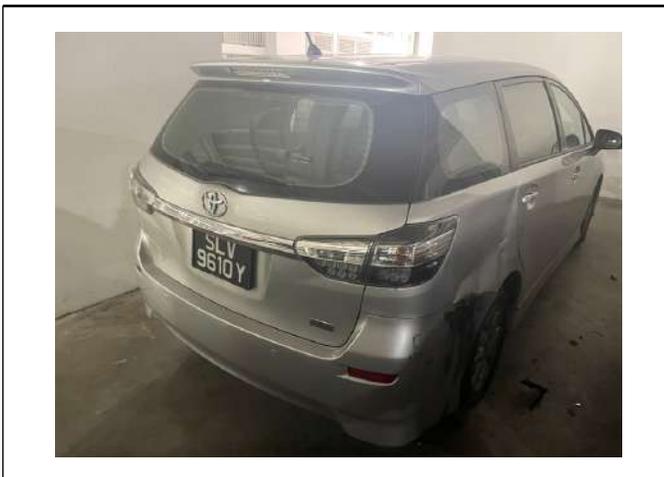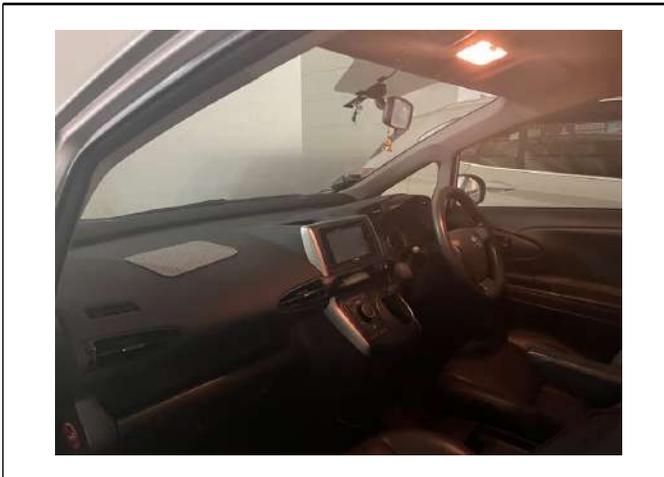







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

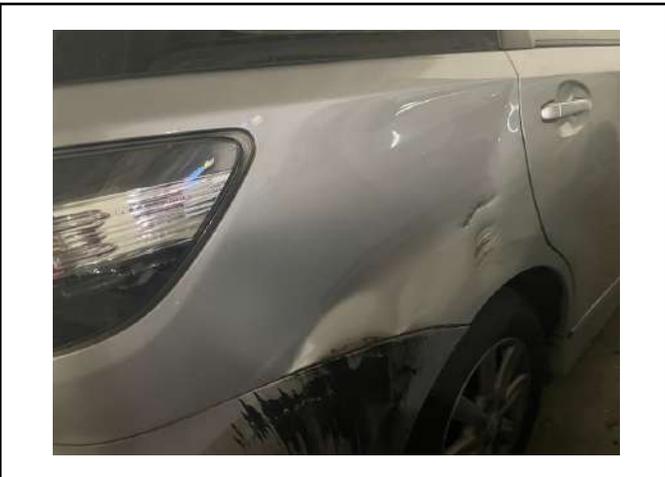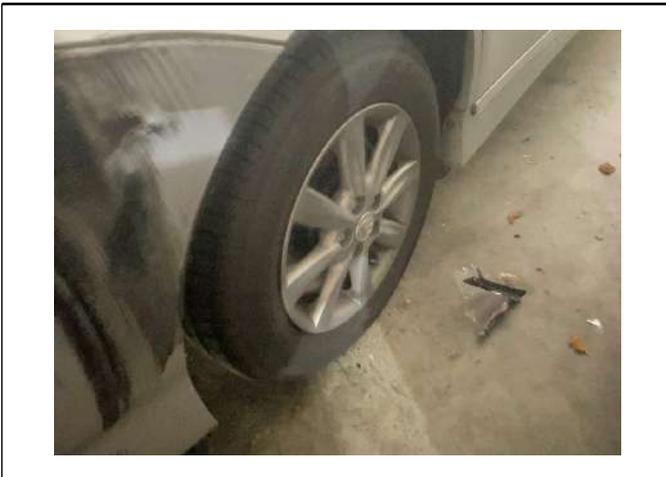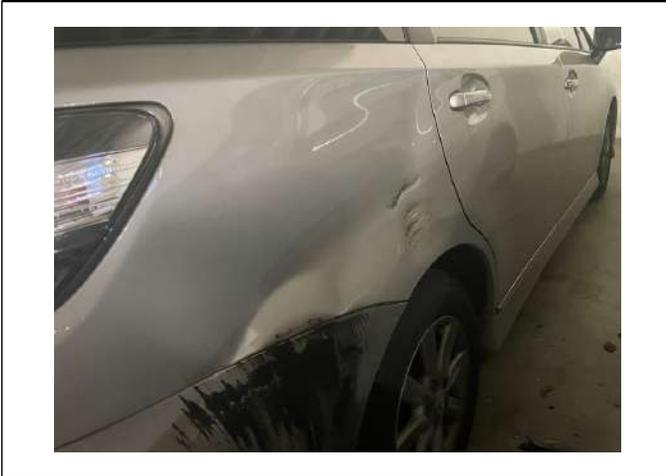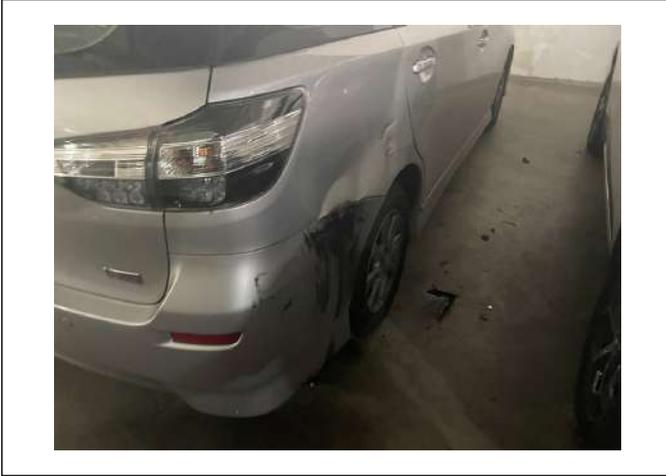



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 9610Y

RE-INSPECTION

