

ASS. REC. BY:

REF:

C12/ 220099671Kc

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

1-B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

YQ 51P4E

Yr Regn:

11, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Dyna

c.c

2754

Colour

White

A/C: Insured / Std / NI / NA

Sp. Reading

39093

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JHHAAGV46X OK 001184

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

175/75R15

R:

145/80R13 #201

SS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI/

TOYO/YOKO or

Front

Rear

R/Bal.

3

mm

R/Bal.

9 9

mm

L/Bal.

1

mm

L/Bal.

9 9

mm

D.O.A.

2/10/22

D.O.I.

11/10/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

10/10 Not ready for survey.

Date/Time, File Pass to?

☐

Prel. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation

S + RS. SI

Fees

Others

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech Invs (\$)

☐

Weekend (\$)

TOTAL

Report Format:

Lump Sum / I.B.I: (\$)

YQ 9194E
OD/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun
Industrial Park A
768761

Insurer Reference: YQ5194E
Repairer Reference: A0457
Date calculated: 07/10/2022 4:47 PM

Full Report
Registration: YQ5194E
Printed: 07/10/2022 4:47 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance
Printed by:	CHENG HOE	Currency:	(Singapore) Pte Ltd
Claim Reference:	YQ5194E	Date of Incident:	SGD
Estimated Repair Time:		Hire Car Start:	02/10/22
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	TOYOTA		
Model:	DYNA		
Sub Model:	150		
Model Sheet Number:	70 1N 03		
Registration:	YQ5194E		
VIN number:	JHHAGV46X0K001184		
Odometer:			
Model Specs			
AIR CONDITIONING	FROM 11.2017	SINGLE CAB	3.0 LTR 80KW
5-SPEED	ANTI LOCK BRAKES	PARTS ORIGIN JAPAN	TWO COAT METALLIC
PREPARE OFF VEHICLE			

*Not Authorised
Repair B & Pain
Ex \$1000*

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	R/F LOWER END PANEL SURFACE PAINT	4.0	
	FRONT PANEL SURFACE PAINT	5.0	
	FRONT FLOOR PANEL SURFACE PAINT	8.0	
	L/F FLOOR SIDE PANEL SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0281	FRONT BUMPER NEW PART PAINTING	27.86
0293	L/F BUMPER BRACKET NEW PART PAINTING	1.55
0294	R/F BUMPER BRACKET NEW PART PAINTING	1.55
0413	COMPL LWR FRT PANEL NEW PART PAINTING	41.25
0418	UPPER FRONT PANEL NEW PART PAINTING	10.32
0889	L/F LOWER END PANEL NEW PART PAINTING	1.55
1481	LEFT FRONT DOOR NEW PART PAINTING	45.92
0411	GRILLE NEW PART PAINT K1R	11.81
0911	L/OUTER A-PILLAR REPAIR PAINTING >50%	13.83
0890	R/F LOWER END PANEL SURFACE PAINT	0.75
0931	FRONT PANEL SURFACE PAINT	4.98
2296	FRONT FLOOR PANEL SURFACE PAINT	19.92
2301	L/F FLOOR SIDE PANEL SURFACE PAINT	3.49

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			125.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	15.50	155.0	651.00

Material Cost - Paint

	Price SGD
New Part Painting	130.00
New Part Painting - Plastic K1R	11.81
Repair Painting	13.83
Surface-/Blend Paint	29.14
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	222.38

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0481	BADGE	75315 37080	Original		40.00
0485	BADGE MODEL	75311 25100	Original		0.00
0424	CLIP FASTENING	90467 W0009	Original		24.00
0413	COMPL LWR FRT PANEL	55700 37350	Original		500.00
3887	COMPR/CONDENSER	88711 25490	Original		185.00
3883	TUBE	88712 25820	Original		190.00
	COMPR/EVAP TUBE				

Code	Description	Part Number	Part Source	Price SGD	
1007	DYNA STICKER	PARTS	Original	35.00	✓
4453	EVAPORATOR	88501 37110	Original	1,650.00	?
0281	FRONT BUMPER	52101 37985	Original	240.00	✓
1000	GLOVEBOX ATTACHMENT	PARTS	Original	80.00	?
2602	GLOVEBOX LID	55501 37030C0	Original	180.00	?
0411	GRILLE	53111 37A01A0	Original	260.00	✓
4415	HEATER BLOWER CPL	87210 37100	Original	180.00	?
4331	INSTRUMENT PANEL	55301 37090C0	Original	480.00	?
2560	INSTRUMENT SUPPORT	55330 37210	Original	480.00	?
2551	INSTRUMENT TRIM	55411 25021B1	Original	160.00	?
1745	L/COWL PANEL COVER	67496 37010	Original	50.00	✓
1737	L/DOOR MIRROR ASSY	87940 37E92	Original	245.00	✓
0293	L/F BUMPER BRACKET	52012 37070	Original	110.00	✓
1519	L/F DOOR WINDOW	68102 37120	Original	200.00	?
0889	L/F LOWER END PANEL	53814 37100A0	Original	130.00	?
0563	L/HEADLAMP TRIM	81193 37050	Original	28.00	X
1577	L/INN DOOR LOCK	69320 37060	Original	130.00	✓
1481	LEFT FRONT DOOR	67002 37322	Original	580.00	?
0561	LEFT HEADLAMP ASSY	81170 37660	Original	320.00	✓
0294	R/F BUMPER BRACKET	52011 37070	Original	110.00	?
0564	R/HEADLAMP TRIM	81193 37050	Original	28.00	X
0562	RIGHT HEADLAMP ASSY	81130 37660	Original	320.00	✓
0418	UPPER FRONT PANEL	55078 37110	Original	115.00	✓
1411	WINDSCREEN BOND KIT	PZ49I 00C1131	Original	0.00	X
1410	WINDSCREEN SEAL	56121 25040	Original	95.00	✓
f: OEM Parts					
n: Non-OEM Parts					
u: Used parts					
Savings					
Subtotal				0.00	
Total				7,145.00	
				7,145.00	

Extras

Code	Description	Price SGD	
1001	FRT NO PLATE	35.00*	✓
1002	CAMERA LENS/HOLDER	160.00*	?
Total Extras		195.00	

Code	Description	WU	Price SGD
670051)	R + R LEFT FRONT DOOR	6.0	25.20
NO NUMBER	R + R L/F STEP	3.0	12.60
670051)	RENEW L/F DOOR (DOOR REMOVED) INCLUDES: CONVERT ATTACHED PARTS, RENEW IF NECESSARY	12.0	50.40
752051	R + R LEFT MIRROR	4.0	16.80
670051)	R + R RIGHT FRONT DOOR	6.0	25.20
743201)	DETACH + REFIT HEADLINING INCLUDES: R + R INSIDE MIRROR, PILLAR TRIMS AND SEAT BELTS	4.0	16.80
NO NUMBER	R + R L/F LOWER DOOR SEAL	2.0	8.40
NO NUMBER	R + R R/F LOWER DOOR SEAL	2.0	8.40
743511)	R + R FRONT FLOOR CARPET	2.0	8.40
711041 ZAX	R + R L/SEAT	2.0	8.40
711041 ZAX	R + R R/SEAT	2.0	8.40
870031)	R + R HEATING CPL	12.0	50.40
870151N	R + R BLOWER (HEATER REMOVED)	16.0	67.20
NO NUMBER	R + R EVAPORATOR	4.0	16.80
550451)	R + R INSTRUMENT PANEL	9.0	37.80
550451)	RENEW INSTRUMENT PANEL (REMOVED)	4.0	16.80
NO NUMBER	R + R INSTRUMENT PANEL CARRIER (REMOVED)	2.0	8.40
850161)	R + R WIPER MOTOR (WIPER UNIT REMOVED)	1.0	4.20
850171)	R + R WIPER LINKAGE	1.0	4.20
002019)	DRAIN + REFILL COOLANT	3.0	12.60
441101	R + R STEERING WHEEL	2.0	8.40
NO NUMBER	R + R COMPRESSOR-/CONDENSER PIPE	3.0	12.60
NO NUMBER	R + R COMPRESSOR-/EVAPORATOR PIPE	3.0	12.60
002889 ZAX	DRAIN AND REFILL AIR CONDITIONING	7.0	29.40
1006	FRIDGE BOX/CTRL BOX REMOVE&REFIT	10.0*	42.00
0911	L/OUTER A-PILLAR REPAIR	40 50.0*	210.00
0931	FRONT PANEL REPAIR	40 50.0*	210.00
2296	FRONT FLOOR PANEL REPAIR	20 30.0*	126.00
1003	CHECK ABS SYSTEM REPAIR	20.0* ?	84.00 ?
1004	REALIGN CABIN REPAIR	20 30.0*	126.00
1005	REPROGRAMME SYSTEM REPAIR	20.0* ?	84.00 ?
Labour Cost		Hrs	WU
Panel / Mechanical Labour		41.60	416.0
Total of Labour			1,747.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRONT BUMPER NEW PART PAINTING	12.0
	L/F BUMPER BRACKET NEW PART PAINTING	6.0
	R/F BUMPER BRACKET NEW PART PAINTING	6.0
	COMPL LWR FRT PANEL NEW PART PAINTING	30.0
	UPPER FRONT PANEL NEW PART PAINTING	8.0
	L/F LOWER END PANEL NEW PART PAINTING	6.0
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	GRILLE NEW PART PAINT K1R	5.0
	L/OUTER A-PILLAR REPAIR PAINTING >50%	15.0

Final Calculation

	SGD	SGD
Parts		
Total Parts	7,145.00	7,145.00
Labour Time Base 10 WU/h		
Total 416.0 WU X 42.00 SGD/h	1,747.20	1,747.20
Total of Labour		1,747.20
Total Of Extras		195.00
Paint Work Time Base 10 WU/h		
Labour Cost 155.0 WU X 42.00 SGD/h	651.00	
Material Cost	222.38	
Total Paint Including Material		873.38
Repair Cost Excludes GST		9,960.58
GST (+7.0%)		697.24
Repair Cost Included GST		10,657.82

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☒
Underbody ☐

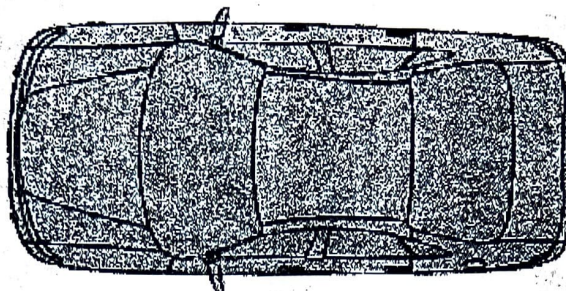

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RENEW FRONT PANEL		60.0	252.00
NO NUMBER	R + R BADGE		2.0	8.40
NO NUMBER	REMOVE AND REFIT L/OUTER WHEELHOUSE		2.0	8.40
520011)	R + R FRONT BUMPER		4.0	16.80
520011)	RENEW FRONT BUMPER (REMOVED)		2.0	8.40
	INCLUDES: REQUIRED ATTACHED PARTS			
	REMOVE AND REFIT			
751011	R + R RADIATOR GRILLE		3.0	12.60
810121Y)	R + R LEFT HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
810121Y)	R + R RIGHT HEADLAMP		1.0	4.20
	(RADIATOR GRILLE REMOVED)			
810151A	ADJUST HEADLAMPS		3.0	12.60
NO NUMBER	R + R L/F LOWER CLOSING PANEL		1.0	4.20
NO NUMBER	R + R R/F LOWER CLOSING PANEL		1.0	4.20
554011)	R + R WINDSCREEN		14.0	58.80
	INCLUDES: R + R SUN VISORS, UPPER FRONT PANEL AND A-PILLAR TRIMS			

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	358N
Vehicle Details	
Vehicle No.:	YQ5194E
Vehicle to be Exported:	No
Intended Deregistration Date:	05 Oct 2022
Vehicle Make:	TOYOTA
Vehicle Model:	DYNA 150 5MT
Primary Colour:	White
Manufacturing Year:	2021
Engine No.:	1GD8809300
Chassis No.:	JHHAGV46X0K001184
Maximum Power Output:	-
Open Market Value:	\$31,609.00
Original Registration Date:	30 Nov 2021
First Registration Date:	30 Nov 2021
Transfer Count:	0
Actual ARF Paid:	\$1,581.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	29 Nov 2031
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$34,589.00
COE Rebate Amount:	\$31,648.00
Total Rebate Amount:	\$31,648.00

The information contained herein is correct as at 05 Oct 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 05/10/2022 17:03 (SGT)
Reported by Driver
Date of Accident 02/10/2022 18:40 (SGT)
Exact Location of Accident Singapore
Additional Location Information SERANGOON ROAD
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number YQ5194E
INSURED/POLICYHOLDER
Is company? Yes
Name Of Registered Owner YONG SENG HENG PTE LTD
Company Reg No 2XXXXX358N
Email Address ysh80532@yahoo.com.sg
Mobile Phone No (Phone) +65-97929678
Alternative Phone No

VEHICLE PARTICULARS

Manufacturer Toyota
Model DYNA 150 SMT
Variant
Exact purpose for which vehicle was being used at time of accident Employment
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Commercial vehicle
Transmission Manual
CC 2755

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMCVSNW00149082100

DRIVER

Name of Driver RAJENDRAN CHANDRAKANTH
Passport No/FIN GXXXX921W
Date Of Birth 09/04/1986
Occupation Outdoor

 Accident report SC1122A50006


Describe Circumstance of the Accident

** NOTE : PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14 DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

(/) Claim Own Policy () Claim Third party () Reporting Only

() Claim OD/ TP at other workshop ()

Sketch Plan

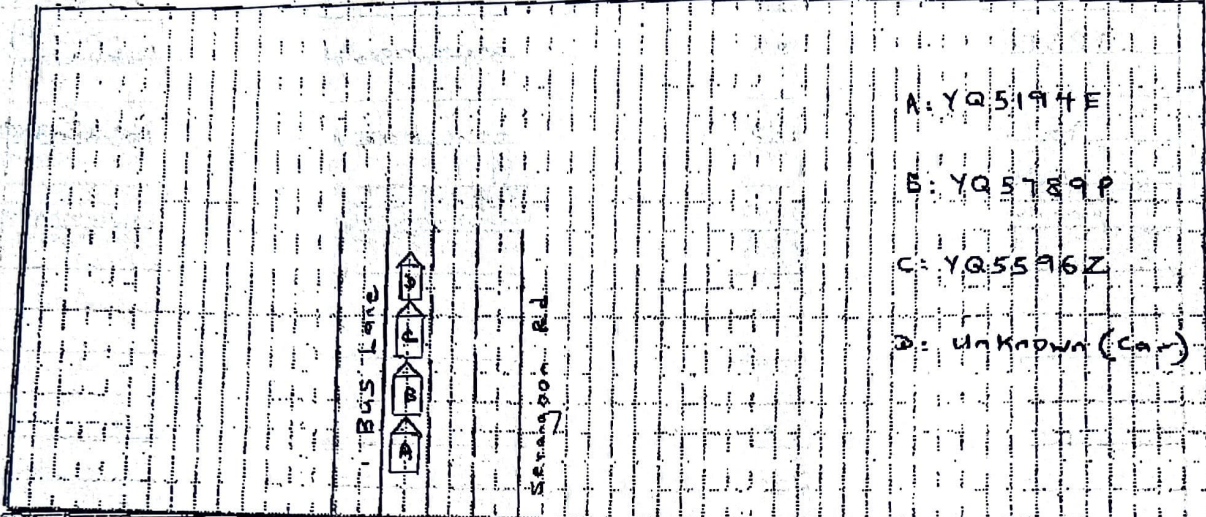

DOA: 2/10/22 6:40pm

I could not stop on time & had collided onto YQ5789P.

Upon alight I realised was involved in chain collision of 4 vehicles.

Declaration

I/We declare the foregoing particulars are true in every respect.

Yong Seng Heng Pte Ltd

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)