



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2304379
3 ANSON ROAD #16-00	INV Date	10/07/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22010039/Aya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMP 4205L
Insured Veh.	SJU 3756D
Claim No.	SNM22D204977/C02
Policy No.	DMPCSNW00124352203
Accident Date	15/07/2022
Inspection Date	04/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22010039/Aya3q2 Date: 10/07/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJU 3756D	Veh. Inspected	SMP 4205L
Policy No.	DMPCSNW00124352203	Coverage (\$)	0.00
Claim No.	SNM22D204977/C02	Excess (\$)	0.00
Assign From		Assign Date	04/10/2022
2. Vehicle Particulars & Condition			
Make & Model	SUBARU WRX	c.c	2457
Engine No.	HIDDEN	Year of Reg.	2006
Chassis No.	JF1GDGKD36G049905	Colour	PINK
Odometer	275198 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	245/45 R17	BRIDGESTONE	6 mm
L/H Front Tyre	245/45 R17	BRIDGESTONE	6 mm
R/H Rear Tyre	245/45 R17	BRIDGESTONE	6 mm
L/H Rear Tyre	245/45 R17	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	15/07/2022	Inspection Date	04/10/2022
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 4205L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	TORN	985.60	654.00
1	FRONT BUMPER LOWER GRILLE	NOT NECESSARY	198.60	-
2	FRONT BUMPER SIDE RETAINERS @\$98.60	NOT NECESSARY	197.20	-
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	30.00
2	FRONT BUMPER SIDE AIRVENTS @\$75.60	NOT NECESSARY	151.20	-
2	FRONT BUMPER FOG LAMP @\$544.80	NOT NECESSARY	1,089.60	-
2	FRONT BUMPER FOG LAMP COVER @\$128.60	NOT NECESSARY	257.20	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	478.90	-
1	FRONT BUMPER CENTRE GRILLE	CRACKED	345.80	240.00
1	FRONT BUMPER CENTRE GRILLE LOGO	NECESSARY	94.50	45.00
1	FRONT BUMPER SPONGE	CRACKED	244.50	125.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	487.90	-
2	FRONT BUMPER SIDE GRILLE @\$225.80	CRACKED	451.60	451.60
2	FRONT BUMPER WASHER COVER @\$68.90	NOT NECESSARY	137.80	-
2	FRONT BUMPER TOWING COVER @\$25.60	NOT NECESSARY	51.20	-
2	HEADLAMP @\$2850.40	NOT NECESSARY	5,700.80	-
2	HEADLAMP BOTTOM RETAINER @\$64.80	NOT NECESSARY	129.60	-
2	SET HEADLAMP CLIPS @\$30.00	NOT NECESSARY	60.00	-
1	FRONT BONNET	NOT NECESSARY	1,489.60	-
1	FRONT BONNET INNERLOCK	NOT NECESSARY	98.50	-
1	FRONT BONNET LOCK BRACE PANEL	NOT NECESSARY	89.70	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	798.50	-
1	FRONT SUPPORT PANEL TOP GARNISH	NOT NECESSARY	185.60	-
	LESS 20% DISCOUNT		-2,754.78	-309.12
			11,019.12	1,236.48
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT NUMBER PLATE WITH CASING (SN)	CRACKED	50.00	50.00
3	SET FRONT GRILLE CLIPS (SN)	NECESSARY	80.00	20.00
1	SET FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	30.00	-
			160.00	70.00

Report Ref No. CC6/CTI22010039/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.		1,200.00	200.00
	SPRAY PAINTING (SPECIAL PAINT).		1,200.00	200.00
	CHECK WIRING ON HEADLAMP AND FOCUSSING.	NOT NECESSARY	100.00	-
	ANTI RUST.	NOT NECESSARY	100.00	-
			2,600.00	400.00
	GRAND TOTAL		13,779.12	1,706.48
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,300.00

Report Ref No. CC6/CTI22010039/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4205L

INSPECTION

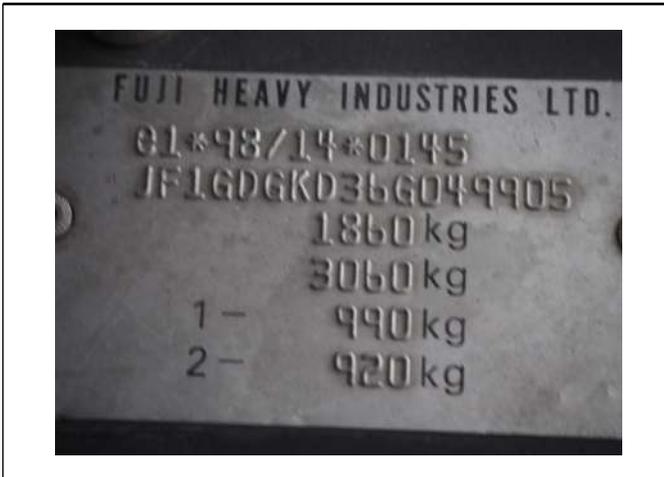



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

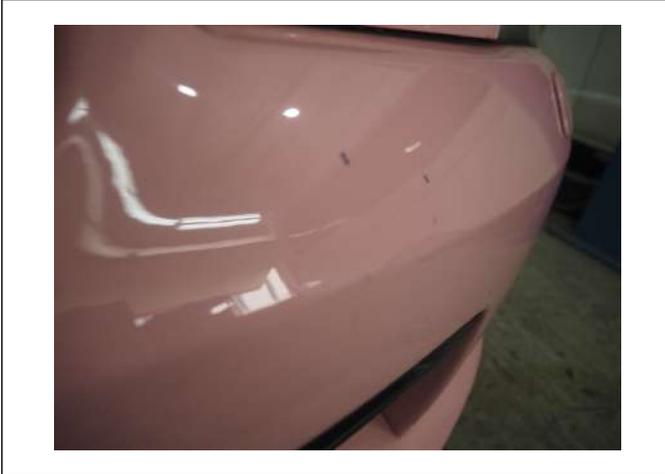



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4205L

RE-INSPECTION

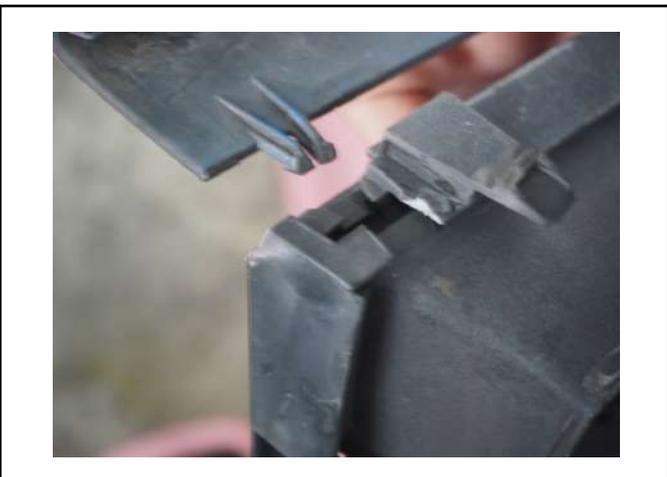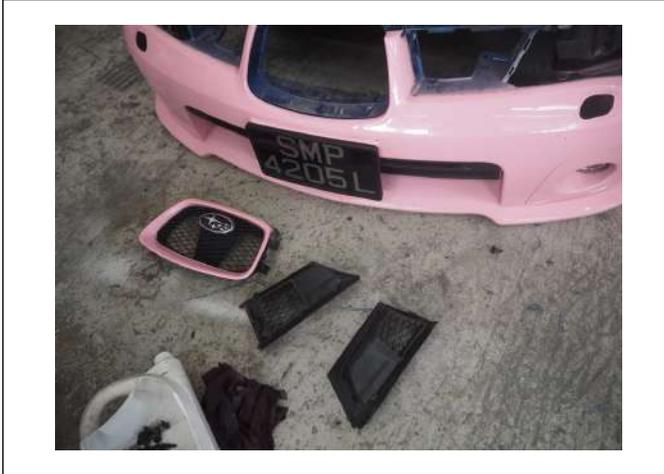



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 4205L

RE-INSPECTION

